

GIS REGISTRY INFORMATION

SITE NAME: Haldemann Property
BRRTS #: 03-11-211076 **FID # (if appropriate):** _____
COMMERCE # (if appropriate): 53935-9999-04
CLOSURE DATE: 22-Nov-2006
STREET ADDRESS: 104 Madison Street
CITY: Friesland

SOURCE PROPERTY GPS COORDINATES (meters in WTM91 projection): X= 595330 Y= 346542

CONTAMINATED MEDIA: Groundwater Soil Both

OFF-SOURCE GW CONTAMINATION >ES: Yes No

IF YES, STREET ADDRESS 1: 112 E. Winnebago Street

GPS COORDINATES (meters in WTM91 projection): X= 595323 Y= 346580

OFF-SOURCE SOIL CONTAMINATION >Generic or Site-Specific RCL (SSRCL): Yes No

IF YES, STREET ADDRESS 1: 112 E. Winnebago Street

GPS COORDINATES (meters in WTM91 projection): X= _____ Y= _____

CONTAMINATION IN RIGHT OF WAY: Yes No

DOCUMENTS NEEDED:

- Closure Letter, and any conditional closure letter or denial letter issued
- Copy of most recent deed, including legal description, for all affected properties
- Certified survey map or relevant portion of the recorded plat map (if referenced in the legal description) for all affected properties
- County Parcel ID number, if used for county, for all affected properties
- Location Map which outlines all properties within contaminated site boundaries on USGS topographic map or plat map in sufficient detail to permit the parcels to be located easily (8.5x14" if paper copy). If groundwater standards are exceeded, the map must also include the location of all municipal and potable wells within 1200' of the site.
- Detailed Site Map(s) for all affected properties, showing buildings, roads, property boundaries, contaminant sources, utility lines, monitoring wells and potable wells. (8.5x14", if paper copy) This map shall also show the location of all contaminated public streets, highway and railroad rights-of-way in relation to the source property and in relation to the boundaries of groundwater contamination exceeding ch. NR 140 ESs and soil contamination exceeding ch. NR 720 generic or SSRCLs.
- Tables of Latest Groundwater Analytical Results (no shading or cross-hatching)
- Tables of Latest Soil Analytical Results (no shading or cross-hatching)
- Isoconcentration map(s), if required for site investigation (SI) (8.5x14" if paper copy). The isoconcentration map should have flow direction and extent of groundwater contamination defined. If not available, include the latest extent of contaminant plume map.
- GW: Table of water level elevations, with sampling dates, and free product noted if present
- GW: Latest groundwater flow direction/monitoring well location map (should be 2 maps if maximum variation in flow direction is greater than 20 degrees)
- SOIL: Latest horizontal extent of contamination exceeding generic or SSRCLs, with one contour
- Geologic cross-sections, if required for SI. (8.5x14" if paper copy)
- RP certified statement that legal descriptions are complete and accurate
- Copies of off-source notification letters (if applicable)
- Letter informing ROW owner of residual contamination (if applicable)(public, highway or railroad ROW)
- Copy of (soil or land use) deed restriction(s) or deed notice if any required as a condition of closure
- Copy of any maintenance plan referenced in the deed restriction.



State of Wisconsin \ DEPARTMENT OF NATURAL RESOURCES

Jim Doyle, Governor
Scott Hassett, Secretary
Lloyd L. Eagan, Regional Director

South Central Region Headquarters
3911 Fish Hatchery Road
Fitchburg, Wisconsin 53711-5397
Telephone 608-275-3266
FAX 608-275-3338
TTY Access via relay - 711

November 22, 2006

Ed Haldemann
721 Lakeshore Drive
Beaver Dam, WI 53916

SUBJECT: Final Case Closure
Haldemann Property (Former Friesland Motors), 104 Madison Street,
Friesland, WI
WDNR BRRTS Activity #: 03-11-211076

Dear Mr. Haldemann:

On September 25, 2006, the South Central Region Closure Committee reviewed the above referenced case for closure. This committee reviews environmental remediation cases for compliance with state laws and standards to maintain consistency in the closure of these cases. Based on the correspondence and data provided, it appears that your case has been remediated to Department standards in accordance with s. NR 726.05, Wisconsin Administrative Code. The Department considers this case closed and no further investigation or remediation is required at this time.

Please be aware that pursuant to s. 292.12 Wisconsin Statutes, compliance with the requirements of this letter is a responsibility to which you (or the current property owner, if different) and any subsequent property owners must adhere. If these requirements are not followed or if additional information regarding site conditions indicates that contamination on or from the site poses a threat to public health, safety, welfare, or the environment, the Department may take enforcement action under s. 292.11 Wisconsin Statutes to ensure compliance with the specified requirements, limitations or other conditions related to the property or this case may be reopened pursuant to s. NR 726.09, Wis. Adm. Code.

Residual soil contamination remains in the vicinity of the former petroleum underground storage tank basins, north and east of the on-site building, and extends in the Madison Street right-of-way and to the property at 112 E. Winnebago Street as indicated in the information submitted to the Department of Natural Resources. If soil in the specific locations described above is excavated in the future, the property owner at the time of excavation must sample and analyze the excavated soil to determine if residual contamination remains. If sampling confirms that contamination is present the property owner at the time of excavation will need to determine whether the material would be considered solid or hazardous waste and ensure that any storage, treatment or disposal is in compliance with applicable standards and rules. In addition, all current and future owners and occupants of the property need to be aware that excavation of the contaminated soil may pose an inhalation or other direct contact hazard and as a result special precautions may need to be taken to prevent a direct contact health threat to humans.

Due to the presence of residual soil and groundwater contamination, your site and the property at 112 E. Winnebago Street will be listed on the DNR Remediation and Redevelopment GIS

Registry of Closed Remediation Sites. Information that was submitted with your closure request application will be included on the GIS Registry. To review the sites on the GIS Registry web page, visit <http://dnr.wi.gov/org/aw/rr/gis/index.htm>. If your property is listed on the GIS Registry because of remaining contamination and you intend to construct or reconstruct a well, you will need prior Department approval in accordance with s. NR 812.09(4)(w), Wis. Adm. Code. To obtain approval, Form 3300-254 needs to be completed and submitted to the DNR Drinking and Groundwater program's regional water supply specialist. This form can be obtained on-line <http://www.dnr.state.wi.us/org/water/dwg/3300254.pdf> or at the web address listed above for the GIS Registry.

The Department appreciates your efforts to restore the environment at this site. If you have any questions regarding this closure decision or anything outlined in this letter, please contact me at (608) 275-3209.

Sincerely,



Denise Nettlesheim
Hydrogeologist
Bureau for Remediation & Redevelopment

cc: Jason Powell, METCO, 2956 Airport Road, La Crosse, WI 54603
Case File



State of Wisconsin \ DEPARTMENT OF NATURAL RESOURCES

Jim Doyle, Governor
Scott Hassett, Secretary
Lloyd L. Eagan, Regional Director

South Central Region Headquarters
3911 Fish Hatchery Road
Fitchburg, Wisconsin 53711-5397
Telephone 608-275-3266
FAX 608-275-3338
TTY Access via relay - 711

September 27, 2006

Ed Haldemann
721 Lakeshore Drive
Beaver Dam, WI 53916

Subject: Conditional Closure Decision With Requirements to Achieve Final Closure
Haldemann Property (Former Friesland Motors), 104 Madison Street,
Friesland, WI
WDNR BRRTS Activity # 03-11-211076

Dear Mr. Haldemann:

On September 25, 2006, the South Central Region Closure Committee reviewed your request for closure of the case described above. The Closure Committee reviews environmental remediation cases for compliance with state rules and statutes to maintain consistency in the closure of these cases. After careful review of the closure request, the Closure Committee has determined that the petroleum contamination on the site from the former underground storage tanks (USTs) that were located on the property appears to have been investigated and remediated to the extent practicable under site conditions. Your case has been remediated to Department standards in accordance with s. NR 726.05, Wis. Adm. Code and will be closed if the following conditions are satisfied:

MONITORING WELL ABANDONMENT

The monitoring wells and borings at the site must be properly abandoned in compliance with ch. NR 141, Wis. Adm. Code. Documentation of well abandonment must be submitted to me on Form 3300-5B found at www.dnr.state.wi.us/org/water/dwg/gw/ or provided by the Department of Natural Resources.

PURGE WATER, WASTE AND SOIL PILE REMOVAL

Any remaining purge water, waste and/or soil piles generated as part of site investigation or remediation activities must be removed from the site and disposed of or treated in accordance with Department of Natural Resources' rules. Once that work is completed, please send appropriate documentation regarding the treatment or disposal of the remaining purge water, waste and/or soil piles.

When the above conditions have been satisfied, please submit the appropriate documentation (for example, well abandonment forms, disposal receipts, copies of correspondence, etc.) to verify that applicable conditions have been met, and your case will be closed. Your site along with the adjacent Cliff's Inc. property located at 112 E. Winnebago Street will be listed on the DNR Remediation and Redevelopment GIS Registry of Closed Remediation Sites. Information that was submitted with your closure request application will be included on the GIS Registry. To review the site on the GIS Registry web page, visit <http://maps.dnr.state.wi.us/brrts>.

As indicated in the information submitted to the Department, soil and groundwater petroleum

contamination remains on the subject property, the property at 112 E. Winnebago Street, and the Madison Street right of way. Groundwater monitoring data indicate exceedances of ch. NR 140, Wis. Adm. Code, Enforcement Standards and soil petroleum contamination exceeds ch. NR 720, Wis. Adm. Code, generic residual contaminant levels (RCLs) remains in the vicinity of the former USTs basins, north and east of the on-site building. If soil in these locations are excavated in the future, the property owner at that time will be required to sample and analyze the excavated soil in order to determine whether the contamination still remains. The owner will also have to properly store, treat, or dispose of any excavated materials, based upon the results of that characterization, and take special precautions during excavation activities to prevent a direct contact threat to humans. All future owners and occupants of this property need to be aware that excavation of the contaminated soil may pose an inhalation or other direct contact hazard at the time of excavation.

If this is a PECFA site, section 101.143, Wis. Stats., requires that PECFA claimants seeking reimbursement of interest costs, for sites with petroleum contamination, submit a final reimbursement claim within 120 days after they receive a closure letter on their site. For claims not received by the PECFA Program within 120 days of the date of this letter, interest costs after 60 days of the date of this letter will not be eligible for PECFA reimbursement.

Please be aware that the case may be reopened pursuant to s. NR 726.09, Wis. Adm. Code, if additional information regarding site conditions indicates that contamination on or from the site poses a threat to public health, safety, or welfare or to the environment.

We appreciate your efforts to restore the environment at this site. If you have any questions regarding this letter, please contact me at (608) 275-3209.


Sincerely,




Denise Nettlesheim
Hydrogeologist
Bureau for Remediation & Redevelopment

cc: Jason Powell, METCO, 2956 Airport Road, La Crosse, WI 54603
Case File

TOPOI map printed on 05/25/06 from "Wisconsin.tpo" and "Untitled.tpg"

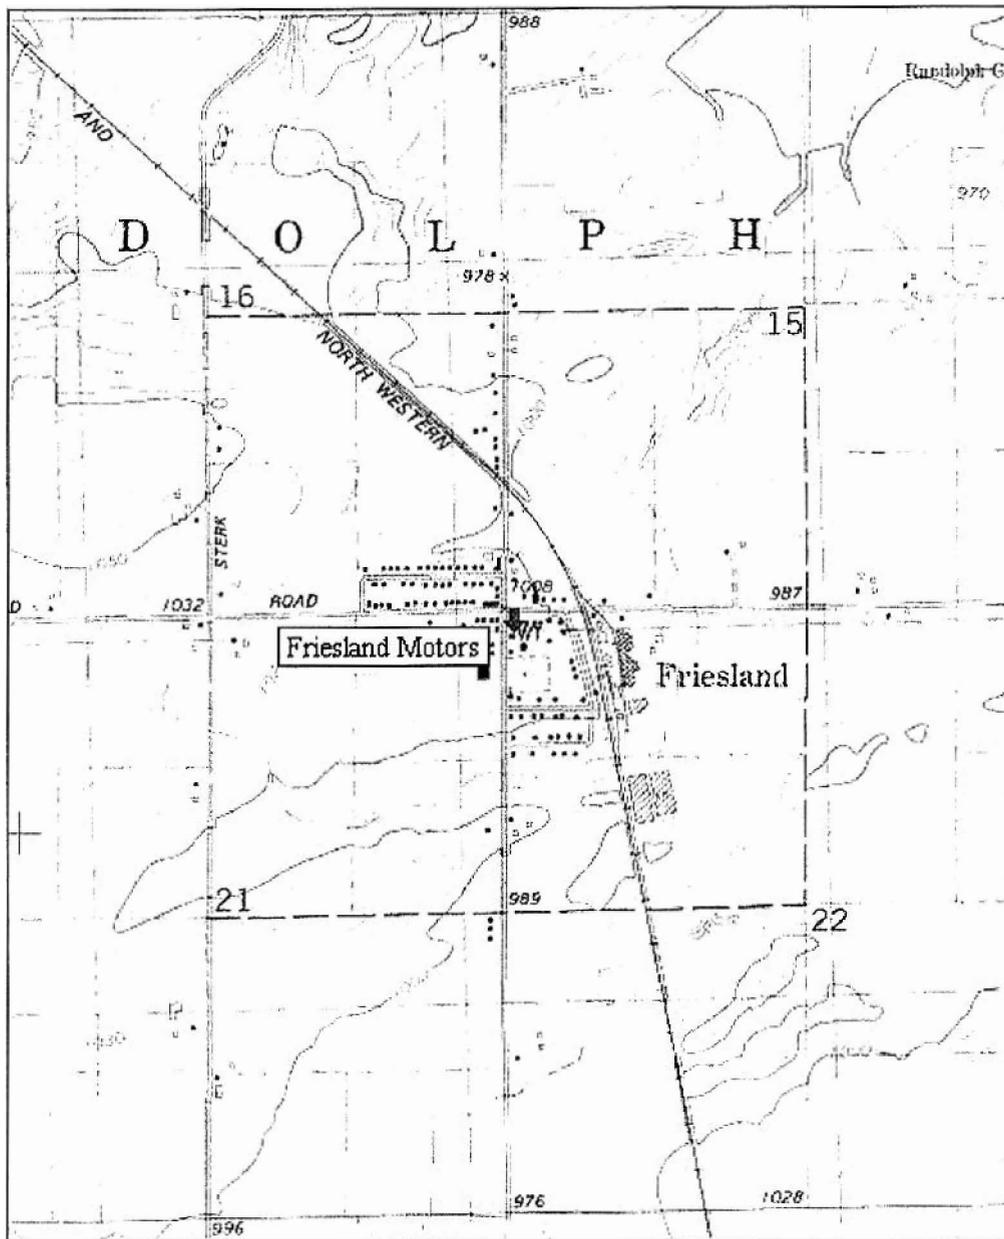


MN TN
2 1/2°

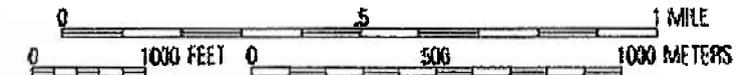

Printed from TOPOI ©2001 National Geographic Holdings (www.topo.com)

SITE LOCATION MAP – CONTOUR INTERVAL 10 FEET
FRIESLAND MOTORS – FRIESLAND, WI
SEAMLESS USGS TOPOGRAPHIC MAPS ON CD-ROM

Environmental Consulting, Fuel System Design, Installation and Service

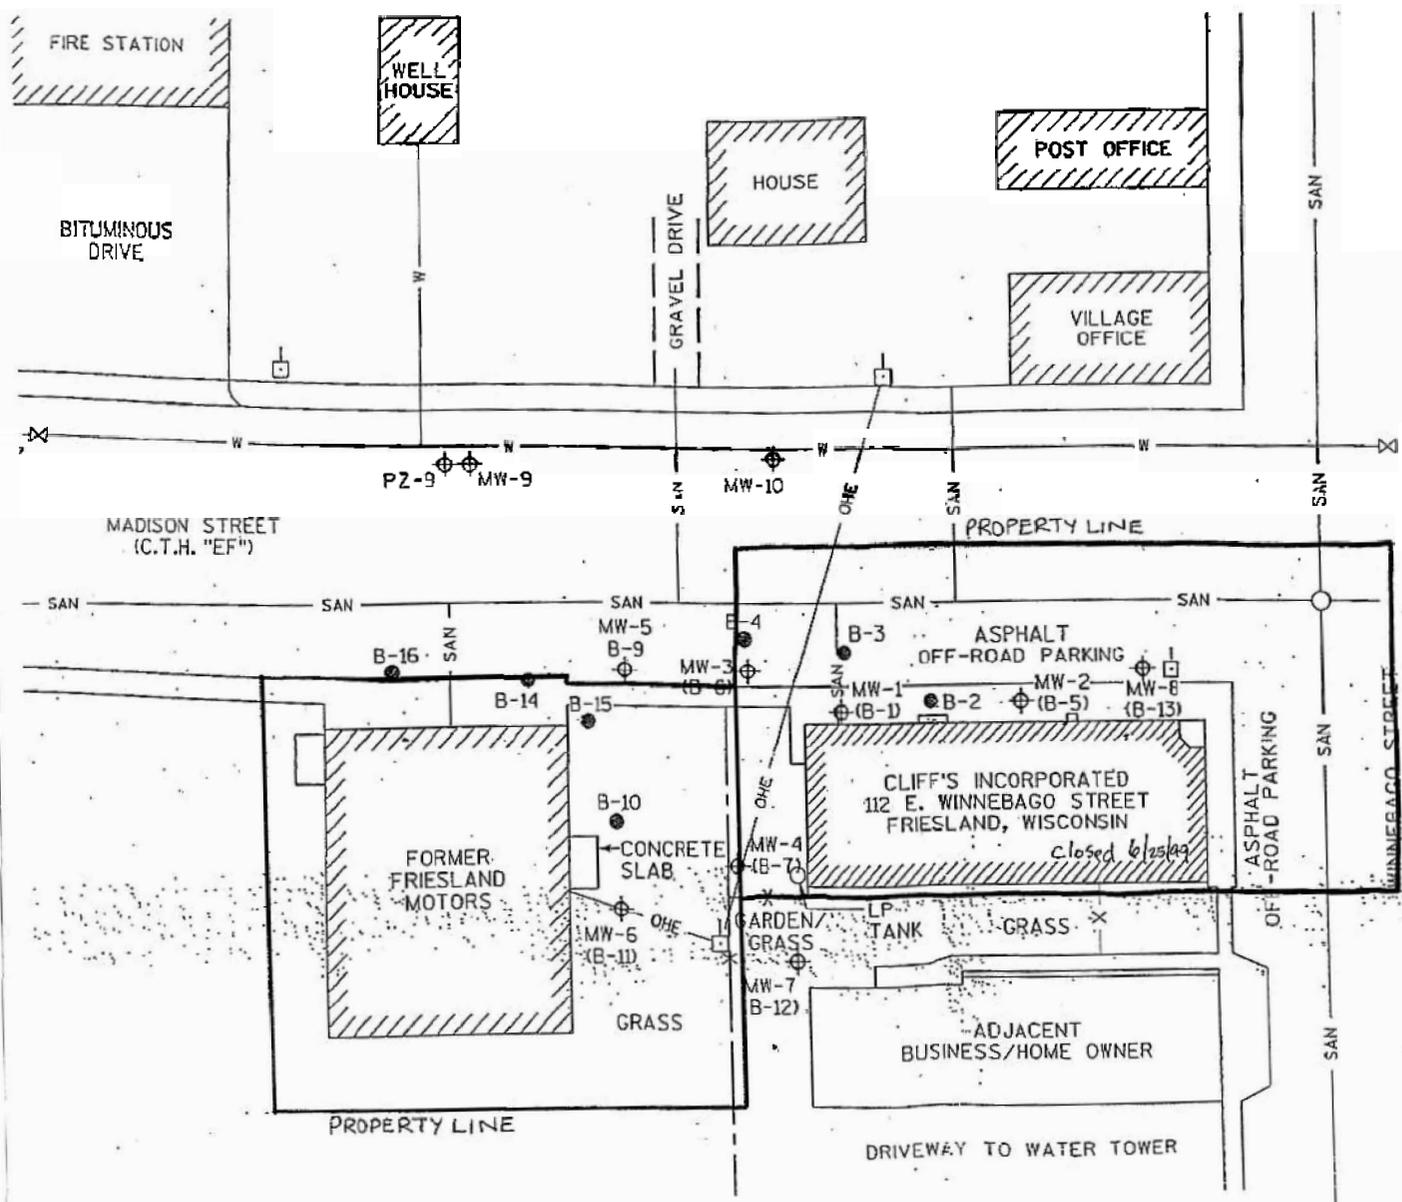

LEGEND

- SOIL BORING
- ⊕ MONITORING WELL

NOTE:
FOR ADDITIONAL NOTES
AND LEGEND, REFER
TO FIGURE 2.

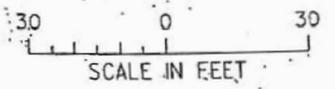


FIGURE 3

MONITORING WELL AND
SOIL BORING LOCATIONS
FORMER FRIESLAND MOTORS
FRIE SLAND, WISCONSIN

MSA PROFESSIONAL ENGINEERING
TRANSPORTATION • MUNICIPAL • RECREATION
DEVELOPMENT • ENVIRONMENTAL
230 South Boulevard, Baraboo, WI 53203
608-338-2111 • 1-800-362-9505 • FAX 608-338-2111

DRAWN BY: RHM DATE: 1-7-04 SHEET: _____ OF _____
CHECKED BY: SCALE: AS NOTED FILE NO.: 212789CC

Modified By METCO/LB 6/6/06

Friesland Motors

Property Address: 104 Madison Street, Friesland, WI 53935

Property Owner: Ed Haldemann

Columbia County Warranty Deed

Deed Recorded: Volume 269, Page 554

Geographical Position (WTM91 projection): 595330, 346542

Soil and Groundwater Contamination

Cliff's Incorporated Property

Property Address: 112 E. Winnebago Street

Property Owner: Terry E. & Diane S. Dykstra

Columbia County Parcel ID No.: 11127VFS 147

Deed Recorded: Volume 537, Page 422

Geographical Position (WTM91 projection): 595323, 346580

Soil and Groundwater Contamination

Adelia Bobholz and Lorraine Bobholz themselves and their heirs, executors and administrators, do covenant, grant, bargain, and agree to and with the said parties of the second part, and to and with the survivor of them, his or her heirs and assigns, that at the time of the ensembling and delivery of these presents they are well seized of the premises above described, as of a good, sure, perfect, absolute and indefensible estate of inheritance in the law, in fee simple, and that the same are free and clear from all incumbrances whatever,

and that the above bargained premises in the quiet and peaceable possession of the said parties of the second part, as joint tenants, his or her heirs and assigns, against all and every person or persons lawfully claiming the whole or any part thereof, they will forever WARRANT AND DEFEND.

In Witness Whereof, the said part 1st. of the first part has hereunto set their hands and seals this 7th day of AUGUST, A. D., 19 58.

Signed, Sealed and Delivered in Presence of
Emery Paul.
Barbara Onley.
Paul Bobholz
Leona Bobholz
Adelia Bobholz
Lorraine Bobholz

STATE OF WISCONSIN, Green Lake County, ss.

Personally came before me, this 7th day of August, A. D., 19 58,

the above named Paul Bobholz, Leona Bobholz, Adelia Bobholz and Lorraine Bobholz

to me known to be the person who executed the foregoing instrument and acknowledged the same.

Court Commissioner GREEN LAKE COUNTY WIS. Notary Public, County, Wis.

My Commission expires 19

INDEXED RECORDED

Section 39.21 (Part of the Wisconsin Statutes provides that all instruments to be recorded shall have plainly printed or typewritten thereon the names of the grantors, grantees, witnesses and notary)

293940, No. Paul and Leona Bobholz

Adelia Bobholz and Lorraine Bobholz TO Edw. Haldeman and Evelyn Haldeman.

WARRANTY DEED

REGISTER'S OFFICE, STATE OF WISCONSIN, Columbia County.

Received for Record this 8 day of Jan A. D., 19 59, at 4:20 o'clock P. M., and recorded in Vol. 269 of Deeds on page 553

Bernard J. Amend Register of Deeds 7K Deputy

James Daley

file copy

293949

This Indenture, Made this 7th day of August, in the year

of our Lord, one thousand nine hundred and 58 between Paul Bobholz and

Leona Bobholz, his wife: Adelia Bobholz, and Lorraine Bobholz

parties of the first part,

and Edw. Haldeman and Evelyn Haldeman

of Friesland, Wisconsin

husband and wife, as joint tenants, parties of the second part.

Witnesseth, That the said parties of the first part, for and in consideration of the sum of Nine thousand & 00/100 (\$9,000.00) Dollars,

to in hand paid by the said parties of the second part, the receipt whereof is hereby confessed and acknowledged, have given, granted, bargained, sold, remised, released, aliened, conveyed and confirmed, and by these presents do give, grant, bargain, sell, remise, release, alien, convey and confirm unto the said parties of the second part, as joint tenants, the following described real estate, situated in the County of

Columbia and State of Wisconsin, to-wit:

Commencing at a point 134 feet South of the Northwest corner of Section 22, Township 13 North, Range 12 East, thence running South 95 feet, thence East 118 feet, thence North 95 feet, thence West 118 feet, to place of beginning.



This instrument drafted by: Emery Paul, Attorney, Markesan, Wisconsin.

Together with all and singular the hereditaments and appurtenances thereunto belonging or in any wise appertaining; and all the estate, right, title, interest, claim or demand whatsoever, of the said parties of the first part, either in law or equity, either in possession or expectancy of, in and to the above bargained premises, and their hereditaments and appurtenances.

To have and to hold the said premises as above described, with the hereditaments and appurtenances, unto the said parties of the second part, as joint tenants.

Vol 37 422

558271

STATE BAR OF WISCONSIN FORM 1 - 1982
WARRANTY DEED

DOCUMENT NO. ...

STATE OF WISCONSIN } SS
COLUMBIA COUNTY }
RECEIVED FOR RECORD

JUL 30 1996

Danny Jull

Reg. of Deeds at 8:00 A M

This Deed, made between Cliff's, Inc., a Wisconsin Corporation, and Dennis W. Dykstra and La Dykstra, as tenants in common
Grantor,
and Terry E. Dykstra and Diane S. Dykstra,
husband and wife as survivorship marital
property
Grantee,

Witnesseth, That the said Grantor, for a valuable consideration

conveys to Grantee the following described real estate in Columbia
County, State of Wisconsin:

Cliff's, Inc., hereby conveys an undivided one-third (1/3) interest and Dennis W. Dykstra and Larry A. Dykstra, in their individual capacity, hereby convey and undivided two-thirds (2/3) interest in the following described property:

A parcel of land beginning on the Northwest corner of Section 22, Township 13 North, Range 12 East, Columbia County, Wisconsin, thence running 67 feet East, thence 134 feet South, thence 67 feet West, thence North 134 feet to place of beginning, now part of the Village of Friesland.

THIS SPACE RESERVED FOR RECORDING DATA
NAME AND RETURN ADDRESS
Reif & Kendall
P.O. Box 153
Randolph, WI 53956

11127VFS 147
PARCEL IDENTIFICATION NUMBER

Transfer fee
24.00
NT7

This is not homestead property.
(is) (is not)

Together with all and singular the hereditaments and appurtenances thereunto belonging;
And Grantor

warrants that the title is good, indefeasible in fee simple and free and clear of encumbrances except municipal and zoning ordinances, recorded easements for public utilities, recorded building and use restrictions and covenants

and will warrant and defend the same.

Dated this 18th day of June, 1996

Cliff's, Inc.
[Signature] (SEAL)

• by: Dennis W. Dykstra, President

[Signature] (SEAL)

• by: Larry A. Dykstra, Secretary/
Treasurer

[Signature] (SEAL)

• Dennis W. Dykstra

[Signature] (SEAL)

• Larry A. Dykstra

AUTHENTICATION

Signature(s) Larry A. Dykstra

and Dennis W. Dykstra

authenticated this 18th day of June, 1996

[Signature]

• Scott R. Reif

TITLE: MEMBER STATE BAR OF WISCONSIN

(If not, authorized by 8706.06, Wis. Stats.)

ACKNOWLEDGMENT

State of Wisconsin, }
County: } ss.

Personally came before me this _____ day of _____, 19____, the above named

to me known to be the person _____ who executed the foregoing

THIS INSTRUMENT WAS DRAFTED BY

REIF & KENDALL LAW OFFICE

RANDOLPH, WISCONSIN

(Signatures may be authenticated or acknowledged. Both are not necessary.)


Instrument and acknowledge the same.

Notary Public, _____ County, Wis.

My commission is permanent. (If not, state expiration date: _____, 19____)

PLAT OF SURVEY

Part of the NE 1/4 of the NE 1/4 in Section 21
and part of the NW 1/4 of the NW 1/4 in Section 22,
all T.13 N., R.12 E., Village of Friesland, Columbia County, Wisconsin.

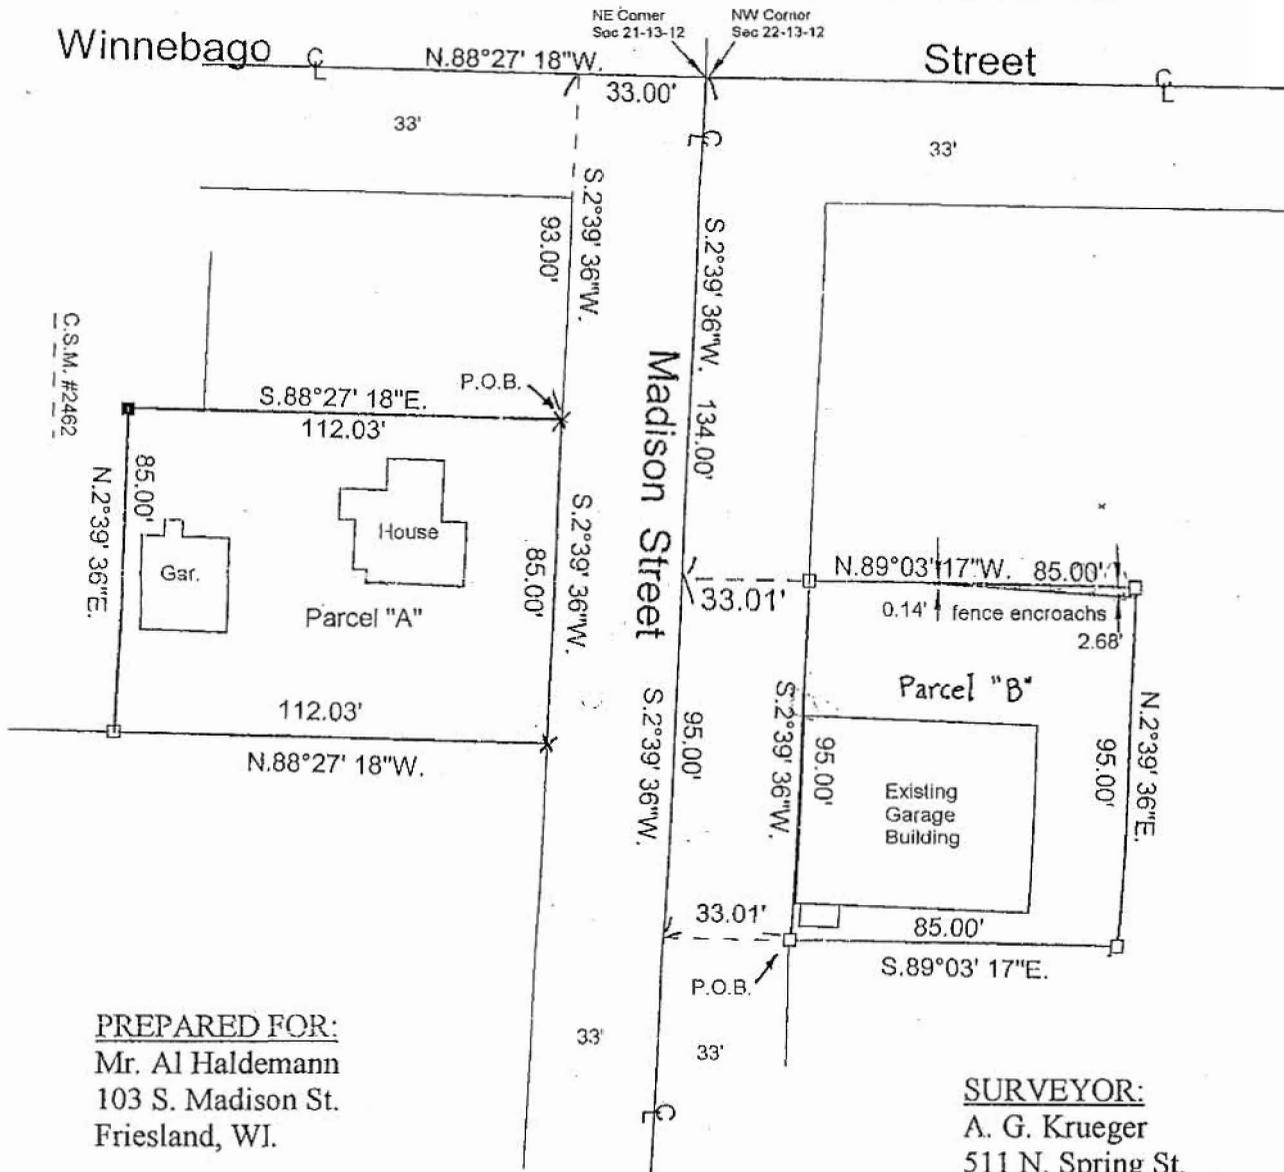


PREPARED FOR:
Mr. Al Haldemann
103 S. Madison St.
Friesland, WI.

SURVEYOR:
A. G. Krueger
511 N. Spring St.
Beaver Dam, WI.
920-887-7248



Scale of Map: 1 inch = 50'

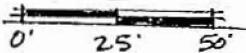

State of Wisconsin)
COLUMBIA County)

- | | | | |
|---|------------------|----------|---------------------------------------|
| ● | Iron Pipes Found | ○ | 1" x 24" Iron Pipes Set, 1.13 lb./ft. |
| ■ | Iron Rod Found | ○ | 2" x 30" Iron Pipes Set, 3.65 lb./ft. |
| ▲ | Iron Pins Found | □ | 3/4" x 24" Iron Rod Set 1.50 lb./ft |
| ⊗ | Stone Mon. Found | □ | 1 1/4" x 30" Iron Rod Set 4.17 lb./ft |
| ⊕ | B.C.A.M. | ▽ | Iron Pins Set |
| ○ | Soil Boring | (xxx.xx) | Recorded Dist. and/or Bearing |

I have surveyed the above-described property, and the above map is a true representation thereof and shows the size and location of the property, its exterior boundaries, the location of all visible structures thereon, fences apparent easements and visible encroachments, if any. This survey is made for the exclusive use of the present owners of the property, and also those who purchase, mortgage, or guarantee the title thereto, within one year from the date hereof, and as to them I certify the accuracy of said survey and map.

Dated this 16th day of August, 2002.

Registered Land Surveyor

**Groundwater Analytical Results Summary
Friesland Motors LUST Site**

Monitoring Well MW-1

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
6/28/1994	NM	NM	660	220	<10	120	2500	1330	3400
9/1/1994	NM	NM	1300	640	<50	340	2600	2120	5200
8/30/1995	NM	NM	7.5	5.8	1.8	15	6.9	62	33.9
5/15/1996	NM	NM	1.4	1.2	1.1	6.5	<1	8.5	7.8

Monitoring Well MW-2

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
6/28/1994	NM	NM	<25	<25	<25	50	<25	69	<25
9/1/1994	NM	NM	4	2.7	<2	9.9	<2	16.8	<6
8/30/1995	NM	NM	4.5	1.6	<1	1.4	7.2	3.9	6.3
5/15/1996	NM	NM	1.7	<1	<1	<1	<1	1.1	<1
4/30/1998	NM	NM	0.8	<0.32	<0.32	<0.35	<0.27	<0.27	<0.43
8/18/1998	NM	NM	1.5	<0.24	0.56	3.8	<0.21	<0.86	<0.97

Monitoring Well MW-3

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
6/28/1994	NM	NM	<1	<1	<1	<1	<1	<1	<1
9/1/1994	NM	NM	180	63	44	45	12	<10	<30
8/30/1995	NM	NM	36	11	19	3	11	4.8	11
5/15/1996	NM	NM	6.2	3.1	29	2.2	<1	<1	<1
4/30/1998	NM	NM	<0.26	<0.24	0.82	NS	<0.21	<0.86	<0.97
8/18/1998	NM	NM	<0.26	<0.24	0.4	NS	<0.21	<0.86	<0.97

Monitoring Well MW-4

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
6/28/1994	NM	NM	1500	520	150	29	48	270	220
9/1/1994	NM	NM	1000	410	140	180	<20	308	74
8/30/1995	NM	NM	24	1.2	22	1.8	<1	4.9	<1
5/15/1996	NM	NM	18	18	4.6	1.5	<1	15.4	1.2
4/30/1998	NM	NM	4.7	0.79	<0.32	<0.35	0.54	0.47	1.55
8/18/1998	NM	NM	340	22	21	46	1.6	102	33.8

Note: Bold type indicates an ES exceedance, *italics* indicates a PAL exceedance. NS = not sampled
NM = Not Measured

Groundwater Analytical Results Summary
Friesland Motors LUST Site

Monitoring Well MW-5

PVC Elevation = 1009.99 (FT) (MSL)

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
8/30/1995	NM	NM	9900	3500	1600	840	20000	3310	16700
5/15/1996	NM	NM	6500	3000	840	920	11000	940	10300
8/1/1996	NM	NM	6000	NS	670	960	8300	3260	10600
10/12/1999	NM	NM	1500	930	100	330	1600	2390	5400
12/7/2000	NM	NM	1300	2100	<40	770	2300	3700	8600
6/18/2001	NM	NM	380	660	<40	350	310	1880	1760
9/27/2001	NM	NM	790	840	<55	480	410	2370	3430
12/4/2001	NM	NM	1500	1900	<40	830	2000	3730	8800
3/19/2002	NM	NM	1500	2500	120	1100	2200	4140	8900
6/8/2002	NM	NM	1700	1600	<40	960	1400	3930	8600
12/11/2003	NM	NM	9800	3400	<300	1700	30000	2240	15000
1/11/2005	988.58	21.41	1150	2920	<20	1060	2150	4671	15500
4/11/2005	987.98	22.01	1100	3400	<11	1000	1700	4200	17000
7/6/2005	987.01	22.98	1060	3280	<18	930	2360	4209	14600
10/6/2005	985.78	24.21	780	3500	<5.5	820	560	3660	8700
1/6/2006	984.57	25.42	510	2700	<1.1	850	540	3080	7560
4/5/2006	983.94	26.05	490	3500	<5.5	1210	280	3900	11020

Monitoring Well MW-6

PVC Elevation = 1011.60 (FT) (MSL)

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)		
8/30/1995	NM	NM	570	380	5.2	160	180	1010	640		
5/15/1996	NM	NM	140	210	<1	79	9.8	122	76		
8/1/1996	NM	NM	860	270	5.6	110	120	533	229		
10/12/1999	NM	NM	34	21	0.5	7.4	5.9	29	29.9		
12/7/2000	NM	NM	<0.40	<0.40	<0.40	<1.0	<0.40	0.76	<0.70		
6/18/2001	NM	NM	<0.40	0.58	<0.40	<1.0	<0.40	1.5	<0.70		
9/27/2001	NM	NM	<0.10	<0.10	<1.1	<0.70	<0.10	<0.30	<0.20		
12/4/2001	NM	NM	3.6	2.9	<0.40	<1.3	3.1	6.1	15.8		
3/19/2002	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	0.81	<0.90		
6/8/2002	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.50	<0.90		
12/11/2003	NM	NM	<0.30	<0.40	<0.30	<0.60	<0.40	<0.30	<0.70		
1/11/2005	994.62	16.98	<0.29	<0.56	<0.2	<0.6	<0.57	<1.17	<1.74		
4/11/2005	997.28	14.32	NS	NS	NS	NS	NS	NS	NS		
7/6/2005	998.06	13.54	<0.26	<0.3	<0.36	<0.85	<0.52	<1.15	<1.17		
10/6/2005	996.39	15.21	NOT SAMPLED								
1/6/2006	996.34	15.26	<0.12	<0.5	<0.11	<1.2	<0.13	<1.11	<2.0		
4/5/2006	997.62	13.98	NOT SAMPLED								

Monitoring Well MW-7

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
5/15/1996	NM	NM	<0.6	<1	<1	<1	<1	<1	<1
4/30/1998	NM	NM	<0.26	<0.24	<0.22	NS	<0.21	<0.86	<0.97

Note: Bold type indicates an ES exceedance, *italics* indicates a PAL exceedance. NS = not sampled
 NM = Not Measured

**Groundwater Analytical Results Summary
Friesland Motors LUST Site**

Monitoring Well MW-8

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
5/15/1996	NM	NM	1.3	<1	<1	<1	<1	<1	<1
4/30/1998	NM	NM	0.26	<0.24	<0.22	NS	<0.21	<0.86	<0.97
8/18/1998	NM	NM	0.57	<0.24	<0.22	NS	<0.21	<0.86	<0.97

Monitoring Well MW-9

PVC Elevation = 1010.46 (FT) (MSL)

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
12/7/2000	NM	NM	<0.40	<0.40	<0.40	<1.0	<0.40	<0.40	0.94
6/18/2001	NM	NM	<0.40	<0.40	<0.40	<1.0	<0.40	<0.40	<0.70
9/27/2001	NM	NM	<0.40	<0.10	<1.1	<0.70	<0.10	<0.30	<0.20
12/4/2001	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.90	<1.4
3/19/2002	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.50	<0.90
6/8/2002	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.50	<0.90
12/11/2003	NM	NM	<0.30	<0.40	<0.30	<0.60	<0.40	<0.30	<0.70
1/11/2005	990.43	20.03	<0.29	<0.56	<0.2	<0.6	<0.57	<1.17	<1.74
4/11/2005	987.91	22.55	NOT SAMPLED						
7/6/2005	986.88	23.58	<0.26	<0.3	<0.36	<0.85	<0.52	<1.15	<1.17
10/6/2005	985.70	24.76	NOT SAMPLED						
1/6/2006	984.50	25.96	<0.12	<0.5	<0.11	<1.2	<0.13	<1.11	<2.0
4/5/2006	983.85	26.61	NOT SAMPLED						

Monitoring Well MW-10

PVC Elevation = 1008.94 (FT) (MSL)

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
12/7/2000	NM	NM	<0.40	<0.40	<0.40	<1.0	<0.40	<0.40	<0.70
6/18/2001	NM	NM	<0.40	<0.40	<0.40	<1.0	<0.40	<0.40	<0.70
9/27/2001	NM	NM	<0.10	<0.10	<1.1	<0.70	<0.10	<0.30	<0.20
12/4/2001	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.90	<0.40
3/19/2002	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.50	<0.90
6/8/2002	NM	NM	<0.40	<0.40	<0.40	<1.3	<0.40	<0.50	<0.90
12/11/2003	NM	NM	<0.30	<0.40	<0.30	<0.60	<0.40	<0.30	<0.70
1/11/2005	988.91	20.03	<0.29	<0.56	<0.2	<0.6	<0.57	<1.17	<1.74
4/11/2005	987.85	21.09	NOT SAMPLED						
7/6/2005	986.70	22.24	<0.26	<0.3	<0.36	<0.85	<0.52	<1.15	<1.17
10/6/2005	985.67	23.27	NOT SAMPLED						
1/6/2006	984.61	24.33	<0.12	<0.5	<0.11	<1.2	<0.13	<1.11	<2.0
4/5/2006	983.69	25.25	NOT SAMPLED						

Monitoring Well PZ-9

PVC Elevation = 1010.59 (FT) (MSL)

Date	Water Elevation (in feet)	Depth to Water (in feet)	Benzene (ppb)	Ethyl Benzene (ppb)	MTBE (ppb)	Naphthalene (ppb)	Toluene (ppb)	Trimethyl-benzenes (ppb)	Xylene (Total) (ppb)
12/11/2003	NM	NM	26	200	<10	44	180	810	1260
1/11/2005	992.42	18.17	0.55	3	8.9	<0.6	<0.57	19.9	5.2-5.84
4/11/2005	994.25	16.34	<0.12	0.67	8.1	<1.2	1.2	4.2	2.0
7/6/2005	995.20	15.39	<0.26	<0.3	8.9	<0.85	<0.52	0.99-1.82	<1.17
10/6/2005	991.14	19.45	<0.12	<0.5	7.5	<1.2	<0.13	0.84-1.37	<1.9
1/6/2006	991.36	19.23	<0.12	<0.5	9.4	<1.2	<0.13	<1.11	<2.0
4/5/2006	993.23	17.36	<0.12	<0.5	6.4	<1.2	1.21	2.07	<2.0

Note: Bold type indicates an ES exceedance, *italics* indicates a PAL exceedance. NS = not sampled
NM = Not Measured

Laboratory Results - Soil
Former Friesland Motors, Friesland, WI

Location	Depth (feet)	GRO	DRO	Benzene	Ethyl-benzene	MtBE	Naphthalene	Toluene	1,2,4-Tri-methyl-benzene	1,3,5-Tri-methyl-benzene	Xylenes
NR 720	GRCLs	100/250	100/250	0.0055	2.9			1.5			4.1
NR 746	Contact			1.1							
NR 746	Product			8.5	4.6		2.7	38	83	11	42
Samples from Site Investigation at Cliff's											
B-4	9.5-11	--	--	--	--	--	--	--	--	--	--
B-4	19-21	--	--	--	--	--	--	--	--	--	--
B-6	24-26	--	--	--	--	--	--	--	--	--	--
B-7	19.5-21	--	--	--	--	--	--	--	--	--	--
B-7	24-26	3.9		0.12	0.075	--		--	0.17	0.054	0.096
B-9	5-7	2800	1700	--	--	--	2.2	--	13	5.1	0.69
B-9	28-30	7.2	--	0.57	0.21	0.098	0.055	1.4	0.19	0.056	1.0
B-10	10-12	110	47	0.27	3.3	--	3.6	0.66	17	5.8	13.2
B-10	23-25	92	13	0.19	4.4	--	4.5	3.6	21	7.2	23.4
B-11	12.5-14.5	--	--	--	--	--	--	--	--	--	--
B-11	23-25	68	6.2	0.087	0.35	--	0.19	0.051	3.3	1.2	0.386
Samples Collected November 21, 2000											
MW-10	20-22	<1.2		<0.025	<0.025	<0.025		<0.025	<0.025	<0.025	<0.025
B-14	0.5-2.5	<1.3		<0.025	0.092	<0.025		<0.025	0.46	0.3	0.25
B-15	2.5-4.5	7.1		0.027	<0.025	<0.025		0.13	0.15	0.055	0.247
B-15	5-7	450		<0.10	6.0	<0.09		5.6	27	9.0	50
B-15	10-12	870		<0.50	17	<0.45		24	43	15	86
B-15	15-17	26		0.06	0.74	<0.025		2.7	1.7	0.56	3.6
B-15	20-22	9.9		<0.025	0.21	<0.025		0.59	0.76	0.24	1.05
B-16	12.5-14.5	<1.2		<0.025	<0.025	<0.025		<0.025	<0.025	<0.025	<0.025
B-16	20-22	3.2		<0.025	<0.025	<0.025		<0.025	0.1	0.036	<0.025

All concentrations are in mg/kg.

GRO = gasoline range organics

DRO = diesel range organics

MtBE = methyl-tert-butyl ether

-- = not detected

GRCLs = Wisconsin Administrative Code NR 720 generic residual contaminant levels

Laboratory Results - Soil (Post-Excavation)
Former Friesland Motors, Friesland, WI (Columbia County)

Location	Depth Interval	Date	PID	GRO	Lead	Benzene	Ethyl-benzene	Methyl-tert-butyl ether	Toluene	1,2,4- Tri-methyl-benzene	1,3,5- Tri-methyl-benzene	M&P Xylene	O Xylene
NR 746 Table 1 (Indicative of Residual Product)						8.5	4.6		38	83	11	42*	42*
NR 746 Table 2 (Direct contact)						1.10							
NR 720 GRCL's				100	50	0.0055	2.9		1.5			4.1*	4.1*
SS#1	4	3-Sep-03	2	<1.6	8.8	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025
SS#2	17	3-Sep-03	218	46	2.6	<0.025	0.027	<0.025	0.042	0.55	0.48	0.27	0.18
SS#3	4	3-Sep-03	4.5	<1.6	9.8	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025
SS#4	10	3-Sep-03	5	<1.6	7.4	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025
SS#5	4	3-Sep-03	5.5	<1.6	7.0	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025
SS#6	12	3-Sep-03	332	1100	1.2	<0.36	24	<0.68	30	63	21	85	33
SS#7	16	4-Sep-03	302	350	13.4	0.04	2.2	<0.043	0.33	5.2	4.8	7.1	0.69
SS#8	8	4-Sep-03	418	380	11.6	<0.045	1.7	<0.085	<0.085	10	6.0	9.9	4.1
SS#9	4	4-Sep-03	0	<1.6	9.2	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025
SS#10	10	4-Sep-03	3	<1.6	9.6	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025
N. End	6	3-Sep-03		2800		<0.45	9.8	<0.85	<0.85	41	47	33	8.3
Middle	6	3-Sep-03		1000		<0.23	8.9	<0.43	3.6	43	19	39	15
S. End	6	3-Sep-03		<1.6		<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025	<0.025

All concentrations are in mg/Kg.

Depths are in feet below ground surface.


PID readings are in ppm as isobutylene.

Blank cells indicate parameter was not analyzed.

* = concentration is for total xylenes.

Values in BOLD exceed a NR 746 Table 1 or Table 2 value.

Groundwater Contamination Map

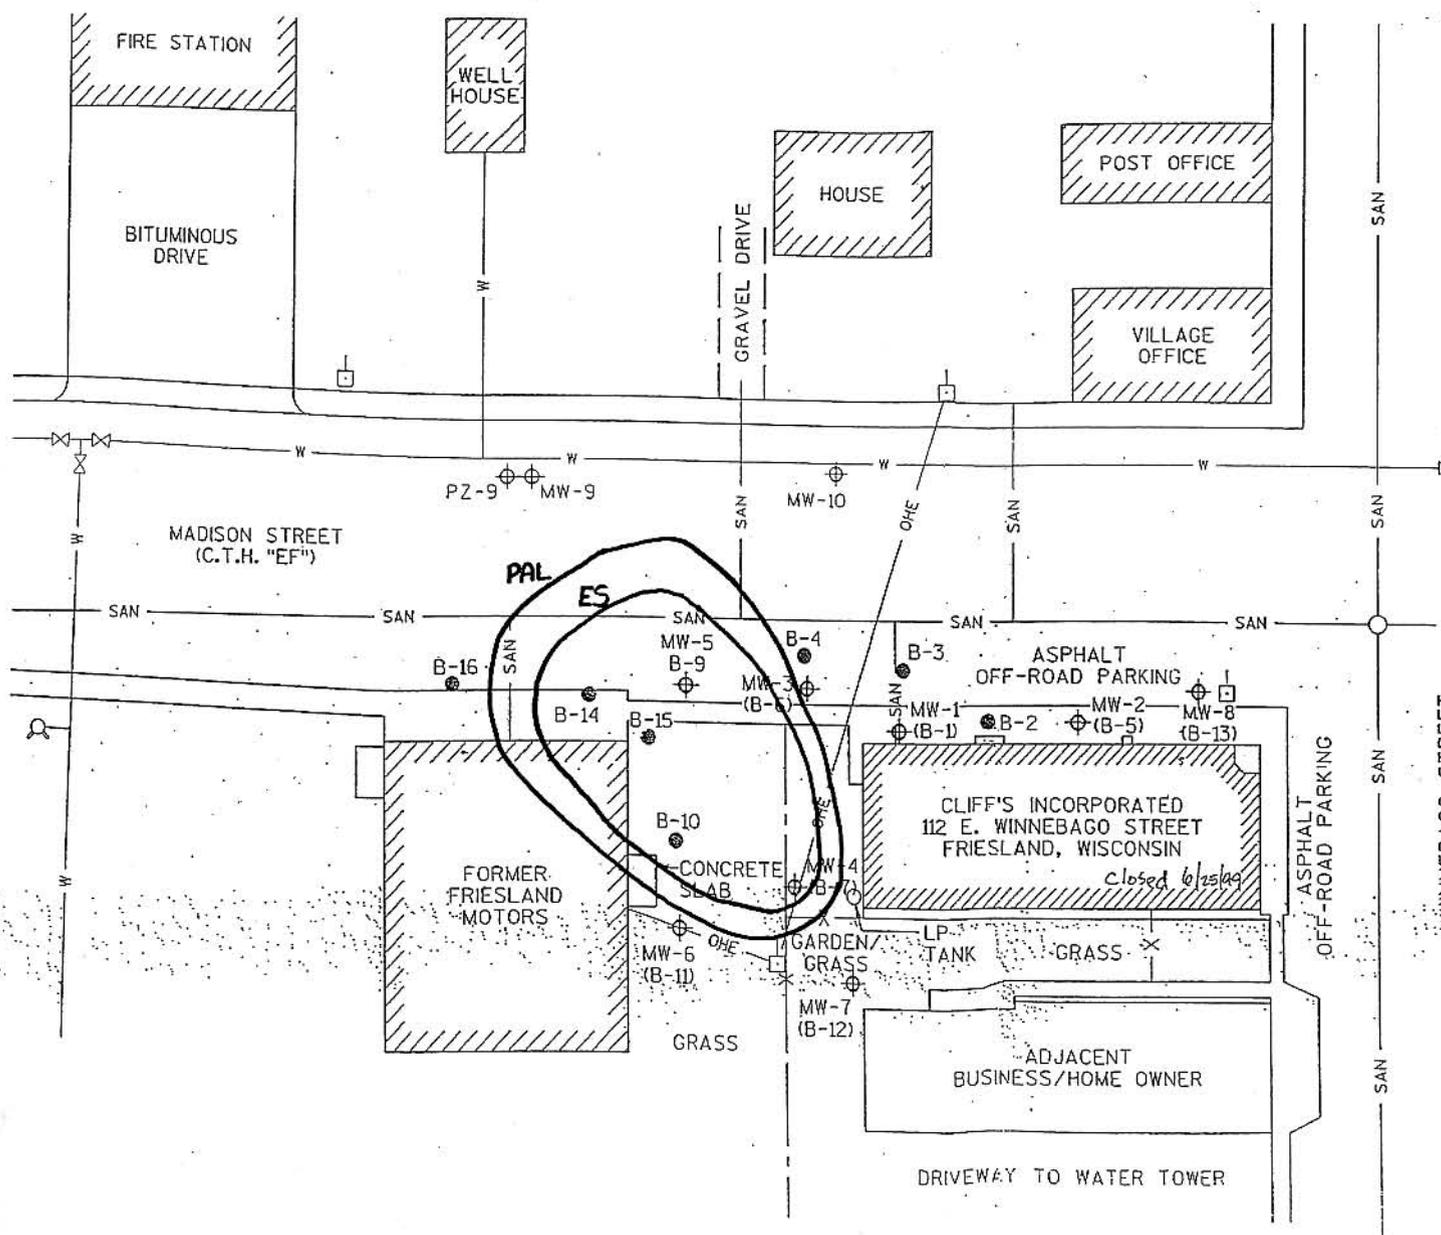

LEGEND

- SOIL BORING
- ⊕ MONITORING WELL

NOTE:

MW-1 showed a PAL exceedance for Benzene (1.4 ppb) on 5/15/96.
 MW-2 showed a PAL exceedance for Benzene (1.5 ppb) on 8/18/98.
 MW-8 showed a PAL exceedance for Benzene (0.57 ppb) on 8/18/98.

NOTE:
 FOR ADDITIONAL NOTES AND LEGEND, REFER TO FIGURE 2.

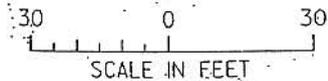


FIGURE 3
 MONITORING WELL AND SOIL BORING LOCATIONS
 FORMER FRIESLAND MOTORS
 FRIESLAND, WISCONSIN

MSA TRANSPORTATION • MUNICIPAL • REMEDIATION DEVELOPMENT • ENVIRONMENTAL
 230 South Boulevard, Baraboo, WI 53003
 608-336-2171 • 1-800-362-4505 • Fax: 608-336-2172

DRAWN BY: RHM DATE: 1-7-04 SHEET: 1 of 1
 CHECKED BY: AS NOTED FILE NO.: 212789C

Modified By METCOLG 5/26/06


**Watertable Elevation Table
Friesland Motors
Friesland, Wisconsin**

<i>pvc top (ft)</i>	MW-5 1009.99	MW-6 1011.60	MW-9 1010.46	MW-10 1008.94	PZ-9 1010.59
---------------------	-----------------	-----------------	-----------------	------------------	-----------------

Date

<i>Date</i>	MW-5	MW-6	MW-9	MW-10	PZ-9
8/30/1995	NS	NS	NI	NI	NI
5/15/1996	NS	NS	NI	NI	NI
8/1/1996	NS	NS	NI	NI	NI
10/12/1999	NS	NS	NI	NI	NI
12/7/2000	NS	NS	NS	NS	NI
6/18/2001	NS	NS	NS	NS	NI
9/27/2001	NS	NS	NS	NS	NI
12/4/2001	NS	NS	NS	NS	NI
3/19/2002	NS	NS	NS	NS	NI
6/8/2002	NS	NS	NS	NS	NI
12/11/2003	NS	NS	NS	NS	NS
1/11/2005	988.58	994.62	988.91	988.91	992.42
4/11/2005	987.98	997.28	987.91	987.85	994.25
7/6/2005	987.98	997.28	987.91	987.85	994.25
10/6/2005	985.78	996.39	985.70	985.67	991.14
1/6/2006	984.57	996.34	984.50	984.61	991.36
4/5/2006	983.94	997.62	983.85	983.69	993.23


Note: Elevations are presented in feet mean sea level (msl).

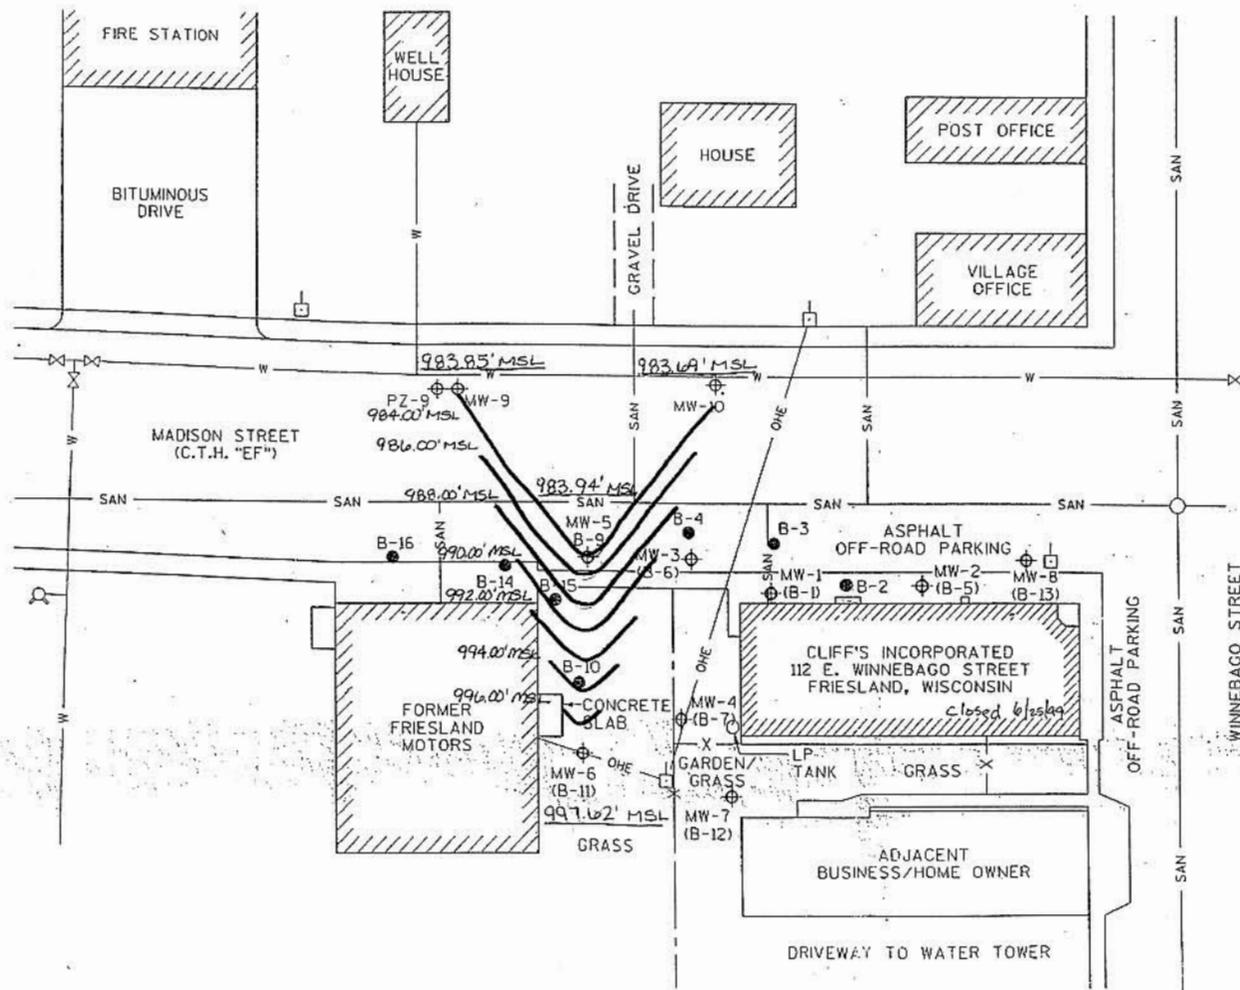

LEGEND

- SOIL BORING
- ⊕ MONITORING WELL

NOTE:
FOR ADDITIONAL NOTES
AND LEGEND, REFER
TO FIGURE 2.

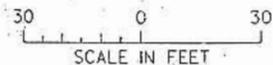

Round 6 Groundwater Contour Map
(4/11/06)

FIGURE 3

MONITORING WELL AND
SOIL BORING LOCATIONS
FORMER FRIESLAND MOTORS
FRIESLAND, WISCONSIN



TRANSPORTATION • MUNICIPAL • REMEDIATION
DEVELOPMENT • ENVIRONMENTAL
220 South Kewaunee Road, Friesland, WI 53150
608-356-0711 • 1-800-342-1585 • Fax: 608-356-4170

DRAWN BY: RHM DATE: 1-7-04 SHEET: 1 OF 1
CHECKED BY: SCALE: AS NOTED FILE NO.: 212789DC


Modified By METCOILG 5125106

Soil Contamination Map

LEGEND

- SOIL BORING
- ⊕ MONITORING WELL
- ▲ SOIL SAMPLE LOCATION
-  EXCAVATION EXTENT

NOTE:
FOR ADDITIONAL NOTES AND LEGEND, REFER TO FIGURE 2.

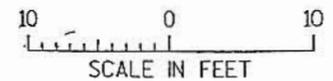

Area of Soil Contamination,
Exceeding NR720 Soil clean-up
Standards and/or NR746
Table 1 Values.

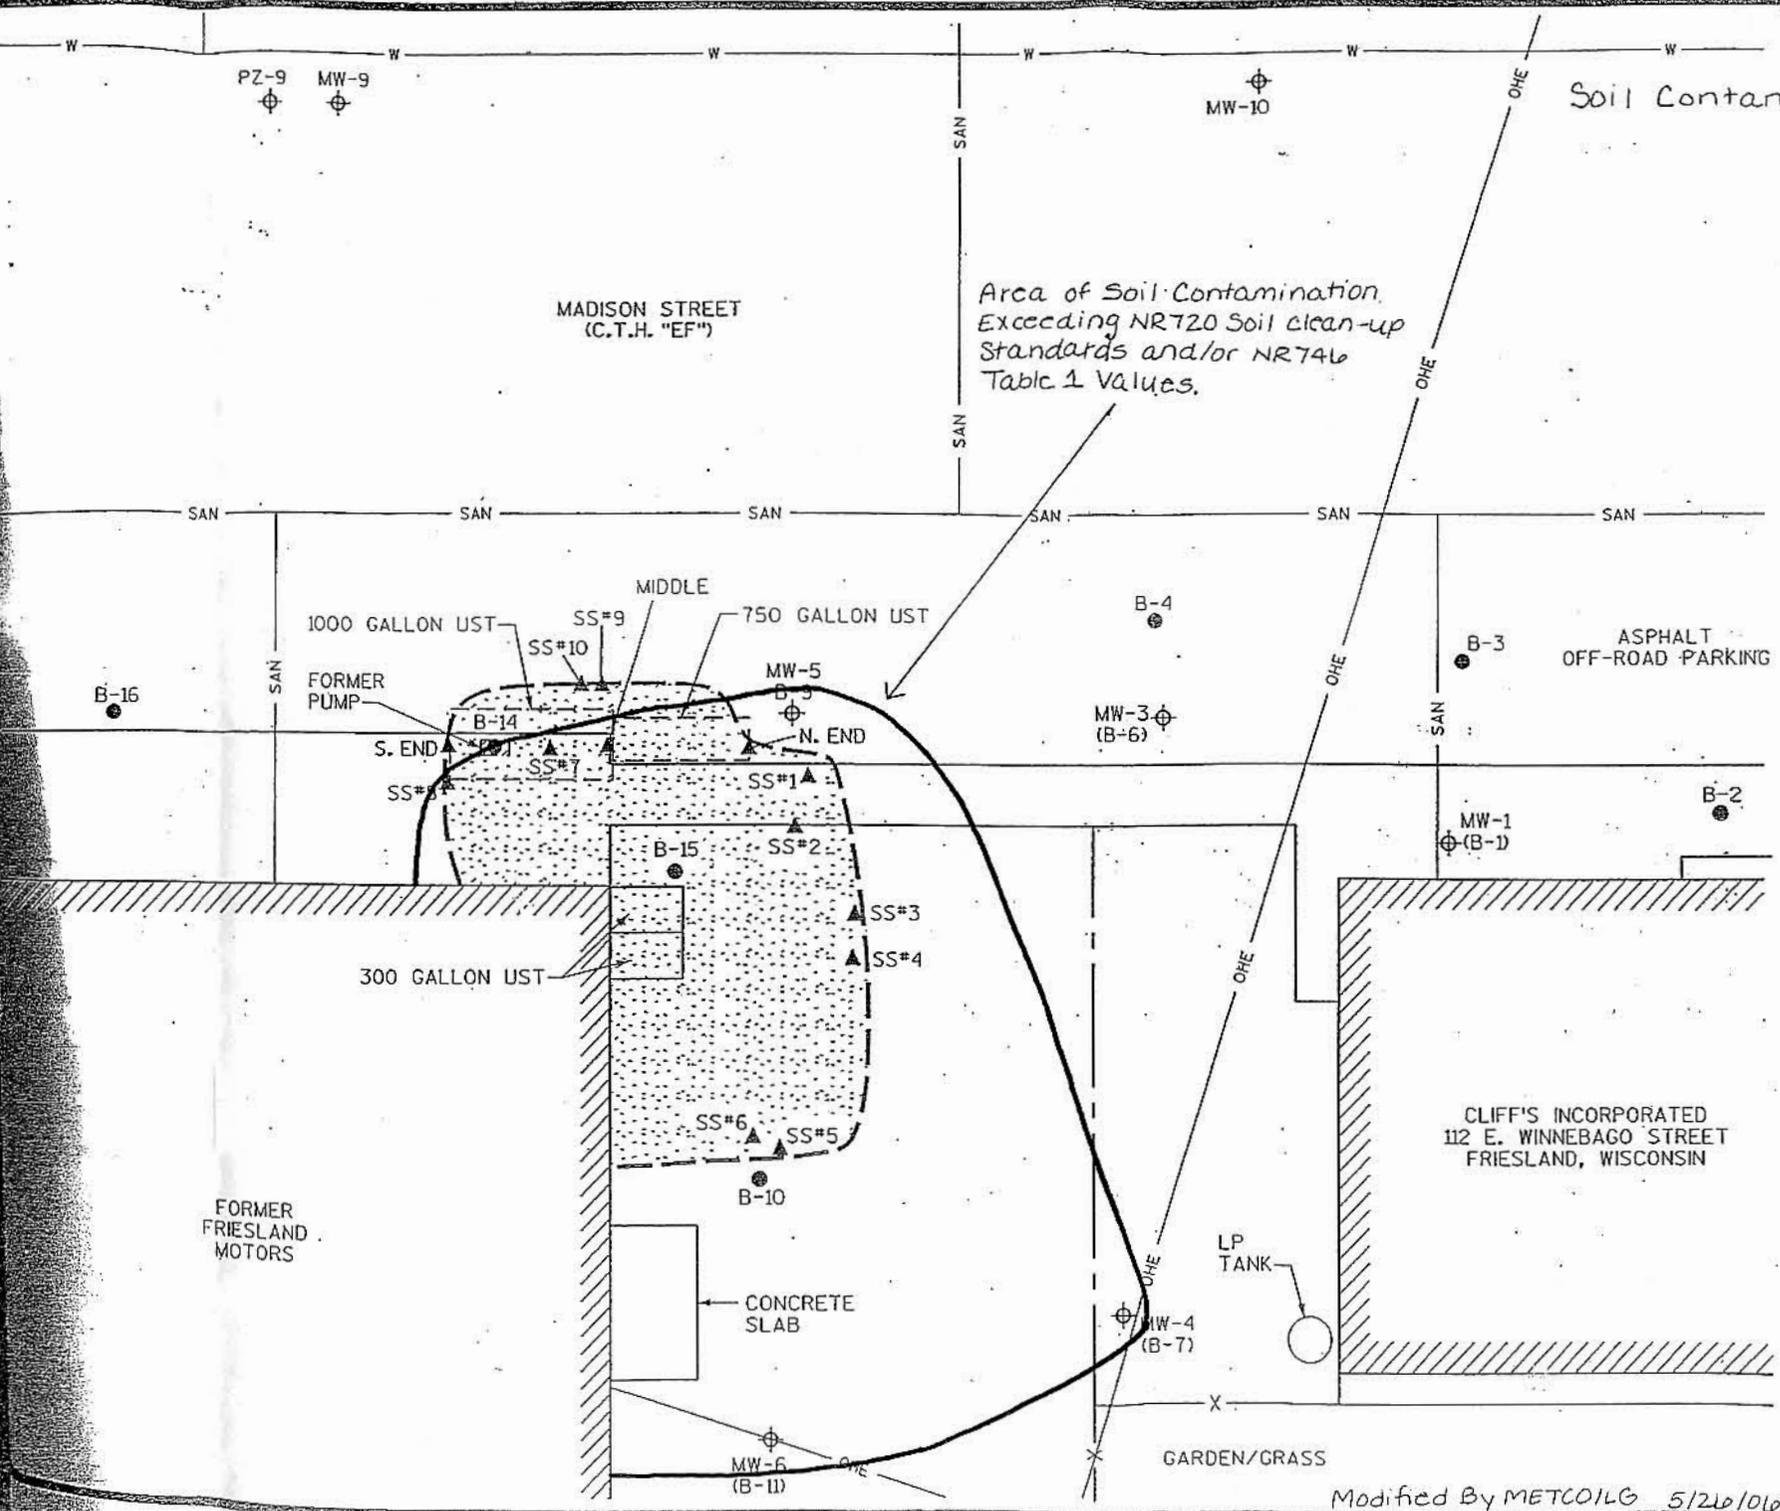


FIGURE 5


EXCAVATION EXTENT

FORMER FRIESLAND MOTORS
FRIESLAND, WISCONSIN

MSA TRANSPORTATION • INDUSTRIAL • REMEDIATION
DEVELOPMENT • ENVIRONMENTAL
1230 South Boulevard • Escanaba, MI 53703
401-754-2171 • 1-800-367-0665 Fax: 401-754-2170

DRAWN BY: RHM DATE: 1-7-04 SHEET: 1 OF 1
CHECKED BY: SCALE: AS NOTED FILE NO.: 212789CE

Modified By METCOILG 5/26/06

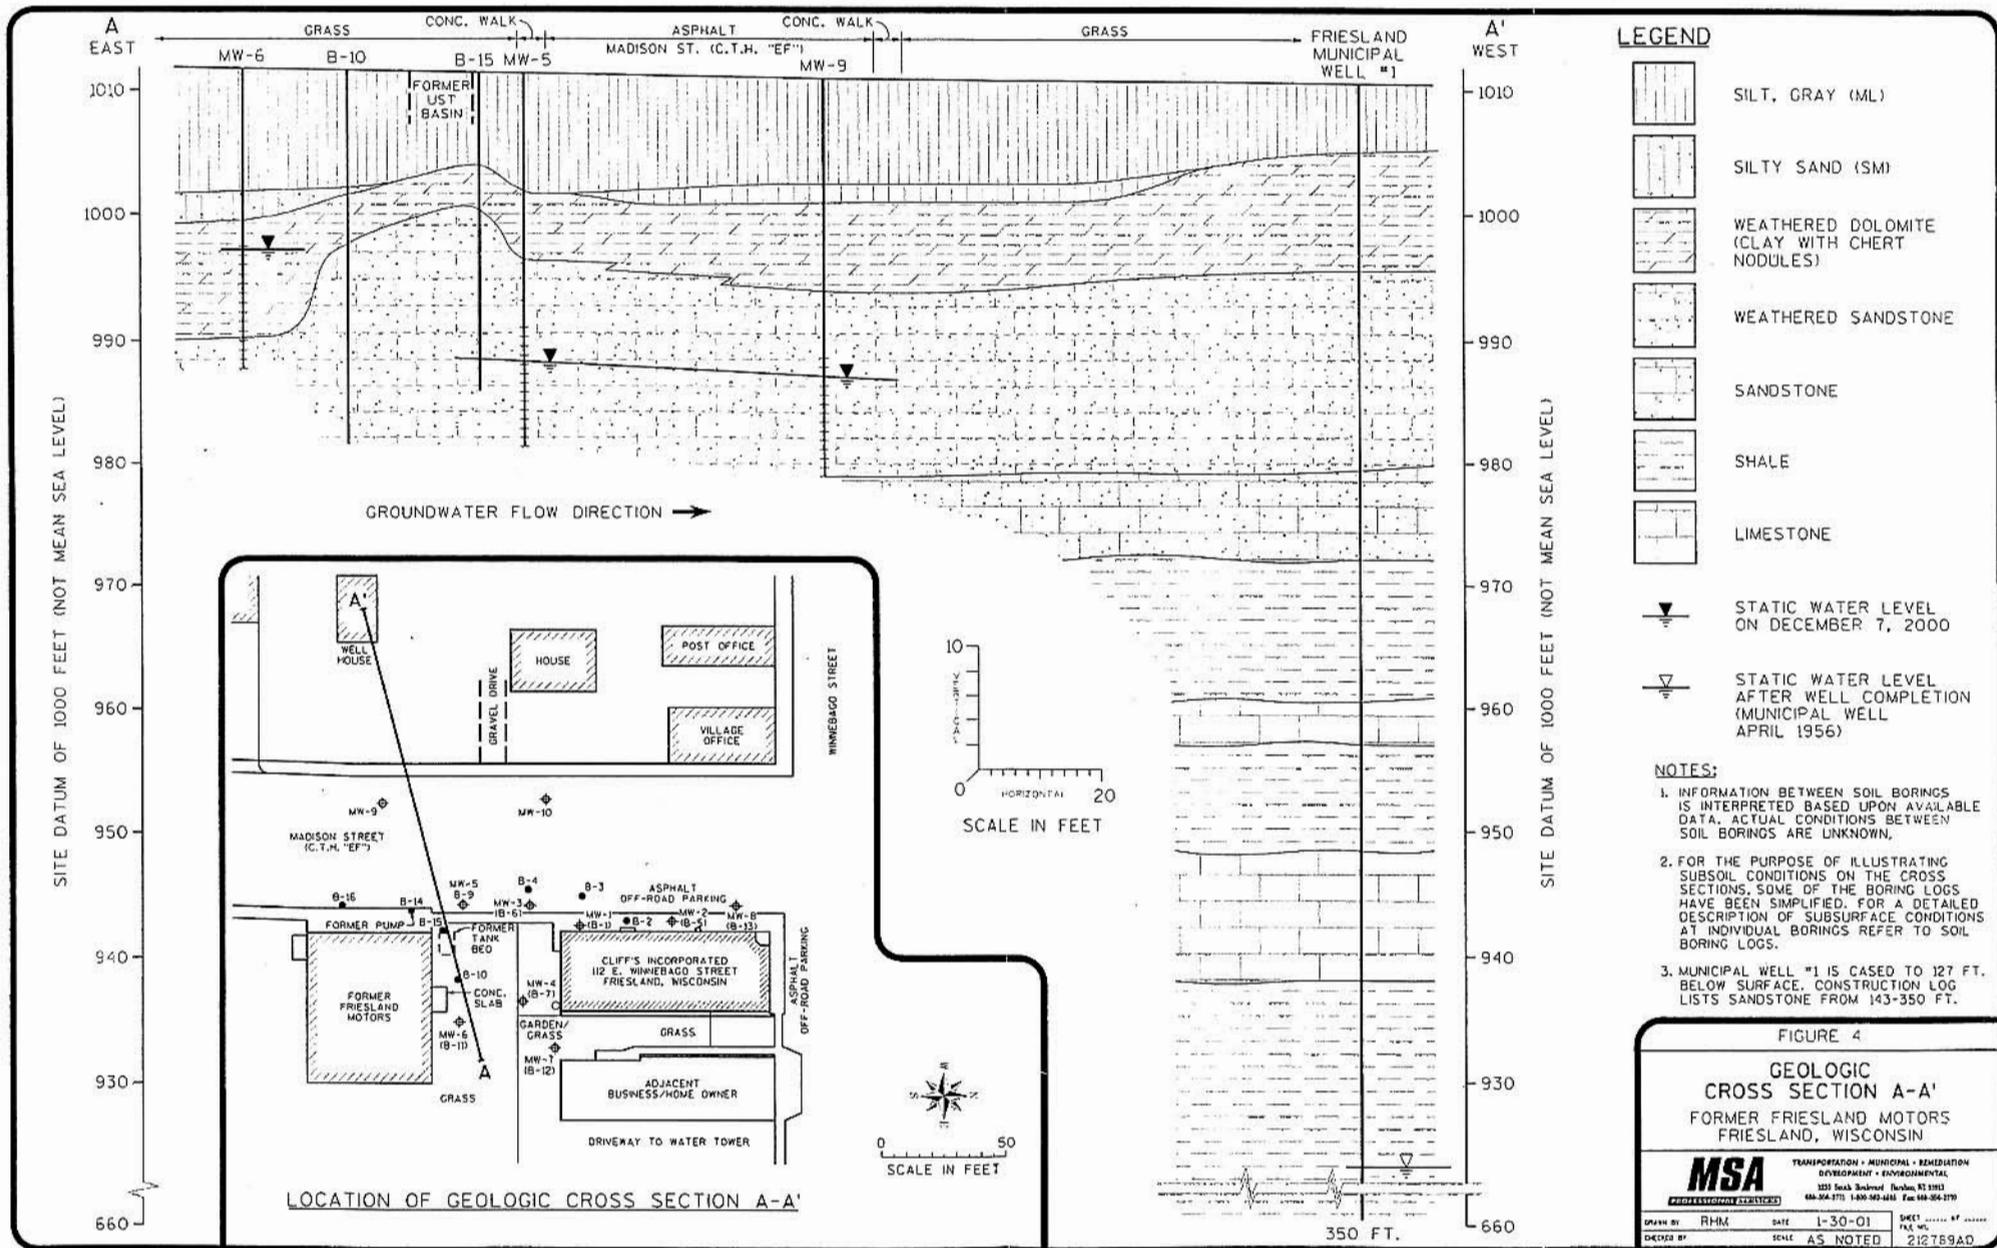

WDNR BRRTS Case #: 03-11-211076

WDNR Site Name: Friesland Motors

Geographic Information System (GIS) Registry of Closed Remediation Sites

In compliance with the revisions to the NR 700 rule series requiring certain closed sites to be listed on the Geographic Information System (GIS) Registry of Closed Remediation Sites (Registry) effective Nov., 2001, I have provided the following information.

To the best of my knowledge the legal descriptions provided and attached to this statement are complete and accurate.

Responsible Party: Ed HALDEMANN OWNER
(print name/title)

Ed Halde Mann 5/30/06
(signature) (date)



Excellence through experience™

COPY

2956 Airport Road ♦ La Crosse, WI 54630 ♦ 1-800-552-2932 ♦ Fax (608) 781-8893 Email: rona@metcohq.com ♦
www.metcohq.com

June 1, 2006

Ron Hart
Director of Public Works
Village of Friesland
P.O. Box 208
Friesland, WI 53935

Notification: Friesland Motors LUST Site (BRRTS # 03-11-211076), Conditional Case Closure
Notification

Dear Mr. Hart,

I am writing to inform you that soil and groundwater contamination from the Friesland Motors site, located at 104 Madison Street, Friesland, WI, exists within the right of way of Madison Street.

As part of the required documentation, you are hereby notified that residual petroleum contamination exists in the soil and groundwater within the right-of-way of Madison Street to the west of the Friesland Motors site. Soil and groundwater contamination was found to exist in the area of the removed underground petroleum storage tanks and dispensers. Groundwater contamination has migrated to the west across the right of way of Madison Street. Depth to groundwater in this area is approximately 25 feet below ground surface.

If the contaminated soil or groundwater is encountered during future construction, it may pose inhalation or other direct contact hazards. Any contaminated soil or groundwater encountered will require sampling and analysis, as well as proper storage, treatment, and disposal of any excavated materials. We are enclosing site maps displaying inferred soil and groundwater contamination plumes.

If you have any questions, or require more detailed information, please contact me at METCO's La Crosse office (608-781-8879).

Sincerely,

Jason T. Powell
Staff Scientist

Enclosure: Maps



Excellence through experience™

COPY

2956 Airport Road ♦ La Crosse, WI 54630 ♦ 1-800-552-2932 ♦ Fax (608) 781-8893 Email: rona@metcohq.com ♦
www.metcohq.com

June 1, 2006

Kurt Dey
Highway Commissioner
Columbia County Highway & Transportation
303 Old Highway 16 West
P.O. Box 875
Wyocena, Wisconsin 53969-0875

Notification: Friesland Motors LUST Site (BRRTS # 03-11-211076), Conditional Case Closure
Notification

Dear Mr. Dey,

I am writing to inform you that soil and groundwater contamination from the Friesland Motors site, located at 104 Madison Street, Friesland, WI, exists within the right of way of County Highway EF (Madison Street).

As part of the required documentation, you are hereby notified that residual petroleum contamination exists in the soil and groundwater within the right-of-way of County Highway EF (Madison Street) to the west of the Friesland Motors site. Soil and groundwater contamination was found to exist in the area of the removed underground petroleum storage tanks and dispensers. Groundwater contamination has migrated to the west across the right of way of County Highway EF (Madison Street). Depth to groundwater in this area is approximately 25 feet below ground surface.

If the contaminated soil or groundwater is encountered during future construction, it may pose inhalation or other direct contact hazards. Any contaminated soil or groundwater encountered will require sampling and analysis, as well as proper storage, treatment, and disposal of any excavated materials. We are enclosing site maps displaying inferred soil and groundwater contamination plumes.

If you have any questions, or require more detailed information, please contact me at METCO's La Crosse office (608-781-8879).

Sincerely,

Jason T. Powell
Staff Scientist

Enclosure: Maps

July 13, 2006

Terry E. and Diane S. Dykstra
P.O. Box 225
Friesland, WI 53935

Dear Mr. & Mrs. Dykstra

Groundwater contamination that appears to have originated on the Friesland Motors property located at 104 Madison Street has migrated onto your property at 112 E. Winnebago Street. The levels of Benzene and Naphthalene contamination in the groundwater on your property are above the state groundwater enforcement standards ("ES") found in chapter NR 140, Wis. Adm. Code. However, the environmental consultants who have investigated this contamination have informed me that these groundwater and soil contaminant plumes are stable and in the process receding and will naturally degrade over time. The environmental consultants believe that allowing natural attenuation to complete the cleanup at this site will meet the requirements for case closure that are found in chapters NR 726 and NR 746 Wis. Adm. Code. Therefore, I will be requesting that the Wisconsin Department of Natural Resources (WDNR) accept natural attenuation as the final remedy for this site and grant case closure. Closure means that the WDNR will not be requiring any further investigation or active cleanup action to be taken, other than the reliance on natural attenuation.

Since the source of the groundwater contamination is not on *your* property, neither you nor any subsequent owner of your property will be held responsible for investigation or cleanup of this groundwater contamination, as long as you and any subsequent owners comply with the requirements of section 292.13, Wis. Stat., including allowing access to your property for environmental investigation or cleanup, if access is required. A copy of the WDNR's Fact Sheet 10: *Guidance for Dealing with Properties Affected by Off-Site Contamination* (publication #RR-589) is attached for your review.

The WDNR will not review my closure request for at least 30 days after the date of this letter. As a potentially affected property owner, you have the right to contact the WDNR to provide any technical information that you may have that indicates that closure should not be granted for this site. If you would like to submit any information to the WDNR that is relevant to this closure request, you should mail that information to Denise Nettesheim, WDNR – South Central Region Headquarters, 3911 Fish Hatchery Road, Madison, WI 53711.

If this case is closed, all properties within the site boundaries where groundwater contamination exceeds the ES will be listed on the WDNR's geographic information system ("GIS") Registry of Closed Remediation Sites. The information on the GIS Registry includes maps showing the location of properties in Wisconsin where groundwater contamination above the ES was found at the time that the case was closed. This GIS Registry is available to the general public on the WDNR's internet web site. Please review the enclosed legal description of your property, and notify me within the next 30 days if the legal description is incorrect.


The Village of Friesland has a community owned and operated water system which supplies potable water to your property. However, should you or any subsequent property owner wish to construct or reconstruct a well on your property, special well construction standards maybe necessary to protect the well from the residual groundwater contamination. Any well driller who proposes to construct a well on your property in the future will first need to call the Diggers Hotline (1-800-242-8511) and also contact the Drinking Water program within the WDNR to determine if there is a need for special well construction standards.

Once the WDNR makes a decision on my closure request, it will be documented in a letter. If the WDNR grants closure, you may obtain a copy of this letter by requesting a copy from me, by writing to the agency address given above or by accessing the DNR GIS Registry of Closed Remediation Sites on the Internet at www.gomapout.dnr.state.wi.us/org/at/et/geo/gwur/. A copy of the closure letter is included as part of the site file on the "GIS Registry of Closed Remediation Sites."

If you need more information, please contact me at either 721 Lakeshore Drive, Beaver Dam, WI 53916 or (920) 885-4677 or Ms. Nettesheim at either the WDNR address noted above or at (608) 275-3209.

Sincerely,

Ed Haldemann

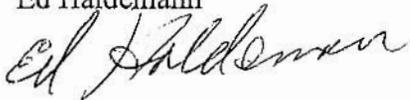

Enclosures: legal description, WDNR Publication # RR-589, maps, table of analytical results