

GIS REGISTRY

Cover Sheet

August 2011
(RR-5367)

Source Property Information

BRRTS #:

ACTIVITY NAME:

PROPERTY ADDRESS:

MUNICIPALITY:

PARCEL ID #:

CLOSURE DATE:

FID #:

DATCP #:

PECFA#:

*WTM COORDINATES:

X: Y:

** Coordinates are in
WTM83, NAD83 (1991)*

WTM COORDINATES REPRESENT:

- Approximate Center Of Contaminant Source
- Approximate Source Parcel Center

Please check as appropriate: (BRRTS Action Code)

Contaminated Media:

Groundwater Contamination > ES (236)

- Contamination in ROW
- Off-Source Contamination

*(note: for list of off-source properties
see "Impacted Off-Source Property" form)*

Soil Contamination > *RCL or **SSRCL (232)

- Contamination in ROW
- Off-Source Contamination

*(note: for list of off-source properties
see "Impacted Off-Source Property" form)*

Land Use Controls:

- N/A (Not Applicable)
- Soil: maintain industrial zoning (220)
*(note: soil contamination concentrations
between non-industrial and industrial levels)*
- Structural Impediment (224)
- Site Specific Condition (228)

- Cover or Barrier (222)
*(note: maintenance plan for
groundwater or direct contact)*
- Vapor Mitigation (226)
- Maintain Liability Exemption (230)
*(note: local government unit or economic
development corporation was directed to
take a response action)*

Monitoring Wells:

Are all monitoring wells properly abandoned per NR 141? (234)

- Yes No N/A

** Residual Contaminant Level
**Site Specific Residual Contaminant Level*

This Adobe Fillable form is intended to provide a list of information that is required for evaluation for case closure. It is to be used in conjunction with Form 4400-202, Case Closure Request. The closure of a case means that the Department has determined that no further response is required at that time based on the information that has been submitted to the Department.

NOTICE: Completion of this form is mandatory for applications for case closure pursuant to ch. 292, Wis. Stats. and ch. NR 726, Wis. Adm. Code, including cases closed under ch. NR 746 and ch. NR 726. The Department will not consider, or act upon your application, unless all applicable sections are completed on this form and the closure fee and any other applicable fees, required under ch. NR 749, Wis. Adm. Code, Table 1 are included. It is not the Department's intention to use any personally identifiable information from this form for any purpose other than reviewing closure requests and determining the need for additional response action. The Department may provide this information to requesters as required by Wisconsin's Open Records law [ss. 19.31 - 19.39, Wis. Stats.].

BRRTS #: (No Dashes) PARCEL ID #:
ACTIVITY NAME: WTM COORDINATES: X: Y:

CLOSURE DOCUMENTS (the Department adds these items to the final GIS packet for posting on the Registry)

- Closure Letter**
- Maintenance Plan** (if activity is closed with a land use limitation or condition (land use control) under s. 292.12, Wis. Stats.)
- Continuing Obligation Cover Letter** (for property owners affected by residual contamination and/or continuing obligations)
- Conditional Closure Letter**
- Certificate of Completion (COC)** (for VPLE sites)

SOURCE LEGAL DOCUMENTS

- Deed:** The most recent deed as well as legal descriptions, for the **Source Property** (where the contamination originated). Deeds for other, off-source (off-site) properties are located in the **Notification** section.
Note: If a property has been purchased with a land contract and the purchaser has not yet received a deed, a copy of the land contract which includes the legal description shall be submitted instead of the most recent deed. If the property has been inherited, written documentation of the property transfer should be submitted along with the most recent deed.
- Certified Survey Map:** A copy of the certified survey map or the relevant section of the recorded plat map for those properties where the legal description in the most recent deed refers to a certified survey map or a recorded plat map. (lots on subdivided or platted property (e.g. lot 2 of xyz subdivision)).
Figure #: 1 **Title: Plat Map**
- Signed Statement:** A statement signed by the Responsible Party (RP), which states that he or she believes that the attached legal description accurately describes the correct contaminated property.

MAPS (meeting the visual aid requirements of s. NR 716.15(2)(h))

Maps must be no larger than 11 x 17 inches unless the map is submitted electronically.

- Location Map:** A map outlining all properties within the contaminated site boundaries on a U.S.G.S. topographic map or plat map in sufficient detail to permit easy location of all parcels. If groundwater standards are exceeded, include the location of all potable wells within 1200 feet of the site.
Note: Due to security reasons municipal wells are not identified on GIS Packet maps. However, the locations of these municipal wells must be identified on Case Closure Request maps.
Figure #: 2 **Title: Site Location Map**
- Detailed Site Map:** A map that shows all relevant features (buildings, roads, individual property boundaries, contaminant sources, utility lines, monitoring wells and potable wells) within the contaminated area. This map is to show the location of all contaminated public streets, and highway and railroad rights-of-way in relation to the source property and in relation to the boundaries of groundwater contamination exceeding a ch. NR 140 Enforcement Standard (ES), and/or in relation to the boundaries of soil contamination exceeding a Residual Contaminant Level (RCL) or a Site Specific Residual Contaminant Levels (SSRCL) as determined under s. NR 720.09, 720.11 and 720.19.
Figure #: 3 **Title: Site Plan**
- Soil Contamination Contour Map:** For sites closing with residual soil contamination, this map is to show the location of all contaminated soil and a single contour showing the horizontal extent of each area of contiguous residual soil contamination that exceeds a Residual Contaminant Level (RCL) or a Site Specific Residual Contaminant Level (SSRCL) as determined under s. NR 720.09, 720.11 and 720.19.
Figure #: 4 **Title: Residual Soil Contamination**

BRRTS #: 02-09-000365

ACTIVITY NAME: River Country Coop

MAPS (continued)

- Geologic Cross-Section Map:** A map showing the source location and vertical extent of residual soil contamination exceeding a Residual Contaminant Level (RCL) or a Site Specific Residual Contaminant Level (SSRCL). If groundwater contamination exceeds a ch. NR 140 Enforcement Standard (ES) when closure is requested, show the source location and vertical extent, water table and piezometric elevations, and locations and elevations of geologic units, bedrock and confining units, if any.

Figure #: 5 **Title: Cross Section A-A' by Cedar Corporation**

Figure #: 6 **Title: Cross Section A-A' by Sand Creek Consultants**

- Groundwater Isoconcentration Map:** For sites closing with residual groundwater contamination, this map shows the horizontal extent of all groundwater contamination exceeding a ch. NR140 Preventive Action Limit (PAL) and an Enforcement Standard (ES). Indicate the direction and date of groundwater flow, based on the most recent sampling data.

Note: This is intended to show the total area of contaminated groundwater.

Figure #: 7 **Title: Groundwater Isoconcentration Map**

- Groundwater Flow Direction Map:** A map that represents groundwater movement at the site. If the flow direction varies by more than 20° over the history of the site, submit 2 groundwater flow maps showing the maximum variation in flow direction.

Figure #: 8 **Title: Groundwater Contours - June 18, 2009**

Figure #: **Title:**

TABLES (meeting the requirements of s. NR 716.15(2)(h)(3))

Tables must be no larger than 11 x 17 inches unless the table is submitted electronically. Tables must not contain shading and/or cross-hatching. The use of **BOLD** or *ITALICS* is acceptable.

- Soil Analytical Table:** A table showing remaining soil contamination with analytical results and collection dates.
Note: This is one table of results for the contaminants of concern. Contaminants of concern are those that were found during the site investigation, that remain after remediation. It may be necessary to create a new table to meet this requirement.

Table #: 1 **Title: Soil Analytical Table**

- Groundwater Analytical Table:** Table(s) that show the most recent analytical results and collection dates, for all monitoring wells and any potable wells for which samples have been collected.

Table #: 2 **Title: Fluid Levels and Groundwater Analytical Data**

- Water Level Elevations:** Table(s) that show the previous four (at minimum) water level elevation measurements/dates from all monitoring wells. If present, free product is to be noted on the table.

Table #: 3 **Title: Groundwater Elevations**

IMPROPERLY ABANDONED MONITORING WELLS

For each monitoring well not properly abandoned according to requirements of s. NR 141.25 include the following documents.

Note: If the site is being listed on the GIS Registry for only an improperly abandoned monitoring well you will only need to submit the documents in this section for the GIS Registry Packet.

- Not Applicable**

- Site Location Map:** A map showing all surveyed monitoring wells with specific identification of the monitoring wells which have not been properly abandoned.

Note: If the applicable monitoring wells are distinctly identified on the Detailed Site Map this Site Location Map is not needed.

Figure #: **Title:**

- Well Construction Report:** Form 4440-113A for the applicable monitoring wells.

- Deed:** The most recent deed as well as legal descriptions for each property where a monitoring well was not properly abandoned.

- Notification Letter:** Copy of the notification letter to the affected property owner(s).

BRRTS #: 02-09-000365

ACTIVITY NAME: River Country Coop

NOTIFICATIONS

Source Property

Not Applicable

Letter To Current Source Property Owner: If the source property is owned by someone other than the person who is applying for case closure, include a copy of the letter notifying the current owner of the source property that case closure has been requested.

Return Receipt/Signature Confirmation: Written proof of date on which confirmation was received for notifying current source property owner.

Off-Source Property

Group the following information per individual property and label each group according to alphabetic listing on the "Impacted Off-Source Property" attachment.

Not Applicable

Letter To "Off-Source" Property Owners: Copies of all letters sent by the Responsible Party (RP) to owners of properties with groundwater exceeding an Enforcement Standard (ES), and to owners of properties that will be affected by a land use control under s. 292.12, Wis. Stats.

Note: Letters sent to off-source properties regarding residual contamination must contain standard provisions in Appendix A of ch. NR 726.

Number of "Off-Source" Letters:

Return Receipt/Signature Confirmation: Written proof of date on which confirmation was received for notifying any off-source property owner.

Deed of "Off-Source" Property: The most recent deed(s) as well as legal descriptions, for all affected deeded **off-source property(ies)**. This does not apply to right-of-ways.

Note: If a property has been purchased with a land contract and the purchaser has not yet received a deed, a copy of the land contract which includes the legal description shall be submitted instead of the most recent deed. If the property has been inherited, written documentation of the property transfer should be submitted along with the most recent deed.

Certified Survey Map: A copy of the certified survey map or the relevant section of the recorded plat map for those properties where the legal description in the most recent deed refers to a certified survey map or a recorded plat map. (lots on subdivided or platted property (e.g. lot 2 of xyz subdivision)).

Figure #:

Title:

Letter To "Governmental Unit/Right-Of-Way" Owners: Copies of all letters sent by the Responsible Party (RP) to a city, village, municipality, state agency or any other entity responsible for maintenance of a public street, highway, or railroad right-of-way, within or partially within the contaminated area, for contamination exceeding a groundwater Enforcement Standard (ES) and/or soil exceeding a Residual Contaminant Level (RCL) or a Site Specific Residual Contaminant Level (SSRCL).

Number of "Governmental Unit/Right-Of-Way Owner" Letters:



State of Wisconsin
Governor Scott Walker

Department of Agriculture, Trade and Consumer Protection

Ben Brancel, Secretary

May 29, 2012

Mr. Mike Prah
River Country Co-op
1080 West River Street
Chippewa Falls, WI 54729

Re: Final Case Closure with Land Use Limitations or Conditions
River Country Co-op, 1080 West River Street, Chippewa Falls, Wisconsin
DATCP Case #91409052901; WDNR BRRTS No. 02-09-000365

Dear Mr. Prah:

On January 30, 2012, our Closure Committee reviewed the above-referenced case for closure. This committee reviews environmental remediation cases for compliance with state laws and standards to maintain consistency in the closure of these cases. On February 1, 2012, you were notified that the Closure Committee had agreed that this would be eligible for closure once the site groundwater monitoring wells had been abandoned and documentation of the well abandonments submitted to the department.

On April 10, 2012 the department received correspondence from your consultant, Sand Creek Consultants, Inc. (Sand Creek) confirming proper abandonment of the monitoring wells, thereby meeting the conditions of closure. Based on the correspondence and data provided, it appears that your case meets the requirements of ch. NR 726, Wis. Adm. Code. The Department considers this case closed and no further investigation or remediation is required at this time.

GIS Registry

The conditions of case closure set out below in this letter require that your site be listed on the Wisconsin Department of Natural Resources (DNR) Remediation and Redevelopment (RR) Program's Geographical Information Systems (GIS) Registry of contaminated sites. The specific reasons are summarized below:

- Residual soil contamination exists that must be properly managed should it be excavated or removed
- If a structural impediment that obstructs a complete site investigation or cleanup is removed or modified, additional environmental work must be completed
- Pavement, an engineered cover or a soil barrier must be maintained over contaminated soil and the state must approve any changes to this barrier
- Groundwater contamination is present above ch. NR 140, Wis. Adm. Code, enforcement standards (ESs)

Information that was submitted with your closure request application will be included on the GIS Registry. To review the sites on the GIS Registry web page, visit the RR Sites Map page at <http://dnr.wi.gov/org/aw/rr/gis/index.htm>. If your property is listed on the GIS Registry because of remaining contamination and you intend to construct or reconstruct a well, you will need prior Department approval in accordance with s. NR 812.09(4)(w), Wis. Adm. Code. To obtain approval, Form 3300-254 needs to be completed and submitted to the DNR Drinking and Groundwater program's regional water supply specialist. This form can be obtained on-line <http://dnr.wi.gov/org/water/dwg/3300254.pdf> or at the web address listed above for the GIS Registry.

Closure Conditions

Please be aware that pursuant to s. 292.12, Wis. Stats., compliance with the requirements of this letter is a responsibility to which you and any subsequent property owners must adhere. If these requirements are not followed or if additional information regarding site conditions indicates that contamination on or from the site poses a threat to public health, safety, welfare, or the environment, the Department may take enforcement action under s. 292.11, Wis. Stats., to ensure compliance with the specified requirements, limitations or other conditions related to the property or this case may be reopened pursuant to s. NR 726.09, Wis. Adm. Code.

Remaining Residual Soil Contamination

Residual pesticide and nitrogen (fertilizer) soil contamination remains at the approximate locations shown on Figure 4 of Sand Creek's GIS Registry package. The GIS Registry package can be viewed at <http://dnr.wi.gov/org/aw/rr/gis/index.htm>. If residual contaminated soil is excavated in the future, then the property owner at the time of excavation must sample and analyze the excavated soil to determine if residual contamination remains (requirement pursuant to ch. NR 718, Wis. Adm. Code, and ch. 289, Wis. Stats., and chs. NR 500 to 536, Wis. Ad. Code, may also apply). If sampling confirms that contamination is present the property owner at the time of excavation will need to determine whether the material would be considered solid or hazardous waste and ensure that any storage, treatment or disposal is in compliance with applicable standards and rules. In addition, all current and future owners and occupants of the property need to be aware that excavation of the contaminated soil may pose a direct contact hazard and as a result special precautions may need to be taken to prevent a direct contact health threat to humans.

Structural Impediments

Structural impediments existing at the time of cleanup, including the former mix/load pad, bulk liquid containment structure, and dry fertilizer warehouse, made complete investigation and remediation of the soil contamination on this property impracticable. Pursuant to s. 292.12(2)(b), Wis. Stats., if the structural impediments on this property that are described above are removed, the property owner shall conduct an investigation of the degree and extent of pesticide and nitrogen contamination. If contamination is found at that time, the Department shall be immediately notified and the contamination shall be properly remediated in accordance with applicable statutes and rules. If soil in the specific locations described above is excavated, the property owner at the time of excavation must sample and analyze the excavated soil to determine if residual contamination remains. If sampling confirms that contamination is present the property owner at the time of excavation will need to determine whether the material would be considered solid or hazardous waste and ensure that any storage, treatment or disposal is in compliance with applicable statutes and rules. In addition, all current and future owners and occupants of the property need to be aware that excavation of the contaminated soil may pose a direct contact hazard and as a result special precautions may need to be taken during excavation activities to prevent a health threat to humans.

Cover or Barrier

Pursuant to s. 292.12(2)(a), Wis. Stats., the installed asphalt paving surface that currently exists in the location shown on Sheet No. 1 of the attached maintenance plan shall be maintained in compliance with the maintenance plan in order to minimize the infiltration of water and prevent additional groundwater contamination that would violate the groundwater quality standards in ch. NR 140, Wis. Adm. Code, and to prevent direct contact with residual soil contamination that might otherwise pose a threat to human

health. If soil in the specific locations described above is excavated in the future, the property owner at the time of excavation must sample and analyze the excavated soil to determine if residual contamination remains. If sampling confirms that contamination is present the property owner at the time of excavation will need to determine whether the material would be considered solid or hazardous waste and ensure that any storage, treatment or disposal is in compliance with applicable statutes and rules. In addition, all current and future owners and occupants of the property need to be aware that excavation of the contaminated soil may pose an inhalation or other direct contact hazard and as a result special precautions may need to be taken during excavation activities to prevent a health threat to humans.

The attached maintenance plan is to be kept on-site, along with an inspection log documenting the required annual maintenance and inspection activities. The inspection log must be submitted to the Department upon request.

Prohibited Activities

The following activities are prohibited on any portion of the property where [pavement, a building foundation, soil cover, engineered cap or other barrier] is required as shown on the attached map, unless prior written approval has been obtained from the DNR: 1) removal of the existing barrier; 2) replacement with another barrier; 3) excavating or grading of the land surface; 4) filling on capped or paved areas; 5) plowing for agricultural cultivation; or 6) construction or placement of a building or other structure.

Remaining Residual Groundwater Contamination

Groundwater impacted by [nitrite-nitrate as nitrogen ($\text{NO}_{2,3}$ as N) and pesticide contamination greater than enforcement standards set forth in ch. NR140, Wis. Adm. Code, is present on the contaminated property. For more detailed information regarding the locations where groundwater samples have been collected (i.e., monitoring well locations) and the associated contaminant concentrations, refer to the RR Program's GIS Registry at the RR Sites Map page at <http://dnr.wi.gov/org/aw/rr/gis/index.htm>.

ACCP Considerations

If the case is re-opened, Agricultural Chemical Cleanup Program (ACCP) reimbursement may still be available. Determination of the ACCP eligibility of any future corrective action costs incurred at this site should be made before the corrective action is performed. It is in your best interest to keep all documentation related to the cleanup project and ACCP reimbursement applications.

The Department appreciates your efforts to restore the environment at this site. If you have any questions regarding this letter, please call me at 608-224-4514.

Sincerely,



Trevor Bannister
Hydrogeologist

cc: Kevin Brey, DATCP
Bill Evans, DNR (WCR)
Ryan Haney, Sand Creek



604 Wilson Avenue • Menomonie, Wisconsin 54751

715-235-9081


800-472-7372

Fax • 715-235-2727

www.cedarcorp.com

July 28, 2003

River Country Cooperative
Attn: Mike Prah
1080 West River Street
Chippewa Falls, WI 54729

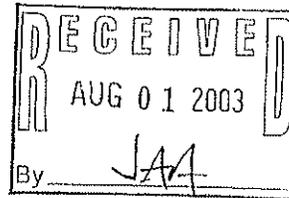

RE: Chippewa Falls Ag Facility; Engineered Barrier Construction Report
ACCP# 91409052901

Dear Mr. Prah:

The engineered cap at the Chippewa Falls Agricultural Facility has been completed. This letter summarizes the construction of the engineered cap.

The engineered cap construction at the Chippewa Falls Agricultural Facility is an asphalt driving surface located over the pesticide soil contamination remaining at the facility. The purpose of the cap is to reduce leaching of residual nitrogen and pesticide contamination to the ground water. The location and specifications of the cap were approved by Jeff Ackerman, DATCP.

The paving was completed by Senn Blacktop, Chippewa Falls, WI. On May 8, 2003 Cedar Corporation personnel met on site with personnel from Senn Blacktop to delineate the extent of the proposed asphalt cap. The photos included in Attachment A show the site following the delineation of the proposed extent of the asphalt cap. The location of the cap was subsequently graded by Senn Blacktop. Soil and gravel was removed from the paving area to allow for the placement of 4 inches of asphalt. Approximately 6 inches of gravel was left in place below the asphalt to allow for a suitable base. The paving was completed on May 23, 2003. Two two-inch lifts were placed over the selected area. The photos included in Attachment A show the site following paving. A site map showing the final extent of the asphalt cap is included as Figure 1.

Additional paving was completed at the Chippewa Agricultural Facility at the request of River Country Cooperative. The extent of the additional paving is shown on figure 1.

A cap maintenance plan has been included. The plan will be recorded with the deed or included with the GIS documents at the time of closure, whichever is required by the DNR.

If you have any questions or concerns, please contact me at 1-715-235-9081.


Yours truly,
CEDAR CORPORATION



Mark Iverson
Environmental Specialist

Enclosure

cc: Jeff Ackerman, DATCP
Kevin Brey, DATCP

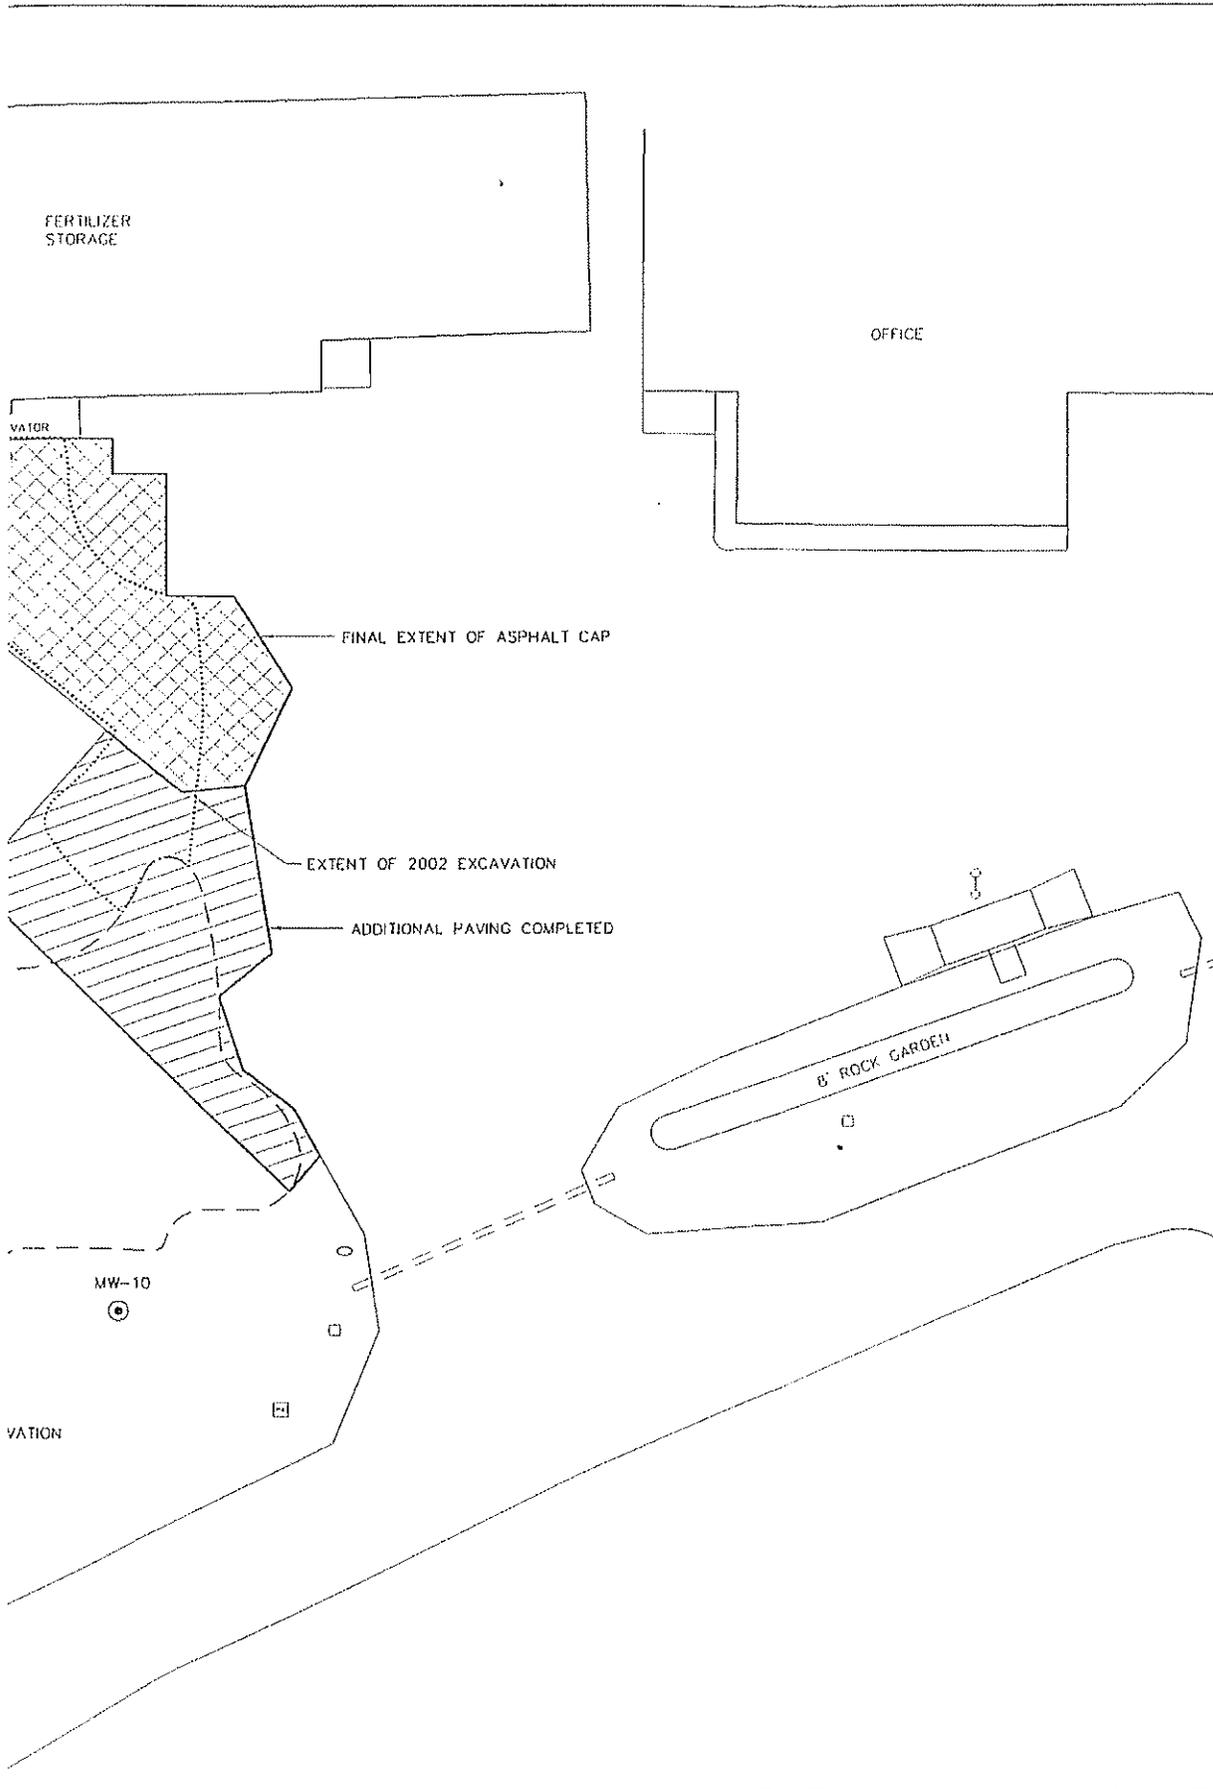

JOB NO.	R1381-021
BOOK NO.	H.I.
DRAWN BY	KAT
CHECKED BY	TAG
DATE	JUNE 2000
REVISIONS	AUG. 2000
	JULY 2001
	AUG. 2002
REFERENCE FILE	
DRAWING FILE	RO21CAP2.dwg

504 Wilson Avenue
Menomonie, Wisconsin 54751

Cedar
Corporation

engineers • architects • planners • environmental specialists
landscapers • landscape architects • interior designers

715-235-9681
800-472-2372
FAX 715-235-2727
www.cedarcorp.com

RIVER COUNTRY CO-OP
PROPOSED EXTENT OF ASPHALT CAP
CHIPPEWA FALLS, WI

SHEET NO.
1

RIVER COUNTRY COOPERATIVE
CHIPPEWA FALLS AGRICULTURAL FACILITY
IMPERVIOUS CAP MAINTENANCE PLAN

River Country Cooperative of 1080 West River Street, Chippewa Falls, WI, (or River Country's successor) agrees to maintain the impervious cap constructed at the Chippewa Falls Agricultural Facility. The Chippewa Falls Agricultural facility is located at 1080 West River Street in Chippewa Falls, WI. The extent of the surface to be maintained is identified on figure 1. The maintenance plan includes an annual inspection of the impervious cap by River Country Cooperative personnel. Cracks and/or damaged areas of the cap will be repaired or replaced by River Country Cooperative personnel or a subcontracted asphalt/concrete maintenance company. The annual inspection and maintenance will be performed in the spring of each year. Additional maintenance and damage repair will be performed as the need arises. A record of all maintenance activities will be kept by River Country Cooperative.

INDEXED _____

QUITCLAIM DEED

514060

CMC REAL ESTATE CORPORATION, a Wisconsin corporation, CHICAGO MILWAUKEE CORPORATION, a Delaware corporation, and CMC HEARTLAND PARTNERS, a Delaware partnership with an office at 547 West Jackson Boulevard, Suite 1510, Chicago, Illinois 60661 (successor to Richard B. Ogilvie, not as an individual but solely as Trustee of the property of Chicago, Milwaukee, St. Paul and Pacific Railroad Company, Debtor, being in possession of all the assets and property of said Railroad Company under authority of the United States District Court for the Northern District of Illinois, Eastern Division, Docket No. 77 B 8999 in proceedings under Section 77 of the Bankruptcy Act) ("Grantor"), for and in consideration of the sum of TEN DOLLARS (\$10.00), and other good and valuable consideration, the receipt and sufficiency whereof are hereby acknowledged, does hereby CONVEY and QUITCLAIM, unto RIVER COUNTRY CO-OP, a Wisconsin corporation, whose address is 20900 Swenson Avenue, Suite 900, Waukesha, Wisconsin 53187, ("Grantee"), subject to any and all exceptions and reservations hereinafter set forth, all of the Grantor's interest, if any, in the following described real estate situated and being in the County of Chippewa, State of Wisconsin, ("the Property"), to-wit:

Part of Government Lot 1, Section 12, Township 28 North, Range 9 West, Government Lot 4 of Section 7 and the Southwest Quarter of the Southwest Quarter (SW¼SW¼) of Section 6, Township 28 North, Range 8 West, the exterior boundary of which is more particularly described as follows:

Commencing at the Northeast corner of Section 12, Township 28 North, Range 9 West; thence S 89°14'00" W along the North Line of Section 12, 260.38 feet; thence S 17°27'00" E, 85.11 feet to the point of beginning; thence continuing 17°27'00" E, 177.19 feet; thence S 42°33'00" W, 317.47 feet; thence S 21°54'57" E, 21.22 feet to a point on the Northerly Line of S.T.H. 29; thence N 42°22'32" E along the Northerly Line of S.T.H. 29, 60.89 feet; thence S 47°37'28" E, 25.00 feet; thence N 42°22'32" E, 149.10 feet to a point of curve; thence in a northeasterly direction along the arc of a circular curve to the right, concave to the southeast, having a central angle of 21°41'06", a radius of 1482.69 feet, an arc length of 561.16 feet, the chord of which bears N 53°13'05" E, the chord distance of 557.82 feet; thence N 25°56'22" W leaving the Northerly Line of S.T.H. 29 and not tangent to said curve, 86.64 feet; thence S 75°29'36" W, 232.45 feet; thence S 69°57'46" W, 202.45 feet to the point of beginning.

TRANSFER
FEE
\$ 9.50

Registers Office
Chippewa County, WI } 53
Received for Record
the 8 day of Jan
A.D. 1993 at 2:00 o'clock P. m.
and recorded in vol. 734
of Records Page 461-462
Beatrice M. Kopyeff
Register

This conveyance is subject to general real estate taxes which are a lien but not yet delinquent, and to any and all covenants, leases, licenses, easements, restrictions, and conditions of any kind or character, including but not limited to, building ordinances, codes or laws, public or private roadways and alleys, whether or not of record.


401

GRANTOR reserves unto itself, its successors, grantees and assigns, the right and privilege in the form of an easement in gross for the continued maintenance, operation and use of all existing driveways, roads, conduits, sewers, water mains, gas lines, electric power lines, wires and other utilities and easements of any kind whatsoever on said Property, whether or not of record, including the repair, reconstruction and replacement thereof, unless otherwise provided for herein and a further reservation of the right and privilege of the Grantor, its successors, grantees and assigns to convert any existing leases, licenses and agreements for driveways, roads, conduits, sewers, water mains, gas lines, electric power lines, wires and other utilities to permanent easements by issuance of a suitable grant in recordable form.


IN WITNESS WHEREOF, this instrument is executed by Grantor, this 31st day of December, 19 92.

ATTEST:


 LAWRENCE S. ADELSON
 GENERAL COUNSEL

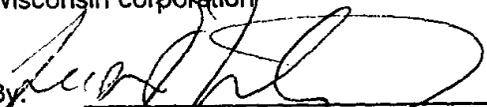CMC REAL ESTATE CORPORATION, a Wisconsin corporation
 By: 


 LEON F. FIORENTINO
 VICE PRESIDENT

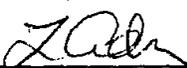ATTEST:


 LAWRENCE S. ADELSON
 GENERAL COUNSEL

CHICAGO MILWAUKEE CORPORATION, a Delaware corporation
 By: 

 LEON F. FIORENTINO
 VICE PRESIDENT

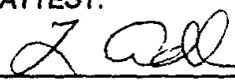ATTEST:


 LAWRENCE S. ADELSON
 GENERAL COUNSEL

CMC HEARTLAND PARTNERS, a Delaware general partnership
 By: 


 LEON F. FIORENTINO
 VICE PRESIDENT

STATE OF ILLINOIS)
) SS
 COUNTY OF COOK)

On the date above noted, before me, the undersigned, a Notary Public in and for the county and state aforesaid, do hereby certify that Leon F. Fiorentino, personally known to me to be the Vice President of CMC REAL ESTATE CORPORATION, a Wisconsin corporation, the Vice President of CHICAGO MILWAUKEE CORPORATION, a Delaware Corporation, and the Vice President of CMC HEARTLAND PARTNERS, a Delaware general partnership and Lawrence S. Adelson, personally known to me to be the General Counsel of said corporations and said general partnership, and personally known to me to be the same persons whose names are subscribed to the foregoing instrument, appeared before me this day in person and acknowledged that as such Vice President and General Counsel of said corporations, they caused the corporate seal of CMC REAL ESTATE CORPORATION and of CHICAGO MILWAUKEE CORPORATION to be affixed thereto, pursuant to authority given by the Board of Directors of said corporations as their free and voluntary act, and as the free and voluntary act and deed of said corporations for the uses and purposes therein set forth.

Given under my hand and seal this 31st day of December, 19 92.

" OFFICIAL SEAL "
 PATRICIA JOHNSON
 NOTARY PUBLIC, STATE OF ILLINOIS
 MY COMMISSION EXPIRES 2/19/96

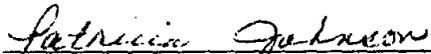

 Notary Public

My commission expires: 2-19-96

F.E.I.N. 36-6000639
 F.E.I.N. 36-2722561
 F.E.I.N. 36-3606608

CMC REAL ESTATE CORPORATION
 CHICAGO MILWAUKEE CORPORATION
 CMC HEARTLAND PARTNERS

THIS DEED WAS PREPARED BY TITLE & CLOSING DEPARTMENT, CMC HEARTLAND PARTNERS, CHICAGO, ILLINOIS 60661

2 
 1200 pd

**FIGURE 1
PLAT MAP
RIVER COUNTRY COOP
PARCEL NO. 22809-1211-50010175**



DISCLAIMER: This map is not guaranteed to be accurate, correct, current, or complete and conclusions drawn are the responsibility of the user.

Statement Regarding Legal Description of
River Country Coop Facility
1080 West River Street, Chippewa Falls, Wisconsin
DATCP Case No. 91409052901
WDNR BRRTS No. 02-09-000365


The legal description for the site specified above, and as shown on Document No. 613040
attached to this statement, is complete and accurate to the best of my knowledge.



Signature




Date


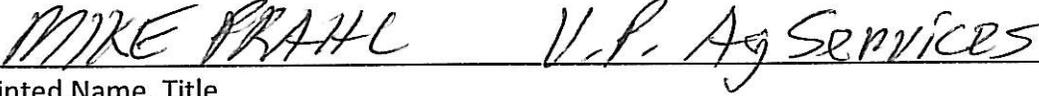


Printed Name, Title

Agritech
16779 98th Street
Bloomer, WI 54742

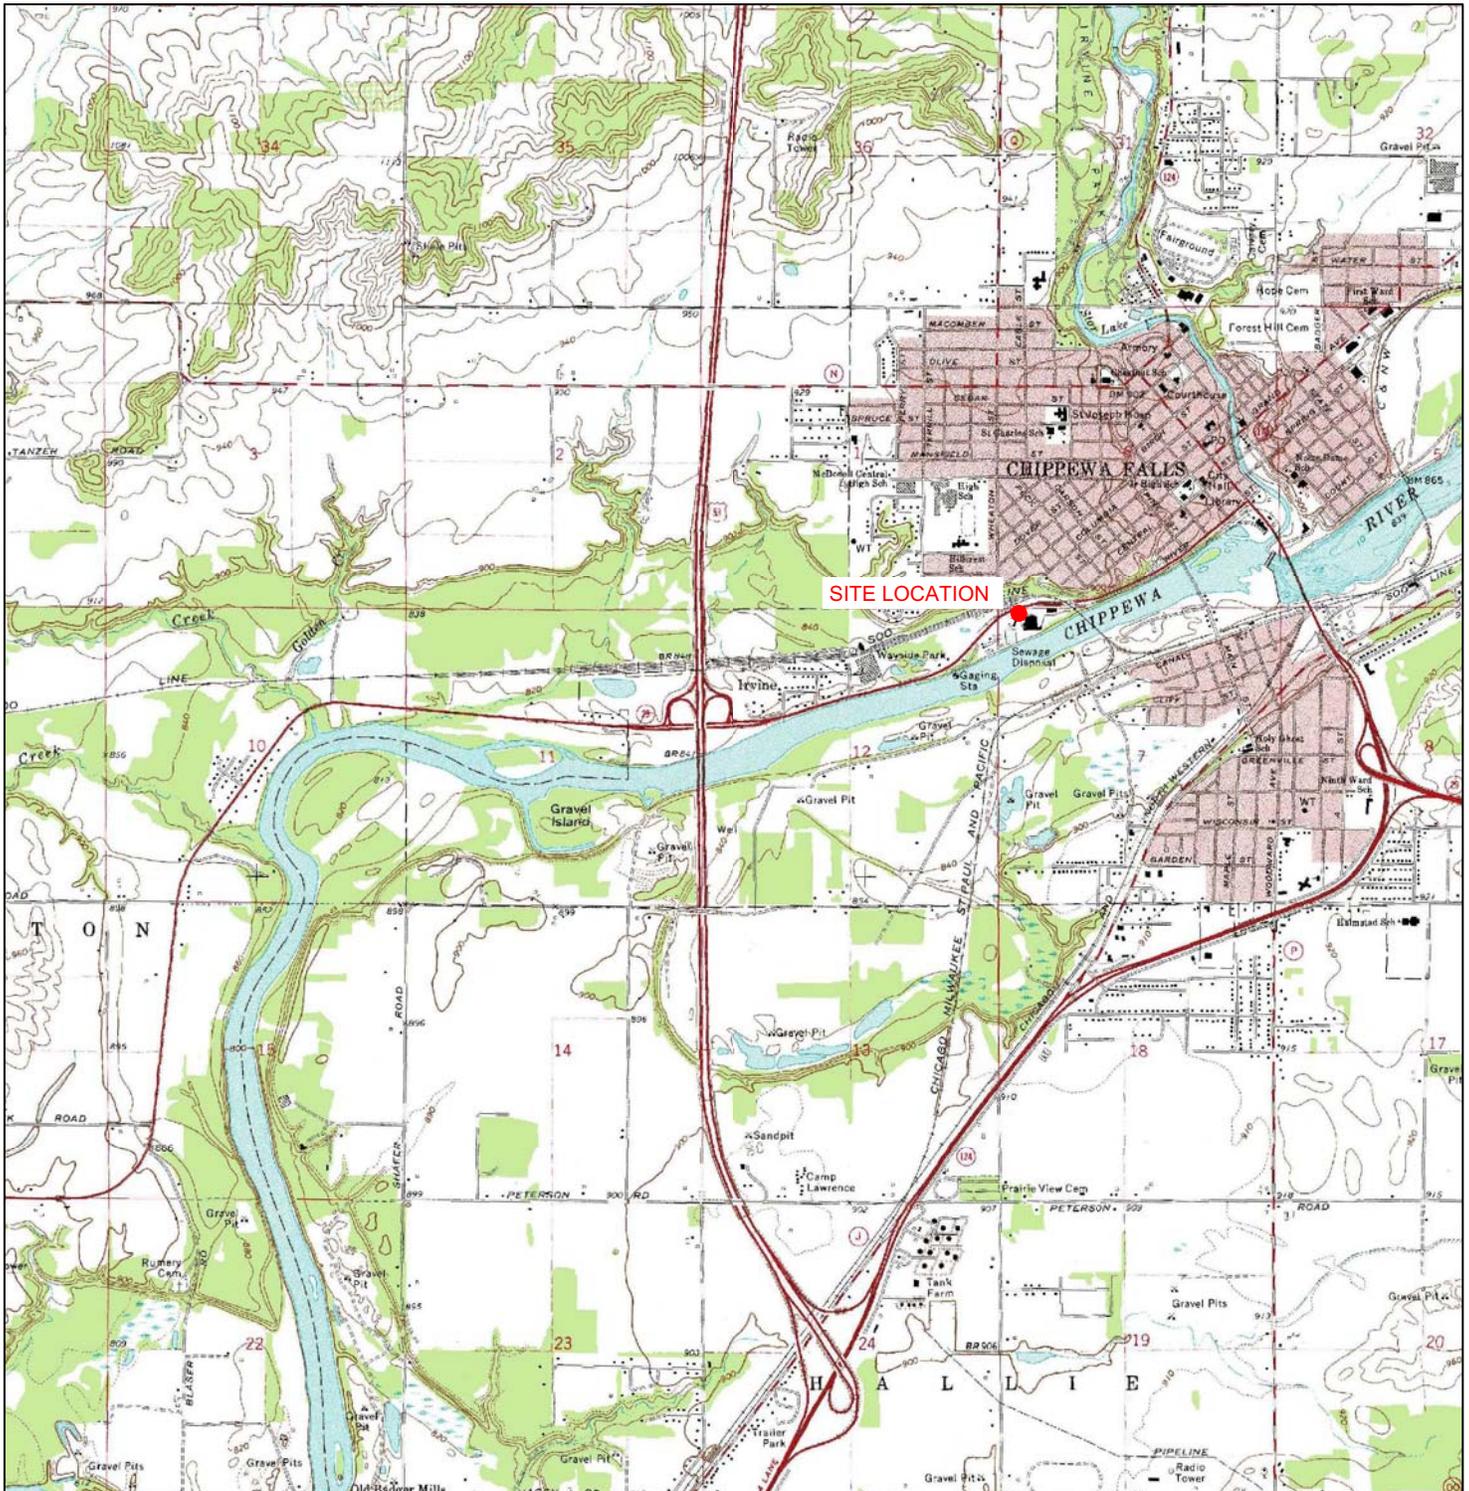



SITE LOCATION

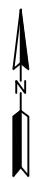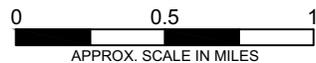

Source: USGS 7.5' Topographic Map

 <p>SAND CREEK CONSULTANTS, INC. 151 Mill Street, PO Box 218 Amherst, WI 54406 Tel: 715.824.5169 Fax: 866.608.6473</p>	<p>SITE LOCATION MAP</p>	<p>FIGURE 2</p>
	<p>RIVER COUNTRY COOP CHIPPEWA FALLS, WISCONSIN</p>	<p>DRAWN BY: TNN 14-OCT-2010</p>

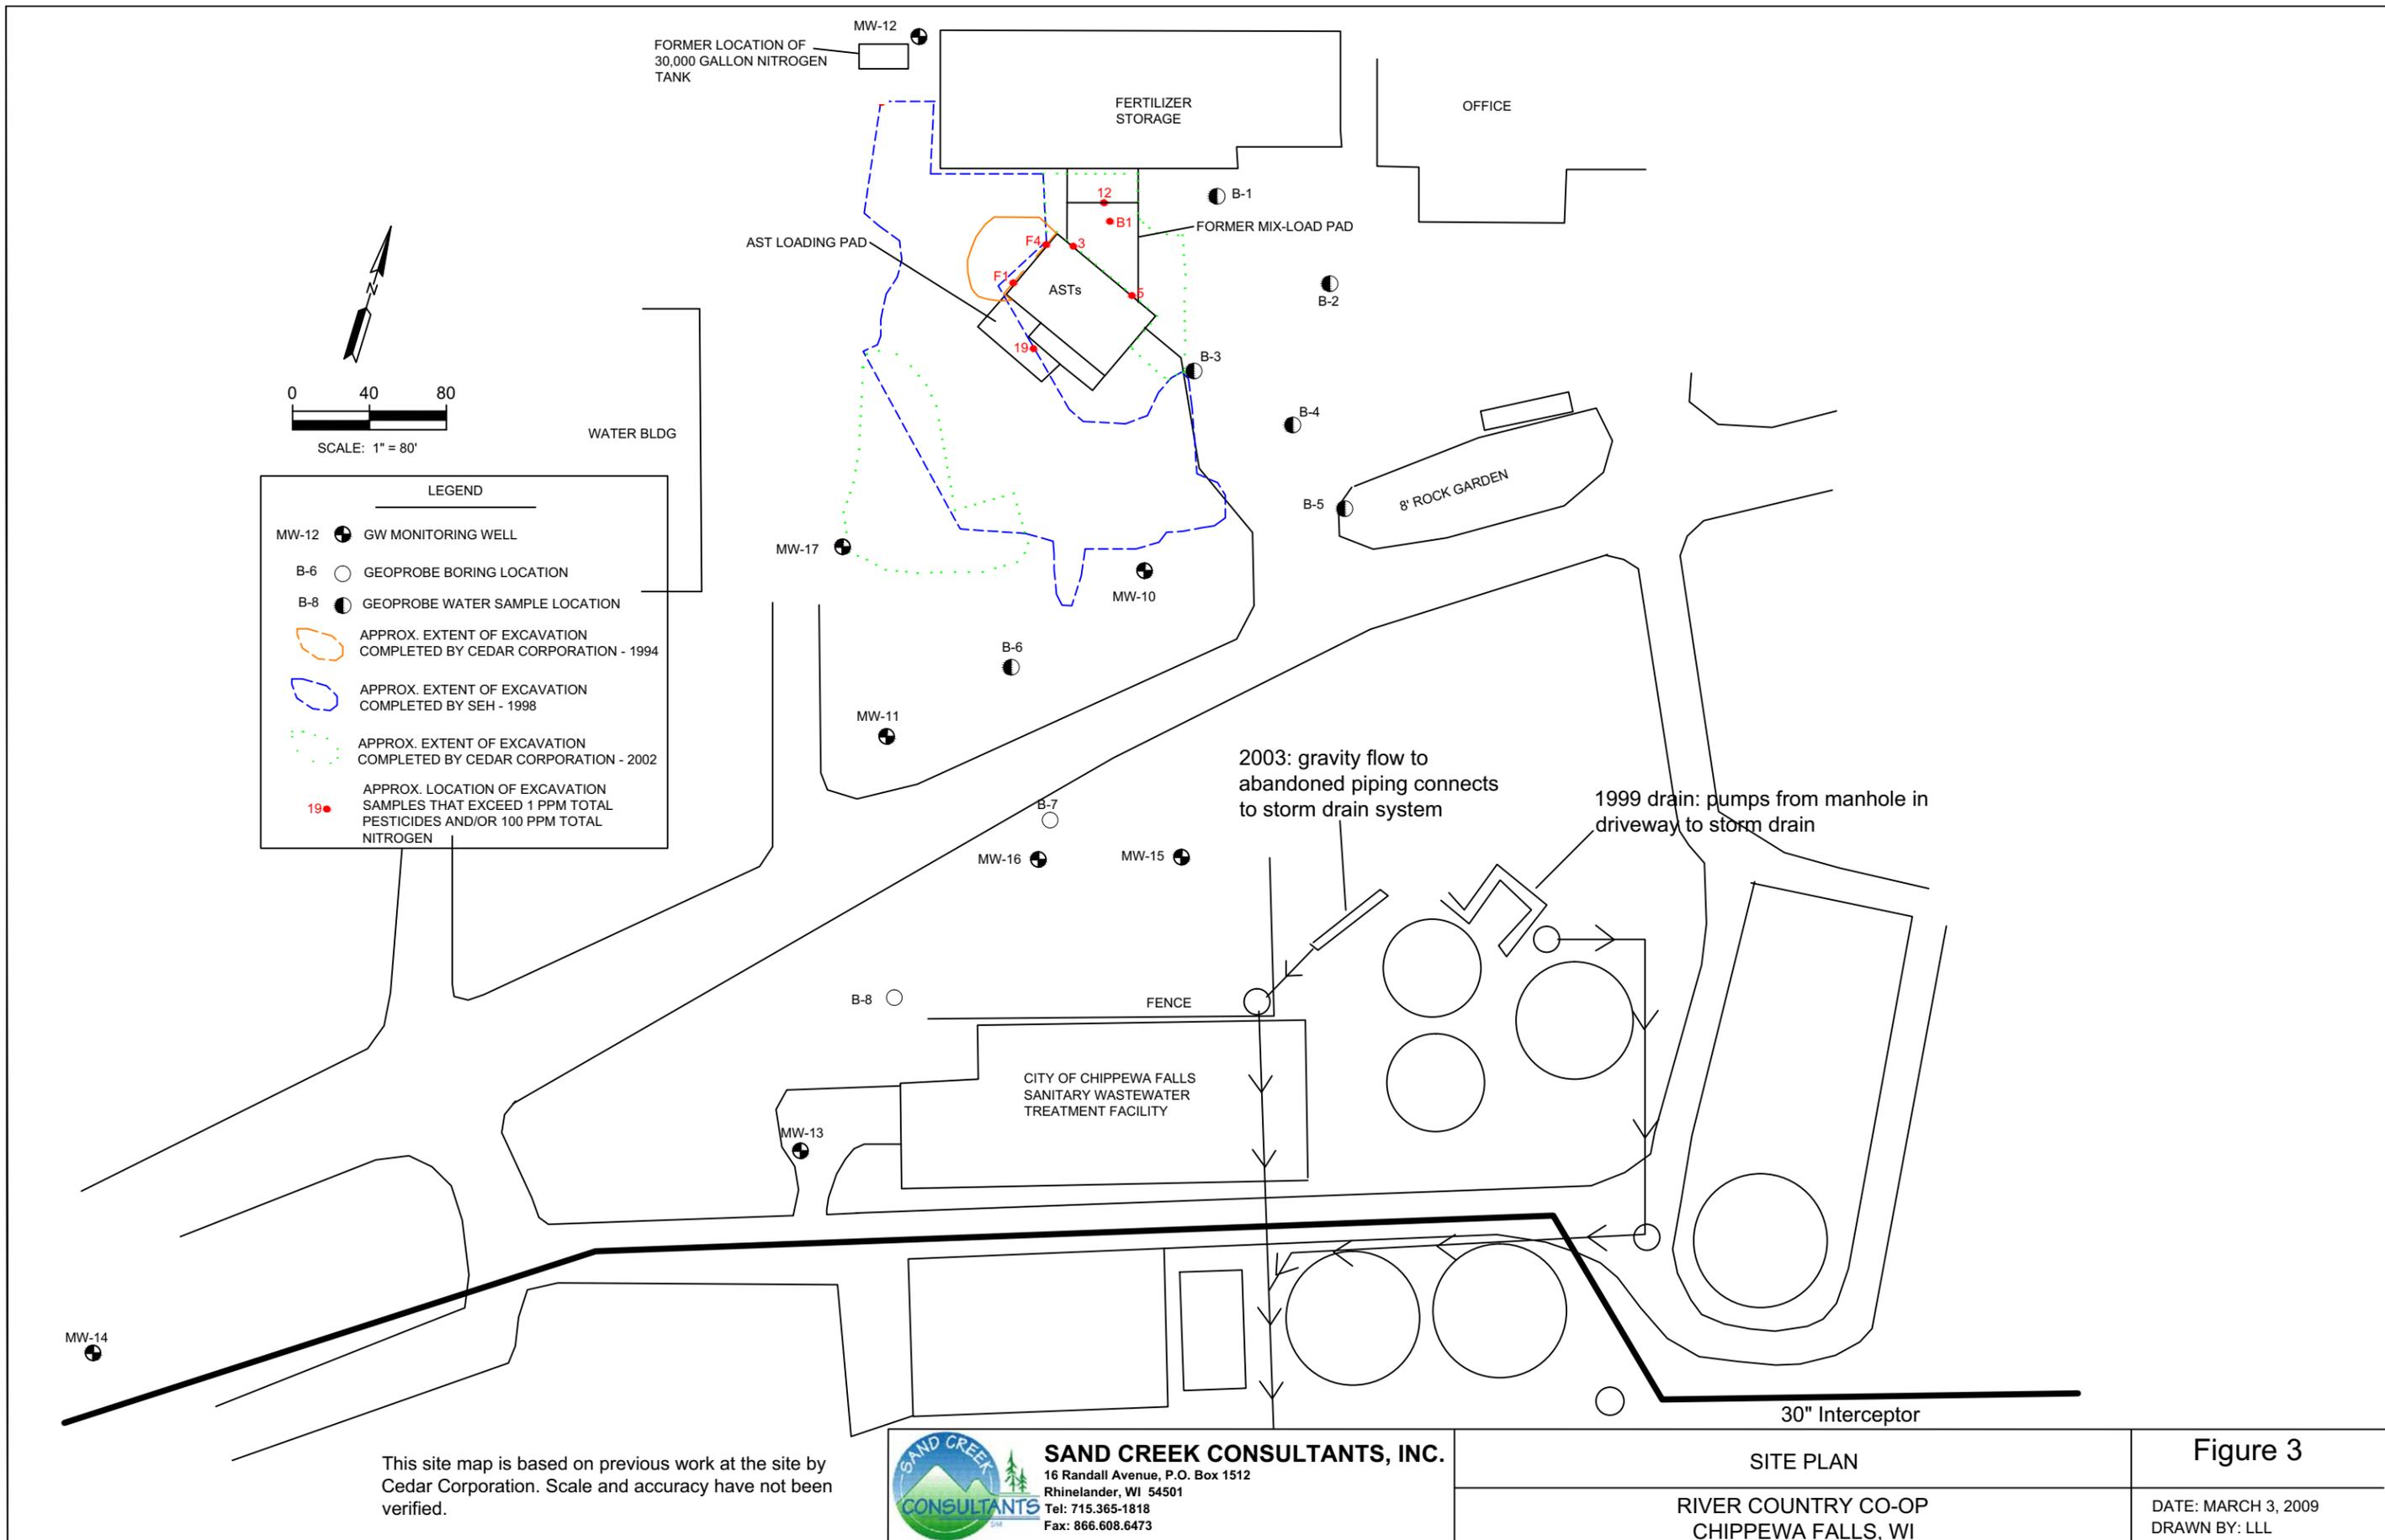

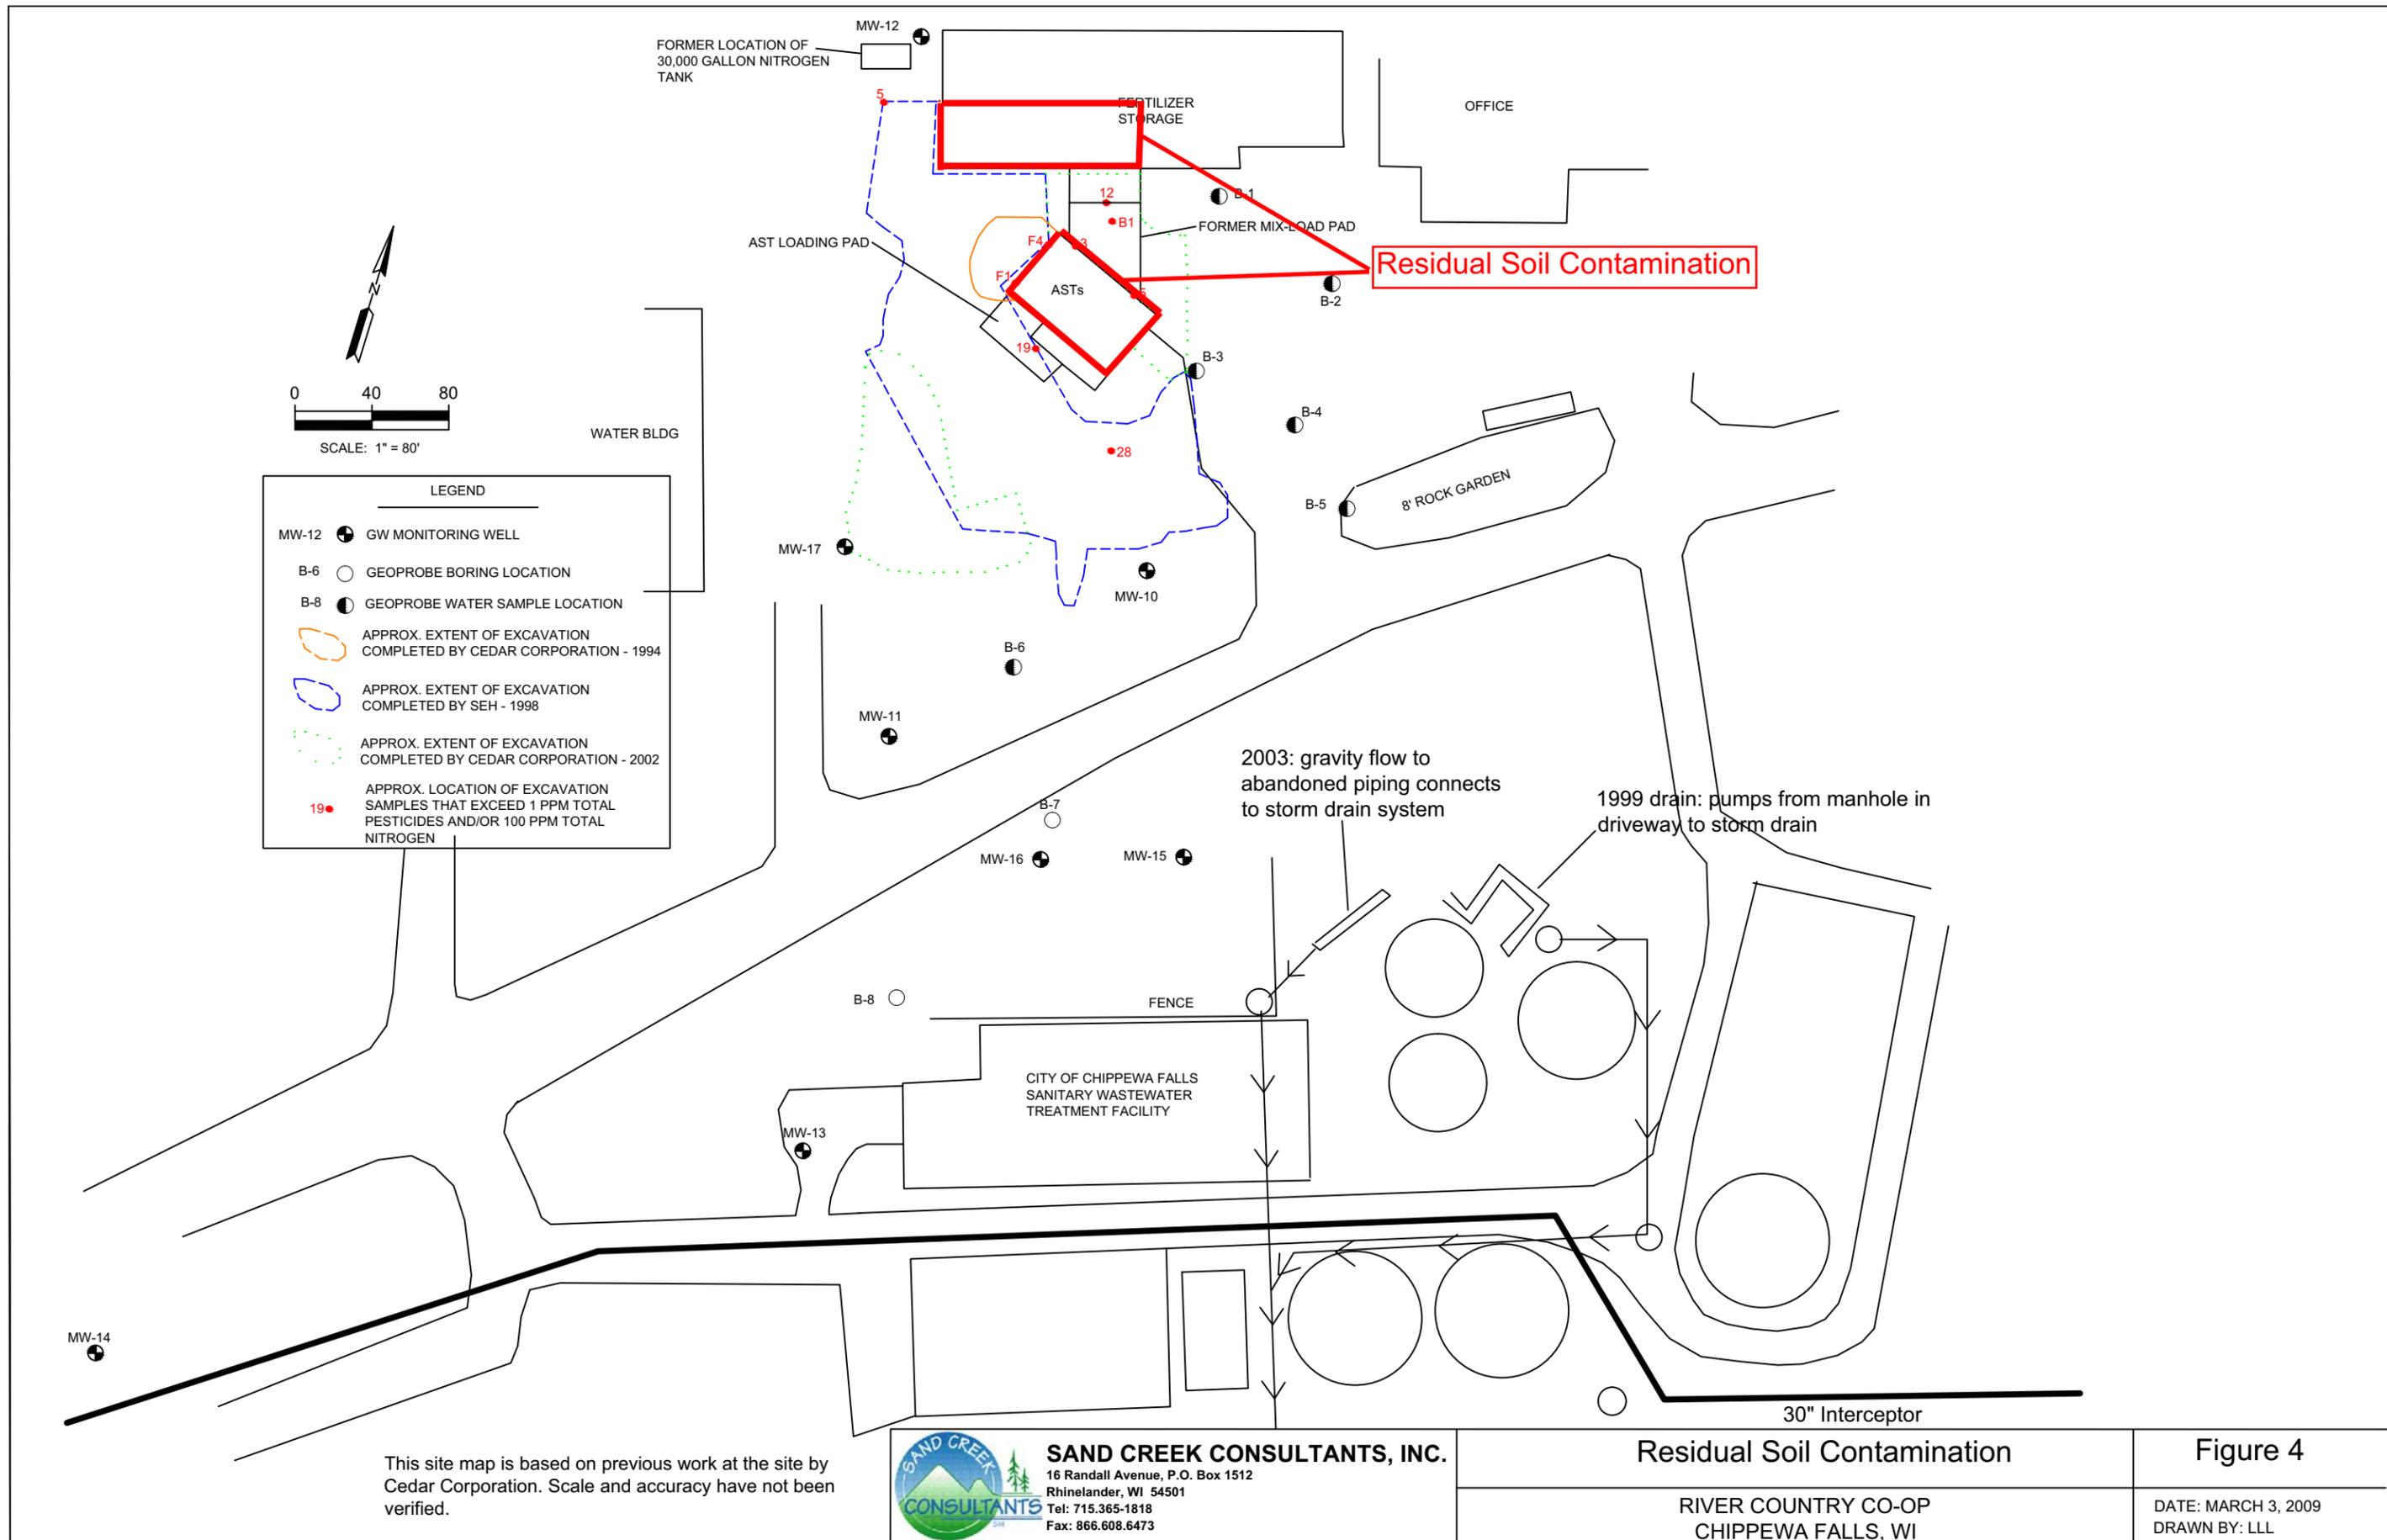

This site map is based on previous work at the site by Cedar Corporation. Scale and accuracy have not been verified.




SAND CREEK CONSULTANTS, INC.
 16 Randall Avenue, P.O. Box 1512
 Rhinelander, WI 54501
 Tel: 715.365-1818
 Fax: 866.608.6473

Residual Soil Contamination

RIVER COUNTRY CO-OP
 CHIPPEWA FALLS, WI

Figure 4


DATE: MARCH 3, 2009
 DRAWN BY: LLL

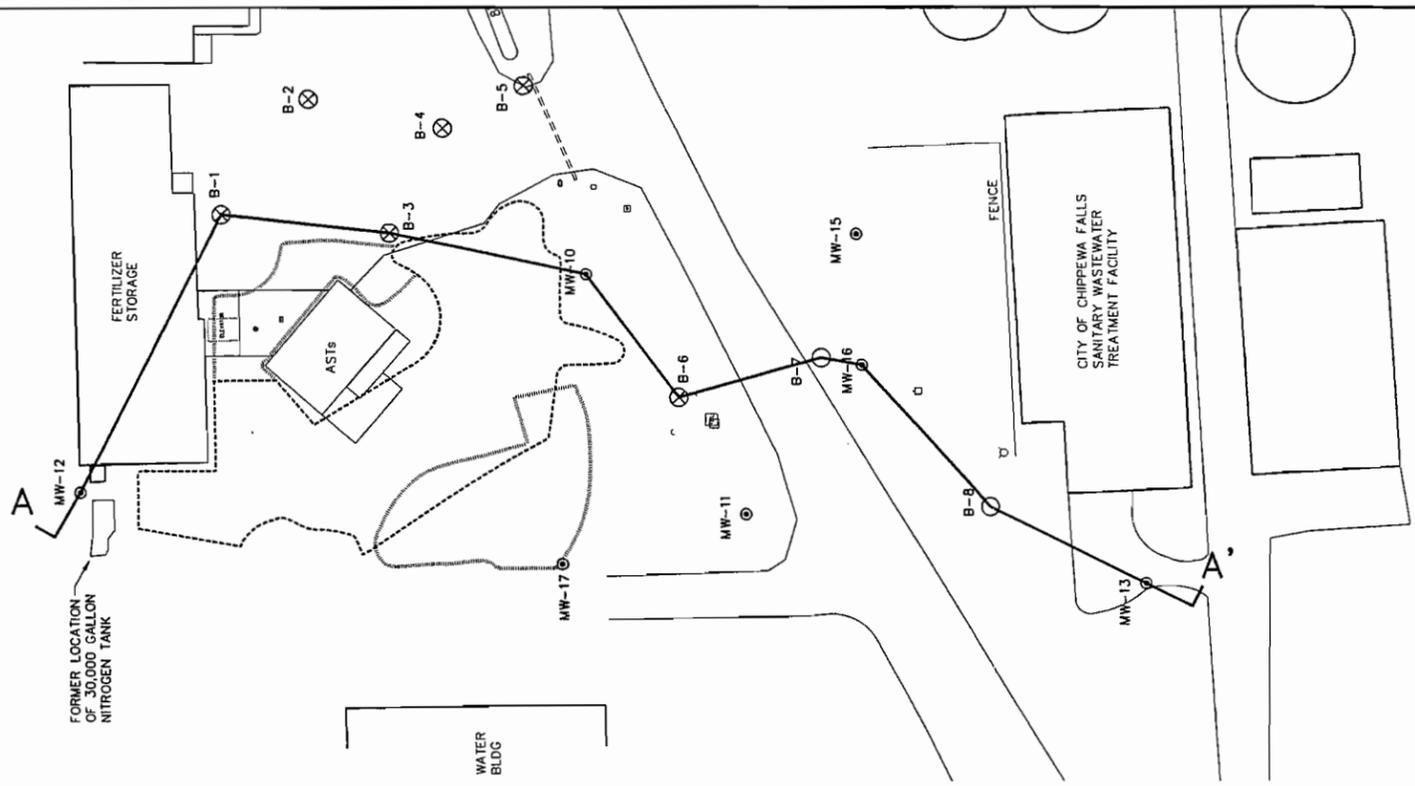

CROSS SECTION A-A'

LEGEND

- ⊙ = GROUND WATER MONITORING WELL
- = GEOPROBE BORING LOCATIONS
- ⊗ = GEOPROBE WATER SAMPLE LOCATIONS
- = APPROXIMATE EXTENT OF EXCAVATION COMPLETED BY SEH
- = EXTENT OF EXCAVATION COMPLETED BY CEDAR CORPORATION - MAY 2002

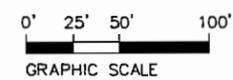

ABBREVIATIONS

F---Fine M---Medium C---Coarse
 Ws---Weathered So---Sound

MATERIAL SYMBOLS

Topsoil	Silt	Sandstone
Sand	Peat	Limestone
Gravel	Clay	Igneous Rock


LEGEND OF BORING

GRO - Gasoline Range Organics
 DRO - Diesel Range Organics
 B - Benzene
 E - Ethylbenzene
 MTBE - Methyl-tert-butyl-ether
 T - Toluene
 1,2,4-TMB - Trimethylbenzene
 1,3,5-TMB - Trimethylbenzene
 X - Xylene

* Laboratory Analytical Results

Ground Water Elevation
 No Ground Water Observed Above This Elevation

NA = Not Analyzed
 * GRO And DRO Laboratory Results Reported in PPM
 All Other Laboratory Results Reported in PPB

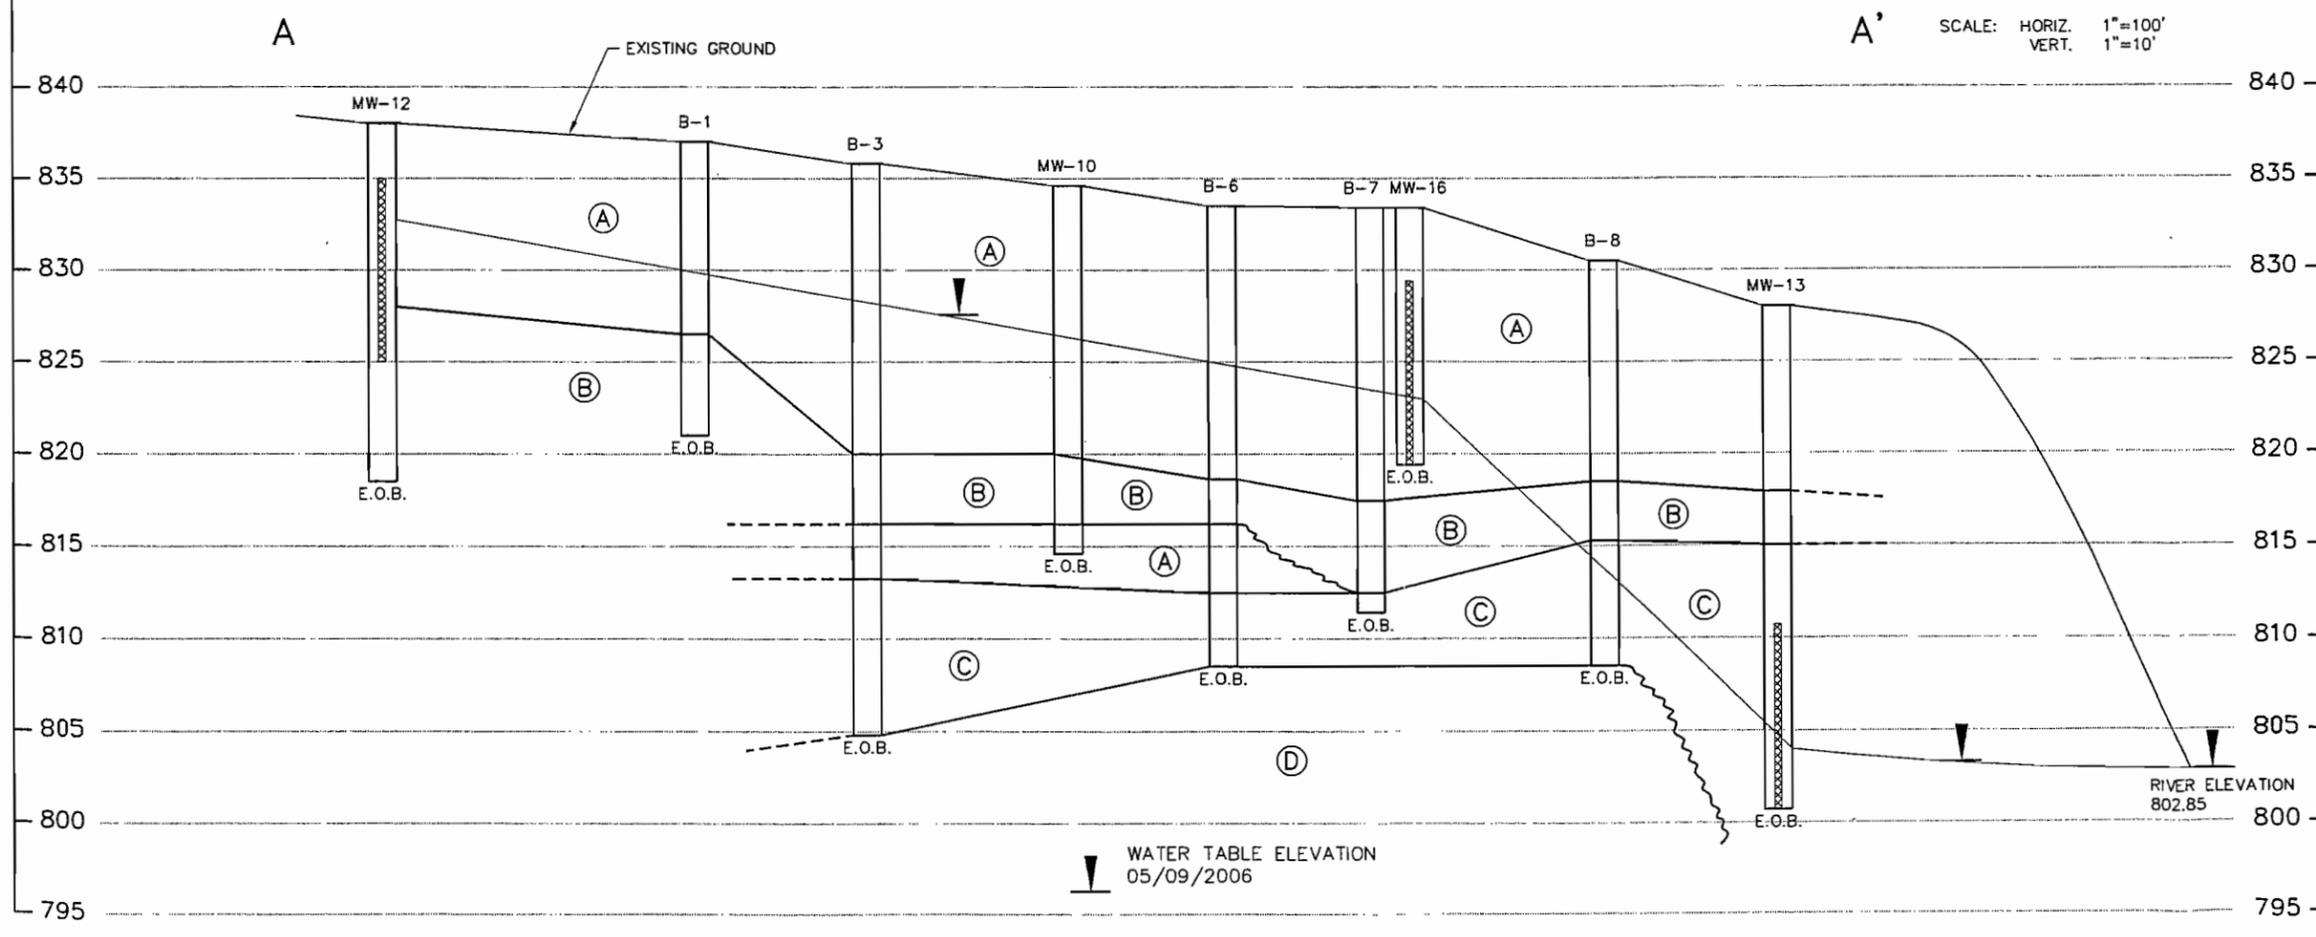

GEOLOGIC LEGEND

- (A) - FINE-MEDIUM BROWN, WELL GRADED GRAVELLY SAND (USCS-SW)
- (B) - FINE, BROWN, SILTY-SAND (USCS-SM)
- (C) - MEDIUM, BROWN, POORLY-GRADED SAND (USCS-SP)
- (D) - BEDROCK (AUGER REFUSAL)

Cedar corporation
 60+ Menomonie, WI


engineers • architects • planners • environmental specialists
 land surveyors • landscape architects • interior designers

RIVER COUNTRY CO-OF CHIPPEWA FALLS, WI

CROSS SECTION A-A'
 Figure 5

Drawn By	PKF	Plans Checked	SEM
Drawing File	R021AA.DWG	Job Number	R1381-021

CROSS SECTION A - A'

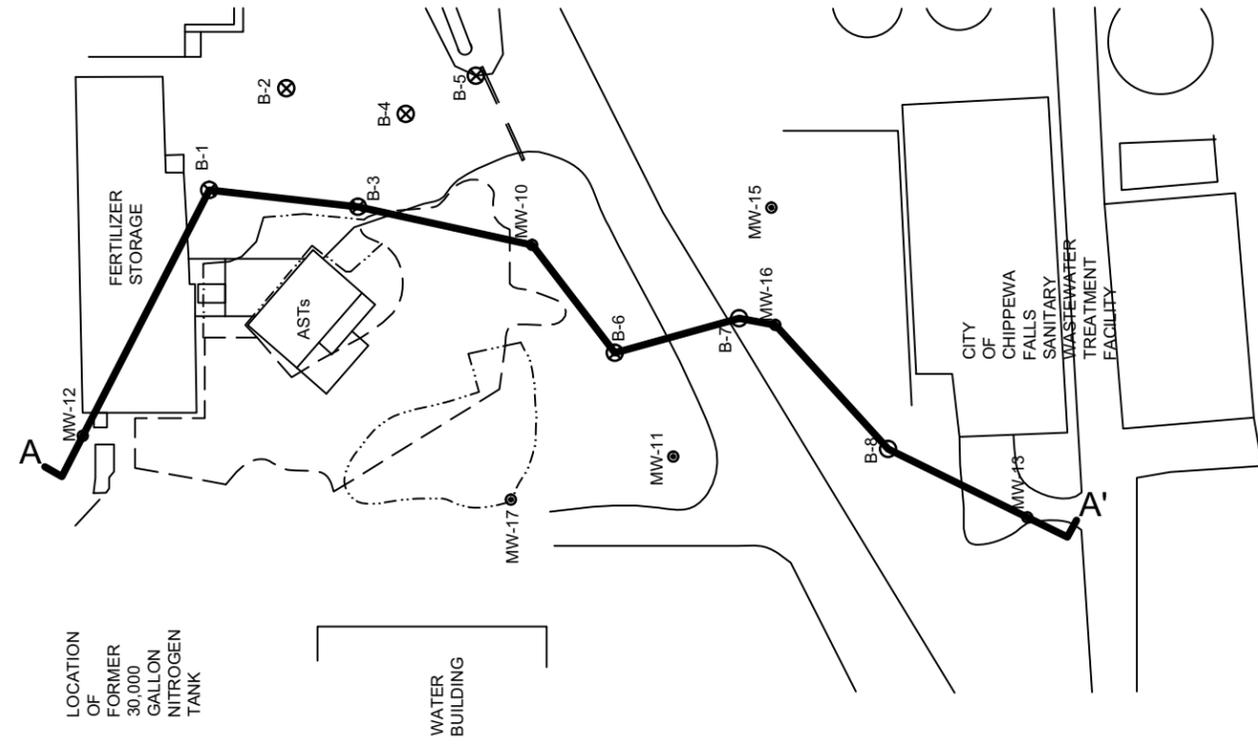


LEGEND

- GROUND WATER MONITORING WELL
- GEOPROBE BORING LOCATIONS
- ⊗ GEOPROBE WATER SAMPLE LOCATIONS
- - - - - APPROXIMATE EXTENT OF EXCAVATION COMPLETED BY SEH
- ▭ EXTENT OF EXCAVATION COMPLETED BY CEDAR CORPORATION - MAY 2002


LOCATION OF FORMER 30,000 GALLON NITROGEN TANK

WATER BUILDING

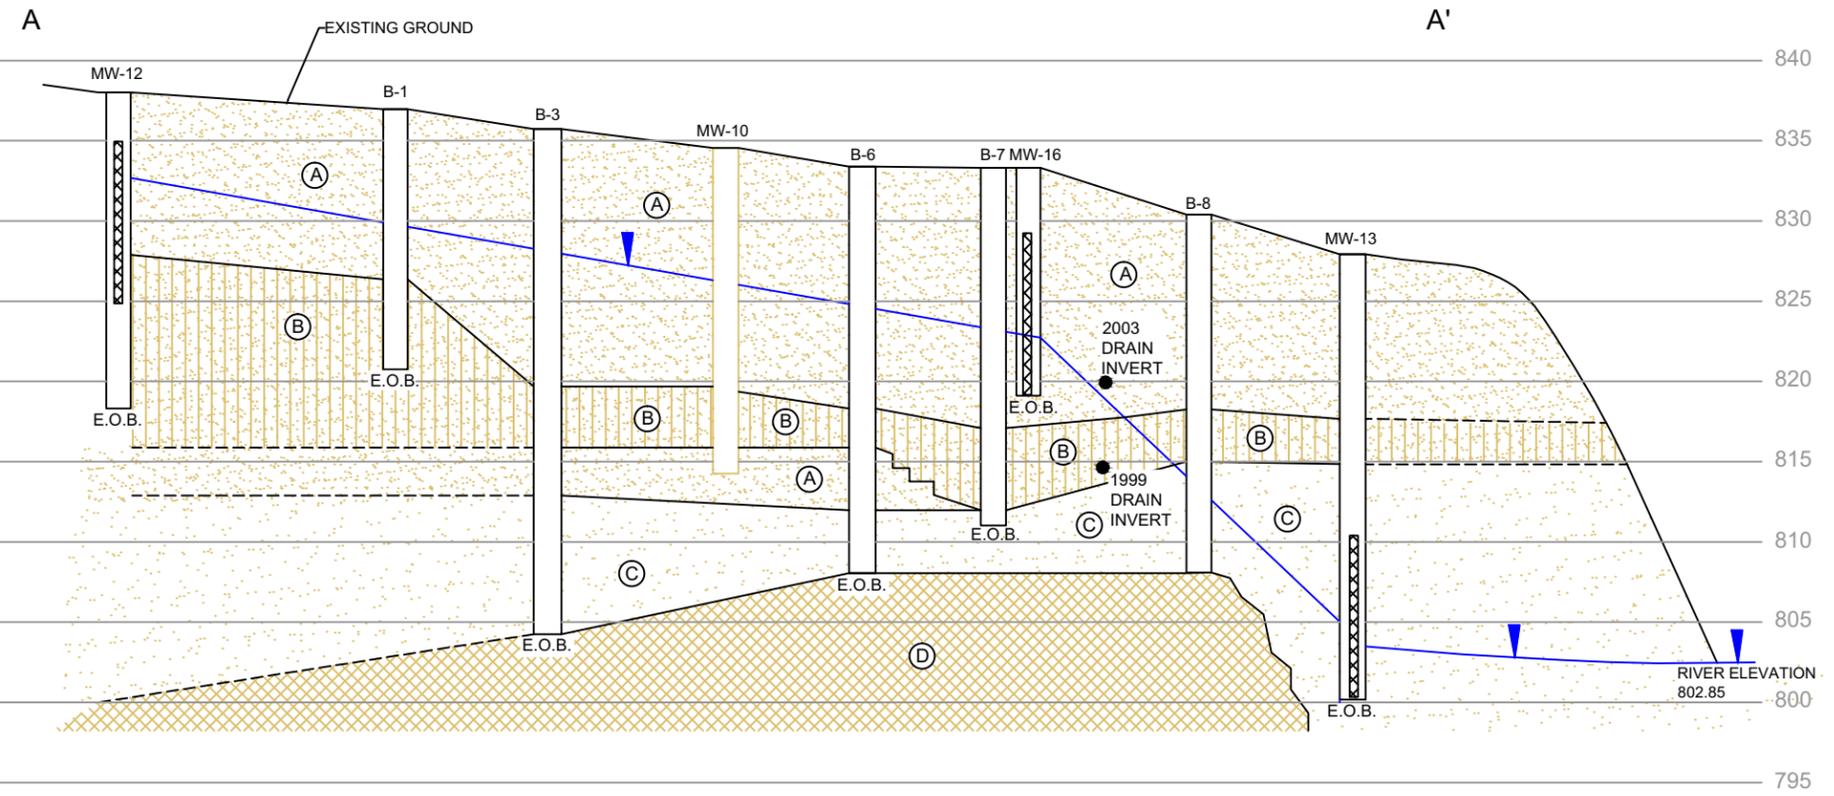

LEGEND

- (A) FINE - MEDIUM BROWN, WELL GRADED GRAVELLY SAND (USCS-SW)
- (B) FINE, BROWN, SILTY-SAND (USCS-SM)
- (C) MEDIUM, BROWN, POORLY-GRADED SAND (USCS-SP)
- (D) BEDROCK (AUGER REFUSAL)
- ▼ WATER TABLE ELEVATION 05 / 09 / 2006

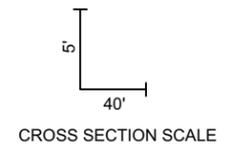


SAND CREEK CONSULTANTS, INC.
 151 Mill Street, PO Box 218
 Amherst, WI
 Tel: 715.824.5169
 Fax: 866.608.6473

CROSS SECTION A-A'
 RIVER COUNTRY COOP
 CHIPPEWA FALLS, WISCONSIN

FIGURE 6
 24-SEPT-2010

DRAWN BY: TNN
 APPROVED BY:

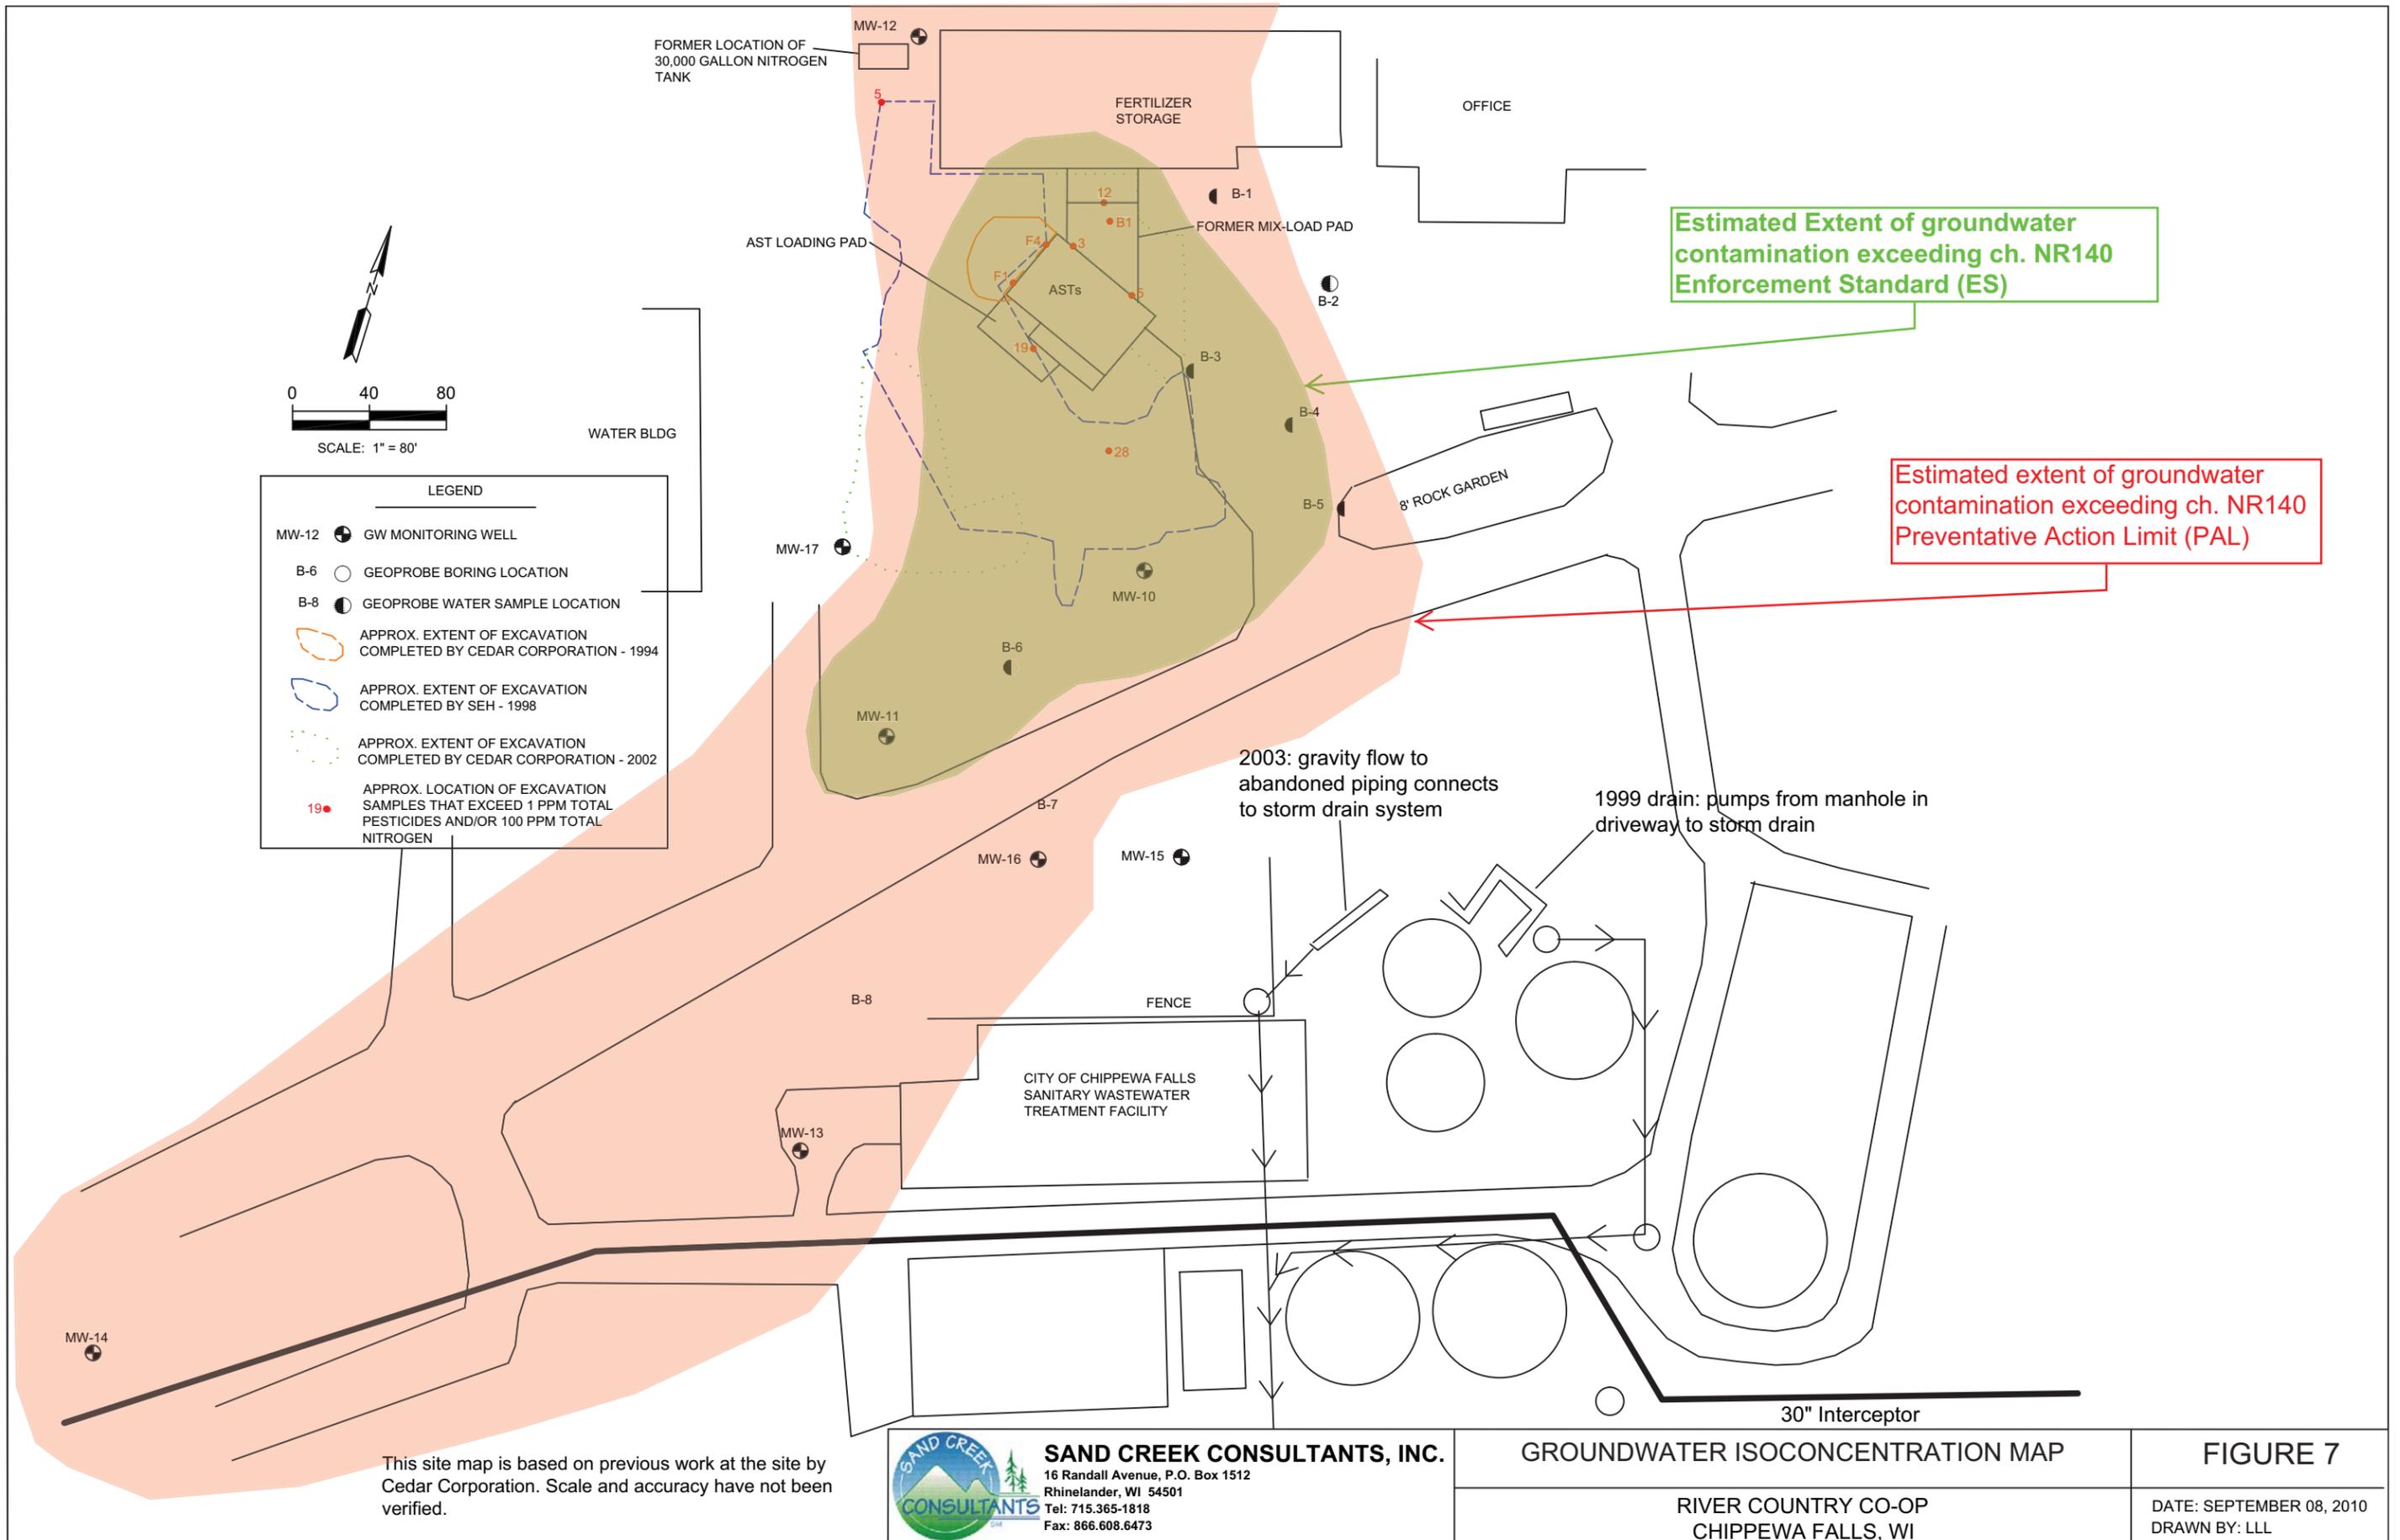

This site map is based on previous work at the site by Cedar Corporation. Scale and accuracy have not been verified.




SAND CREEK CONSULTANTS, INC.
 16 Randall Avenue, P.O. Box 1512
 Rhinelander, WI 54501
 Tel: 715.365-1818
 Fax: 866.608.6473

GROUNDWATER ISOCONCENTRATION MAP

RIVER COUNTRY CO-OP
 CHIPPEWA FALLS, WI

FIGURE 7

DATE: SEPTEMBER 08, 2010
 DRAWN BY: LLL

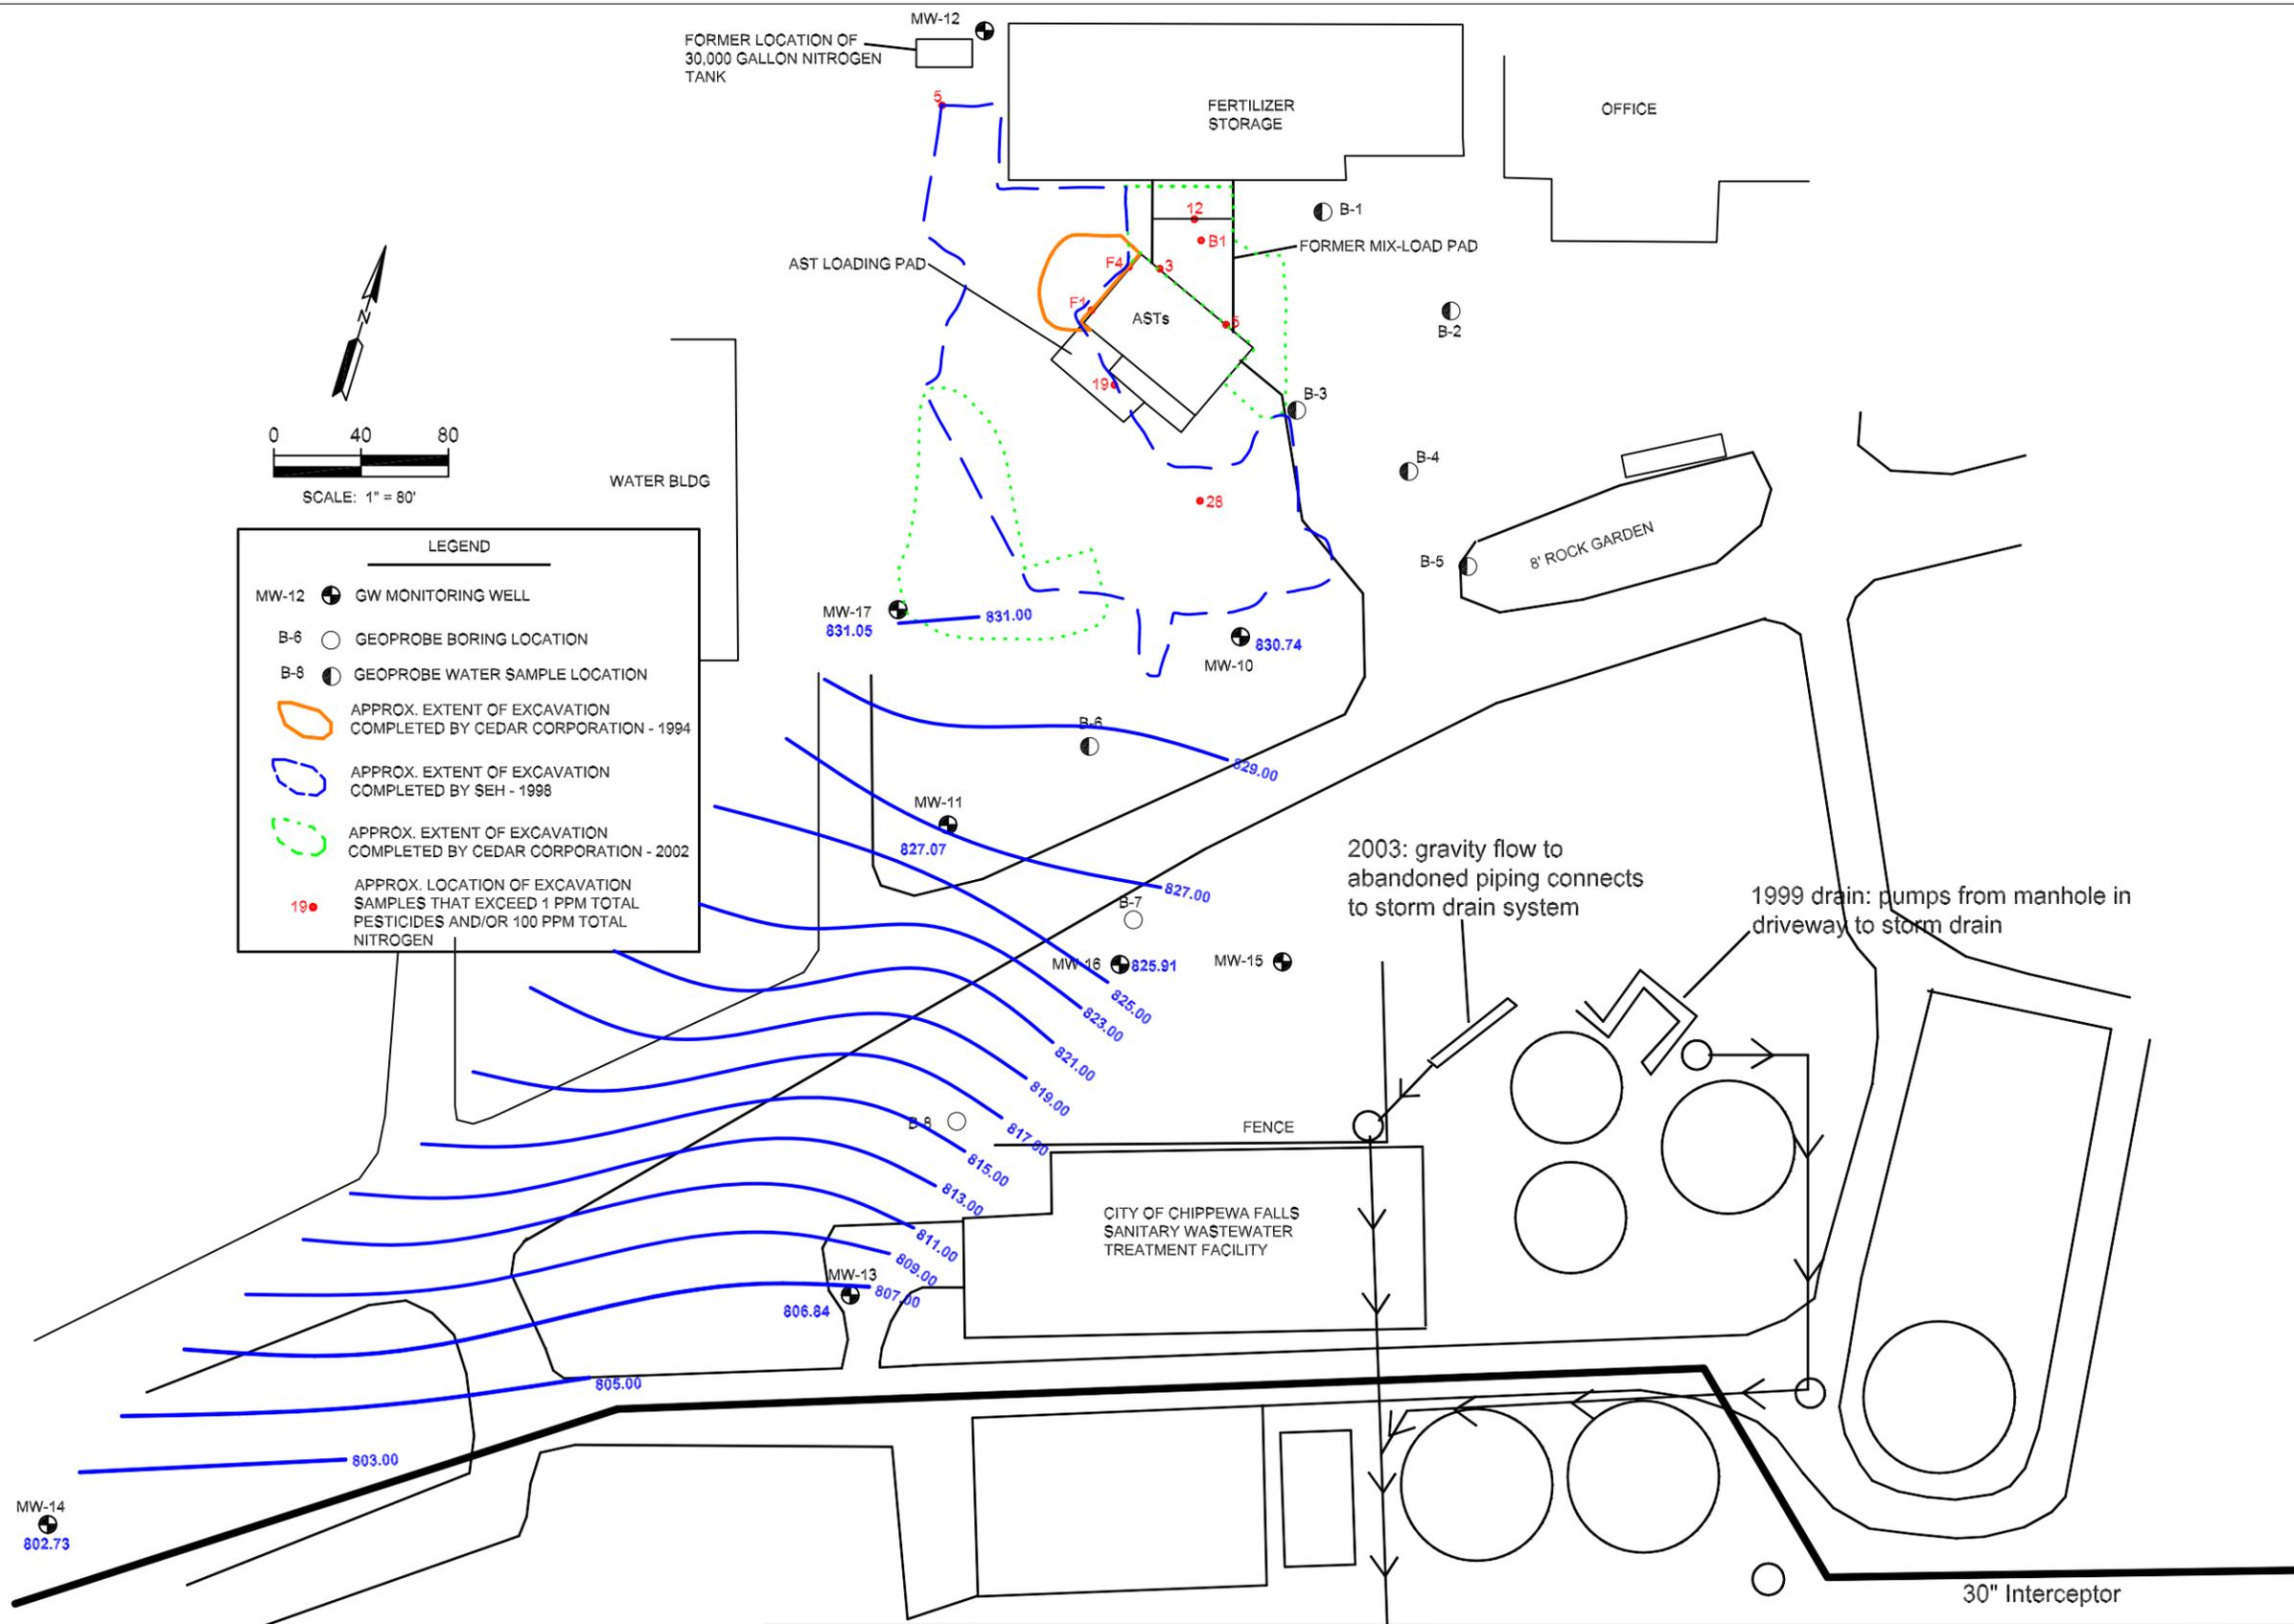

This site map is based on previous work at the site by Cedar Corporation. Scale and accuracy have not been verified.

SAND CREEK CONSULTANTS, INC.
 151 Mill Street, P.O. Box 218
 Amherst, WI 54406
 Tel: 715.824.5169
 Fax: 866.608.6473

GROUNDWATER CONTOURS
 JUNE 18, 2009
 RIVER COUNTRY CO-OP
 CHIPPEWA FALLS, WI

FIGURE 8
 DATE: JUNE 8, 2010
 DRAWN BY: RSH

TABLE 1

SOIL ANALYTICAL TABLE
River Country Cooperative
1080 West River Road
Chippewa Falls, Wisconsin

Sample ID	Sample Date	Sample Depth (feet)	Ammonia-N (mg/kg)	Nitrate-N (mg/kg)	Atrazine (mg/kg)	Acetochlor (mg/kg)	Alachlor (mg/kg)	Butylate (mg/kg)	Cyanazine (mg/kg)	Dimethenamid (mg/kg)	EPTC (mg/kg)	Metolachlor (mg/kg)	Metribuzin (mg/kg)	Pendimethalin (mg/kg)	Propazine (mg/kg)	Simazine (mg/kg)	Trifluralin (mg/kg)
F1	11/15/1993	2.5			0.35		2.3	<0.350	<0.200			3.9	<0.100	<0.100		<0.100	<0.100
F4	11/15/1993	2			<0.200		0.105	<0.350	<0.200			4	<0.100	<0.100		<0.100	<0.100
12	5/13/02 - 5/15/02	1	71	28	-	-	0.34	-	-	-	-	0.82	-	1	-	-	0.18
		4	58	-	<5	<5	6.8	23	<5	<5	36	7.3	<5	<5	<5	<5	<5
		7	140	57	<20	<20	<20	<20	<20	<20	<20	250	<20	33	<20	<20	<20
3	5/13/02 - 5/15/02	1	-	-	-	-	-	-	-	-	-	0.22	-	0.13	-	-	-
		4	66	-	9	<2.5	7.8	5.1	<2.5	<2.5	24	6.4	<2.5	12	<2.5	<2.5	<2.5
		7	96	-	20	15	<5	8.9	<5	<5	22	58	<5	54	<5	<5	<5
5	5/13/02 - 5/15/02	1	29	-	-	-	-	-	-	-	3.5	0.26	-	0.1	-	-	-
		4	600	140	<1	<1	0.4	0.54	<1	<1	1.2	0.47	<1	3.1	<1	<1	<1
		7	-	-	<1	<1	1	2.2	<1	<1	3.8	1.5	<1	9.3	<1	<1	<1
B-1	5/13/02 - 5/15/02	7	-	-	<5	<5	7.1	5.8	<5	<5	13	14	<5	27	<5	<5	<5
19	11/20/1998	2	110	46													

Definitions/Abbreviations:

ID = Identification
 - = not detected
 Blank Cell = not analyzed

TABLE 2
FLUID LEVELS AND GROUNDWATER ANALYTICAL DATA
 River Country Cooperative
 1080 West River Road
 Chippewa Falls, Wisconsin

Well ID	Sample Date	Top of Casing (TOC) Elevation (ft above MSL)	Depth to Groundwater (feet below TOC)	Groundwater Elevation (ft above MSL)	NO ₃ (mg/L)	Atrazine (Total) (µg/L)	Acetochlor (µg/L)	Alachlor (µg/L)	Butylate (µg/L)	Cyanazine (µg/L)	Dimethenamid (µg/L)	EPTC (µg/L)	Metolachlor (µg/L)	Metribuzin (µg/L)	Prometon (µg/L)	Propazine (µg/L)	Simazine (µg/L)	Trifluralin (µg/L)	
					10	3	7	2	400	1	50	250	100	70	100	10	4	7.5	
					2	0.3	0.7	0.2	80	0.1	5	50	10	14	20	2	0.4	0.75	
MW-10	6/24/1993	836.89			7.7	3.7		3.2					3.2						
	10/27/1993					3.87													
	3/28/1994																		
	10/4/1994						8.1		8.2										
	3/8/1995						4		3					4.6					
	9/28/1995						<1.0		58					45					
	7/18/1996					40.6													
	7/10/1997					3													
	1/30/1999					59													
	4/21/1999					18	27		9.6					25					
	7/28/1999					17													
	10/11/1999					32													
	1/31/2000					41													
	1/2/2001					30	8.8		19					80					
	4/26/2001					14	6.5		5.5					36					
	10/19/2001					20	1.9		4.3					12					
	4/12/2002					7.1	1.74		2.27					8.04					
	11/26/2002					2.2	40.2		92.6					<3					
	4/23/2003					10	12		6.6					23					
	10/3/2003					32	46		75					350					
5/14/2004				49	20		76					320							
8/18/2005				12	7.3		22					130							
11/8/2005				53	6		44					270							
2/13/2006				27	11		45					250							
5/9/2006				48	7.4		59					260							
6/18/2009			6.15	830.74	49	5.05	3.4	43	1.0	-	0.71	8.5	210	-	-	0.080	-	-	
MW-11	10/20/1992	834.74			58	7.3		16					20						
	6/24/1993				32	1		0.47					2.3						
	10/27/1993						6.51		67.4										
	3/28/1994						5		35				56						
	10/4/1994						7.2		29.5										
	3/8/1995						0.5		0.77				4.9						
	9/28/1995						3.8		10				63						
	7/18/1996					46.6													
	7/10/1997					205													
	1/30/1999					100													
	4/21/1999					23	0.44		0.55				14						
	7/28/1999					53													
	10/11/1999					98													
	1/31/2000					210													
	1/2/2001					20	0.29		2				55						
	4/26/2001					18	.11		.48				11						
	10/19/2001					14	.38		.97				26						
4/12/2002				10.3	.632		.744				16.6								

TABLE 2
FLUID LEVELS AND GROUNDWATER ANALYTICAL DATA
 River Country Cooperative
 1080 West River Road
 Chippewa Falls, Wisconsin

Well ID	Sample Date	Top of Casing (TOC) Elevation (ft above MSL)	Depth to Groundwater (feet below TOC)	Groundwater Elevation (ft above MSL)	NO ₃ (mg/L)	Atrazine (Total) (µg/L)	Acetochlor (µg/L)	Alachlor (µg/L)	Butylate (µg/L)	Cyanazine (µg/L)	Dimethenamid (µg/L)	EPTC (µg/L)	Metolachlor (µg/L)	Metribuzin (µg/L)	Prometon (µg/L)	Propazine (µg/L)	Simazine (µg/L)	Trifluralin (µg/L)
MW-11 (cont.)	11/26/2002	834.74			5	.34		.268					14.5					
	4/23/2003				14	.11		.73					20					
	10/3/2003				15	.23		<0.053					25					
	5/14/2004				17	1		<0.053					18					
	8/16/2005				13	.44		<0.085					7.9					
	11/8/2005					6.3	<0.16		<0.35				9.4					
	2/13/2006					4.1	.17		<0.11				7.9					
	5/9/2006					4.3	.32		<0.35				7.4					
6/18/2009		7.67	827.07	20	0.219	-	-	-	-	0.054	-	2.7	-	-	-	-	-	
MW-12	6/24/1993	830.32		834.57	1.9	23		62					5.6					
	10/27/1993			833.20		1.27		1.53										
	3/28/1994				832.88		1.1		<0.50					0.78				
	10/4/1994						1.02		5.2									
	3/8/1995						<0.50		<0.50					<0.50				
	9/28/1995				832.77		0.61		2.6					1.3				
	7/18/1996				832.93	5.9												
	7/10/1997				833.81	6.9												
	1/30/1999				832.59	5.1												
	4/21/1999				833.58	21	0.46		3					4.4				
	7/28/1999				832.89	5.7												
	10/11/1999				832.42	3.8												
	1/31/2000				832.23	6.8												
	1/2/2001				832.59	4.2	<0.12		<0.23					<0.43				
	4/26/2001				834.18	5.9	0.33		10					5.8				
	10/19/2001				833.35	4.1	0.13		<0.23					<0.43				
	4/12/2002				834.85	2.7	0.314		0.408					3.6				
	11/26/2002				833.09	3.6	0.174		0.158					0.382				
	4/23/2003				834.53	4.3	0.2		1.7					4.4				
	10/3/2003				832.61	3.5	<0.053							<0.21				
5/14/2004			833.75	3.5	<0.037		<0.053					0.4						
8/18/2005			831.93	3.9	<0.068		<0.085					0.44						
11/8/2005			832.41	3.5	0.37		<0.35					<0.53						
2/13/2006			832.50	2.6	<0.048		<0.11					<0.17						
5/9/2006			832.85	3.0	<0.16		<0.35					0.9						
MW-13	6/24/1993	830.32	17.66	812.66	1.7	0.31		0.13					<0.1					
	10/27/1993		27.25	803.07		1.1		0.39										
	3/28/1994		26.62	803.77		0.54		<0.50						<0.50				
	10/4/1994					0.59		<0.1										
	3/8/1995					<0.50		<0.50						<0.50				
	9/28/1995		27.53	802.79		<0.50		<0.50						<0.50				
	7/18/1996		26.51	803.81	7.9													
	7/10/1997		25.42	804.90	7.4													
	1/30/1999		28.42	801.90	9.4													
	4/21/1999		26.82	803.55	13	0.27		-						0.95				
7/28/1999	21.03	809.29	18															

TABLE 2
FLUID LEVELS AND GROUNDWATER ANALYTICAL DATA
 River Country Cooperative
 1080 West River Road
 Chippewa Falls, Wisconsin

Well ID	Sample Date	Top of Casing (TOC) Elevation (ft above MSL)	Depth to Groundwater (feet below TOC)	Groundwater Elevation (ft above MSL)	NO ₃ (mg/L)	Atrazine (Total) (µg/L)	Acetochlor (µg/L)	Alachlor (µg/L)	Butylate (µg/L)	Cyanazine (µg/L)	Dimethenamid (µg/L)	EPTC (µg/L)	Metolachlor (µg/L)	Metribuzin (µg/L)	Prometon (µg/L)	Propazine (µg/L)	Simazine (µg/L)	Trifluralin (µg/L)	
MW-13 (cont.)	10/11/1999	830.32	27.18	803.14	11														
	1/31/2000		28.01	802.31	13														
	1/2/2001		28.56	801.76	6.4	0.13		<0.23						0.49					
	4/26/2001		17.63	812.69	6.4	<0.099		<0.23						<0.43					
	10/19/2001		27.43	802.89	10.0	0.16		<0.23						<0.43					
	4/12/2002		13.13	817.19	9.1	0.18		<0.028						0.634					
	11/26/2002		26.31	804.01	9.8	0.204		<0.028						0.309					
	4/23/2003		18.08	812.24	6.0	<0.060		<0.11						<0.28					
	10/3/2003		28.25	802.07	12.0	<0.037		<0.053						<0.21					
	5/14/2004		23.19	807.13	6.9	<0.037		<0.053						0.85					
	8/18/2005		28.26	802.06	8.2	<0.068		<0.085						<0.22					
	11/8/2005		3.96	826.36	6.0	<0.16		<0.35						<0.53					
	2/13/2006		27.05	803.27	5.5	0.075		<0.11						<0.17					
	5/9/2006		26.55	803.77	4.8	<0.16		<0.35						<0.53					
6/18/2009	23.48	806.84	5.1	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
MW-14	6/24/1993	825.23	11.72	813.51	0.5	0.51		<0.1					<0.1						
	10/27/1993		22.10	803.13		1.42		<0.2											
	3/28/1994		21.62	803.61		0.74		<0.50						<0.50					
	10/4/1994					1.01		<0.1											
	3/8/1995					<0.50		<0.50						<0.50					
	9/28/1995		22.43	802.80		0.67		<0.50						<0.50					
	7/18/1996		21.42	803.81	7														
	7/10/1997		20.52	804.71	4.5														
	1/30/1999		23.25	801.98	5.6														
	4/21/1999		21.70	803.53	5.5	0.54		-						-					
	7/28/1999		16.00	809.23	8.4														
	10/11/1999		22.25	802.98	5.8														
	1/31/2000		23.01	802.22	6.3														
	1/2/2001		23.46	801.77	5	0.27		<0.23						<0.43					
	4/26/2001		12.69	812.54	3.9	<0.099		<0.23						<0.43					
	10/19/2001		22.34	802.89	6.1	0.25		<0.23						<0.43					
	4/12/2002		8.08	817.15															
	11/26/2002		21.24	803.99															
	4/23/2003		13.08	812.15															
	10/3/2003		23.17	802.06															
5/14/2004	18.33	806.50																	
11/8/2005	21.14	804.09																	
2/13/2006	22.13	803.10																	
6/18/2009	22.50	802.73	4.1	0.199	-	-	-	-	-	-	-	0.72	-	-	-	-	-		
MW-15	1/30/1999			828.68	-	5.6		0.66					5.80						
	4/21/1999			829.31	1.1														
	7/28/1999			828.51	-														
	10/11/1999			828.21	0.2														
	1/31/2000			827.95															
	1/2/2001			828.26	1	0.21		<0.23					<0.43						

TABLE 2
FLUID LEVELS AND GROUNDWATER ANALYTICAL DATA
 River Country Cooperative
 1080 West River Road
 Chippewa Falls, Wisconsin

Well ID	Sample Date	Top of Casing (TOC) Elevation (ft above MSL)	Depth to Groundwater (feet below TOC)	Groundwater Elevation (ft above MSL)	NO ₃ (mg/L)	Atrazine (Total) (µg/L)	Acetochlor (µg/L)	Alachlor (µg/L)	Butylate (µg/L)	Cyanazine (µg/L)	Dimethenamid (µg/L)	EPTC (µg/L)	Metolachlor (µg/L)	Metribuzin (µg/L)	Prometon (µg/L)	Propazine (µg/L)	Simazine (µg/L)	Trifluralin (µg/L)
MW-15 (cont.)	4/26/2001			829.50	6.8	<0.099		<0.23					<0.43					
	10/19/2001			828.88	2.2	0.19		<0.23						<0.43				
	4/12/2002			829.74														
	11/26/2002			828.88														
	4/23/2003			829.58														
	10/3/2003			827.26														
	5/14/2004			827.68														
	11/8/2005			827.02														
2/13/2006		827.08																
MW-16	10/11/1999	839.11	18.93	820.18	8.8													
	1/2/2001		18.01	821.10	7.8	0.22		<0.23						<0.43				
	4/26/2001		15.05	824.06	2.4	<0.099		<0.23						<0.43				
	10/19/2001		16.72	822.39	9.3	0.16		<0.23						<0.43				
	4/12/2002		15.10	824.01	2.7	<0.014		<0.028						<0.03				
	11/26/2002		17.50	821.61	6.5	0.212		<0.028						0.276				
	4/23/2003				2.6	<0.060		<0.11						<0.28				
	10/3/2003		17.78	821.33	9.2	0.23		<0.053						<0.21				
	5/14/2004		15.67	823.44	6.3	<0.037		<0.053						<0.21				
	8/18/2005		17.69	821.42	6.7	<0.068		<0.065						<0.22				
	11/8/2005		3.74	835.37	7.7	<0.16		<0.35						<0.53				
	2/13/2006		18.00	821.11	6.1	0.08		<0.11						<0.17				
	5/9/2006		16.69	822.42	4.5	<0.16		<0.35						<0.53				
6/18/2009	13.20	825.91	3.5	0.04	-	-	-	-	-	-	-	0.18	-	-	-	-		
MW-17	5/14/2004	837.03	6.64	830.39	1.7	<0.037		<0.053					<0.21					
	8/18/2005		7.79	829.24	1.0	<0.068		<0.085					<0.22					
	11/8/2005		0.61	836.42	0.9	<0.16		<0.35					<0.53					
	2/13/2006		7.47	829.56	0.6	<0.046		<0.11					<0.17					
	5/9/2006		6.82	830.21	1.1	<0.16		<0.35					<0.53					
	6/18/2009		5.98	831.05	1.2	-	-	-	-	-	-	-	-	-	-	-	-	
Hill	6/18/2009	-	-	-	7.1	0.8	0.21	2.9	0.24	-	0.17	1.40	16	-	-	-	-	
Manhole	6/18/2009	-	-	-	1.2	0.12	-	-	-	-	-	0.61	-	-	-	-		

Definitions/Abbreviations:
 ID = Identification "- " = Less than the laboratory reporting limit indicated.
 MSL = Mean Sea Level blank cell = Not sampled or analyzed.
 NO₃ = Nitrates/Nitrites by EPA Test Method 353.2 J = Estimated Value
 Pesticides = Analyzed by EPA Test Method Modified 8270 NE = Not established.
 na = Not applicable.

Notes:
BOLD = Exceeds NR 140 Enforcement Standard (ES)
Italics = Exceeds NR 140 Preventive Action Limit (PAL)

Table 3
Groundwater Elevations
River Country Cooperative
Chippewa Falls, Wisconsin

Sample Date	Monitoring Wells						Gradient Direction	Gradient Slope
	MW-10	MW-11	MW-12	MW-13	MW-14	MW-15		
10/20/1992		829.67						
6/24/1993	831.83	827.70	834.57	812.66	813.51			209 0.027
10/27/1993	830.17	825.76	833.20	803.07	803.13			208 0.029
3/28/1994	829.46	825.77	832.88	803.77	803.61			202 0.025
9/28/1995	829.94	825.76	832.77	802.79	802.80			209 0.027
7/18/1996	830.03	826.26	832.93	803.81	803.81			206 0.025
7/10/1997	829.18	828.55	833.81	804.90	804.71			
1/30/1999	829.94	825.06	832.59	801.90	801.98	828.68		213 0.032
4/21/1999	831.20	827.18	833.58	803.55	803.53	829.31		211 0.026
7/28/1999	830.13	826.66	832.89	809.29	809.23	828.51		205 0.023
10/11/1999	829.69	825.31	832.42	803.14	802.98	828.21	820.18	210 0.029
1/31/2000	829.34	825.29	832.23	802.31	802.22	827.95		207 0.027
1/20/2001	829.81	825.28	832.59	801.76	801.77	828.26	821.10	210 0.03
4/26/2001	831.53	828.24	834.18	812.69	812.54	829.50	824.06	205 0.022
10/19/2001	828.56	826.78	833.35	802.89	802.89	828.88	822.39	167 0.018
4/12/2002	831.62	828.83	834.85	817.19	817.15	829.74	824.01	194 0.02
11/26/2002	830.27	825.98	833.09	804.01	803.99	828.68	821.61	209 0.028
4/23/2003	831.54	828.36	834.53	812.24	812.15	829.58		202 0.021
10/3/2003	829.88	826.14	832.61	802.07	802.06	827.26	821.33	207 0.025
5/14/2004	830.53	828.70	833.75	807.13	806.90	827.68	823.44	168 0.013
8/18/2005	829.32	825.75	831.93	802.06			821.42	166 0.012
11/8/2005	829.48	825.76	832.41		804.09	827.02		167 0.0119
2/13/2006	829.60	825.99	832.50	803.27	803.10	827.08	821.11	171 0.0114
5/9/2006	830.48	828.89	832.85	803.77			822.42	
6/18/2009	830.74	827.07		806.84	802.73		825.91	161 0.02

